
# Vol. 3 of 5 FEP-02/457/2013/C Central Kowloon Route Yau Ma Tei East Contract No. HY/2014/08 April 2020





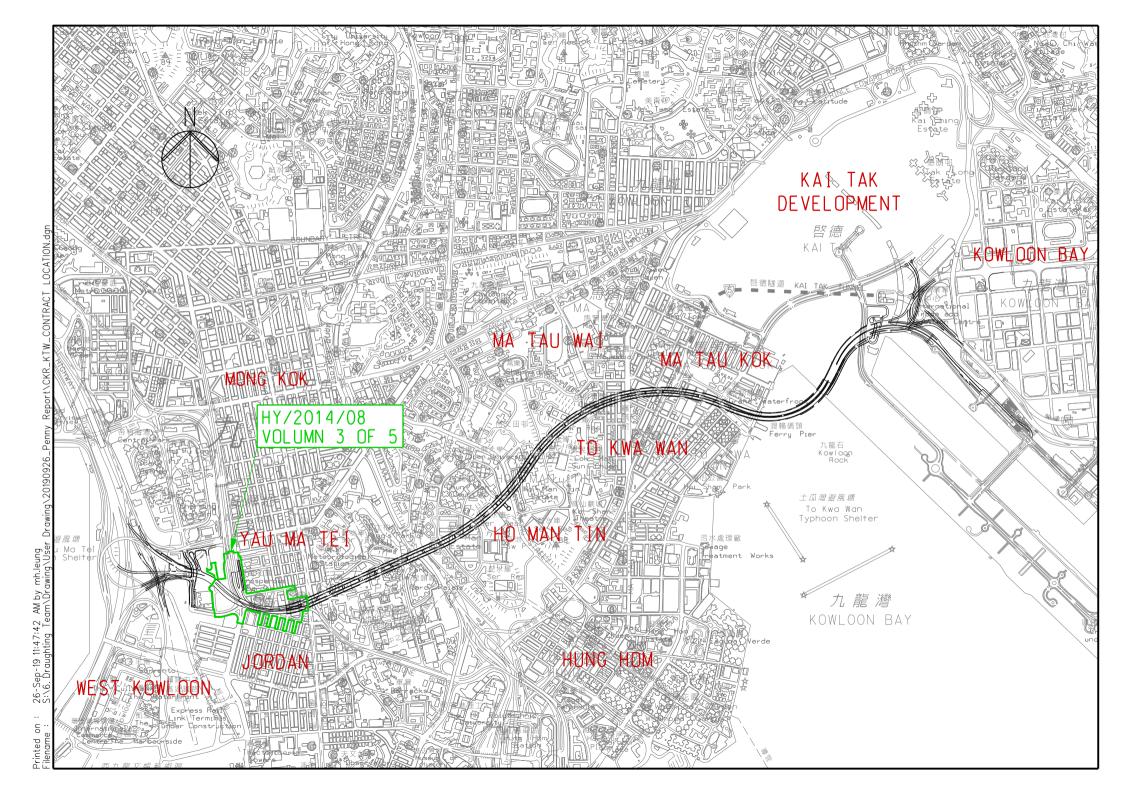

### Environmental Permit No. EP-457/2013/C

### Central Kowloon Route

### **Independent Environmental Checker Verification**

Reference Document/Plan	
Document/ <del>Plan</del> to be <del>Certified</del> / Verified:	Monthly EM&A Report No.25 (April 2020)
Date of Report:	16 May 2020 (Rev.2)
Date received by IEC:	16 May 2020

Yau Ma Tei East (HY/2014/08)

### **Reference EP Condition**

**Works Contract:** 

Environmental Permit Condition: 3.4

Submission of Monthly EM&A Report of the Project

3.4 Four hard copies and one electronic copy of monthly EM&A Report shall be submitted to the Director within 2 weeks after the end of each reporting month throughout the entire construction period. The EM&A Reports shall include a summary of all non-compliance. The submissions shall be certified by the ET Leader and verified by the IEC as complying with the requirements as set out in the EM&A Manual before submission to the Director. Additional copies of the submission shall be provided to the Director upon request by the Director.

### **IEC Verification**

Mondy 20.

I hereby verify that the above referenced document/<del>plan</del> complies with the above referenced condition of EP-457/2013/C.

Ms Mandy To Date: 18 May 2020

Independent Environmental Checker

Our ref: 0436942\_IEC Verification Cert\_YMTE\_Monthly EM&A Rpt No.25b.docx



## Acuity Sustainability Consulting Limited

Unit C, 11/F, Ford Glory Plaza, No. 37-39 Wing Hong Street, Cheung Sha Wan Kowloon, Hong Kong Tel.: (852) 2698 6833 Fax.: (852) 2333 1316

# Build King - SKEC Joint Venture

# Central Kowloon Route Contract HY/2014/08 Section of Yau Ma Tei East

Monthly EM&A Report No. 25

(Period from 1 to 30 April 2020)

Rev. 2

(16 May 2020)

		Name	Signature
Prepared by		Sally H.S. Mok (Assistant Environmental Consultant)	MHS.
Checked Reviewed by	&	Nelson T. H. Tsui (Senior Environmental Consultant)	74
Approved & Certified by	&	Kevin W. M. Li (Environmental Team Leader)	X:

### TABLE OF CONTENTS

### **EXECUTIVE SUMMARY**

1.	BASIC PROJECT INFORMATION	7
2.	ENVIRONMENTAL STATUS	9
3.	MONITORING RESULTS	.11
4.	SUMMARY OF COMPLAINTS, NOTIFICATION OF SUMMONS AND PROSECUTIONS	20
5.	EM&A SITE INSPECTION	22
6.	FUTURE KEY ISSUES	23
7.	CONCLUSION AND RECOMMENDATIONS	24

### LIST OF APPENDICES

- A. Alignment and Works Area for the Contract No. HY/2014/08
- B. Construction Programme
- C. Project Organization Chart
- D. Dust Event-Action Plan (EAP)
- E. Noise Event-Action Plan (EAP)
- F. Environmental Mitigation Implementation Schedule (EMIS)
- G. Monitoring Schedules of the Reporting Month
- H. Calibration Certificate (Air Monitoring)
- I. Calibration Certificate (Noise)
- J. The Certification of Laboratory with HOKLAS Accredited Analytical Tests
- K. Location Plan of Noise and Air Quality Monitoring Station
- L. Monitoring Data (Air Monitoring)
- M. Monitoring Data (Noise)
- N. Waste Flow Table
- O. Statistics on Complaint, Notifications of Summons and Successful Prosecutions
- P. Monitoring Schedule of the Coming Month
- Q. Interim Report for the Complaint

### **EXECUTIVE SUMMARY**

- A.1 Build King SKEC Joint Venture ("Contractor") commenced the construction works of Highway Department (HyD) Central Kowloon Route Contract No. HY/2014/08 Section of Yau Ma Tei East ("The Project") on 20 April 2018. This is the 25<sup>th</sup> monthly Environmental Monitoring and Audit (EM&A) report presenting the EM&A works carried out during the period from 1 April 2020 to 30 April 2020.
- A.2 A summary of the construction works reported by Main Contractor for the Project during the reporting month is listed below.

### **Construction Activities undertaken**

- Construct Roof Slab/Lintel Beam, excavate soil below roof slab and install ELS L7 & L8 at Zone E (Access Shaft)
- Install 406mm pipe piles at Yau Ma Tei Police Station (YMTPS)
- Architectural Builders Works and Finishes (ABWF) and Building Services (BS) Works including Lift Installation and T&C Works at Temporary Public Library Cum Jade Hawker Bazaar Building (TPLCJHB)
- Construction of Ceiling Slab at Zone A
- Excavation below Ceiling Slab to Formation Level at Zone A
- Construction of Stage 1 D-wall panels at Zone B
- Construction of Stage 1 D-wall panels at Zone C
- A.3 A summary of regular construction noise and construction dust monitoring activities in this reporting period is listed below:

### Regular construction noise monitoring during normal working hours

W-N1A, W-N18, W-P11 6 times W-N25A 5 times W-N25A-T 1 time

Construction dust (24-hour TSP) monitoring

W-A1 6 times W-A6 6 times

Construction dust (1-hour TSP) monitoring

W-A1,W-A6 18 times

- A.4 Noise monitoring station at Prosperous Garden Block 1 (W-N25A) was temporarily suspended from 24 March 2020 to 6 April 2020, due to a case of novel coronavirus infection at the Prosperous Garden Block 4. Temporary alternative noise monitoring location, W-N25A-T was used to conduct noise monitoring on 3 April 2020. Details of temporary alternative monitoring location are presented in Temporary Alternative Proposal for Monitoring Station as proposed by ET and agreed by IEC dated 27 March 2020.
- A.5 Bi-weekly inspection of the implementation of landscape and visual mitigation measures was conducted on 2, 16, 29 April 2020. Details of the audit findings and implementation status are presented in Section 5.

- A.6 Joint weekly site inspections were conducted by representatives of Environmental Team (ET), Contractor and Engineer on 2, 9, 16, 23, 29 April 2020. One joint site inspection with IEC was also undertaken on 9 April 2020. Details of the audit findings and implementation status are presented in Section 5.
- A.7 Details of waste management are presented in Section 3.
- A.8 One Action Level of construction noise was triggered during the reporting period as there was one documented complaint received on 27 April 2020 related to construction noise at access shaft underground working area at Zone E. No exceedance of the Limit Level of 24-hour TSP, 1-hour TSP and construction noise monitoring were recorded during the reporting month.
- A.9 One environmental complaint was received on 27th April 2020 regarding noise nuisance at the access shaft underground working area in Zone E during restricted hours. Investigation with the Contractor reflected that all required noise mitigation measures for working in restricted hours, as stipulated in the EM&A Manual and CNP, were implemented. The interim report for the complaint is shown in Appendix Q.
- A.10 No non-compliance was received in the reporting month.
- A.11 No notification of summon or prosecution was received in this reporting month.
- A.12 A summary of the construction activities provided by Main Contractor in the next reporting month is listed below:

### **Construction Activities to be undertaken**

- Complete construction of lintel beam during the reporting period at Zone E(Access Shaft)
- Continue excavation below roof slab including installation of ELS (L7) at Zone E(Access Shaft)
- Removal of temporary D-wall and commence construction of underpinning walls at Zone E(Access Shaft)
- Continue pumping test (stage 2) and excavation below ceiling slab at Zone A
- Continue predrilling works, guide wall construction, D-wall construction and utility diversion at Zone B
- Complete jacking works (as remedial works) and resume Pipe Piling Works at YMTPS
- Continue D-wall construction at Zone C
- Backfill and sub-structure works at TPLCJHB
- Erect hoarding at existing TPLCJHB
- Continue for ABWF, BS works drainage works at TPLCJHB
- Continue external drainage work for TPLCJHB along Kansu Street
- T&C for Lift at TPLCJHB
- Monitoring of instrumentation for all areas

### 1. BASIC PROJECT INFORMATION

- 1.1. Central Kowloon Route (CKR) is a 4.7 km long dual 3-lane trunk road in Central Kowloon linking Yau Ma Tei Interchange in West Kowloon with the road network on Kai Tak Development and Kowloon Bay in East Kowloon.
- 1.2. The Central Kowloon Route Design and Construction Environmental Impact Assessment Report (Register No.: AEIAR-171/2013) was approved with conditions by the Environmental Protection Department (EPD) on 11 July 2013. An Environmental Permit (EP 457/2013) was issued on 9 August 2013. Variations of EP (VEP) was subsequently applied for and the latest EP (EP-457/2013/C) was issued by EPD on 16 January 2017. A Further EP (FEP-02/457/2013/C) was issued by EPD on 5 March 2018.
- 1.3. The construction of the CKR had been divided into different sections. This Contract No. HY/2014/08 Section of Yau Ma Tei East (YMTE) covers part of the construction activities located at Yau Ma Tei under the EP and FEP which includes:
  - Section of Yau Ma Tei East
  - i. Construction of Cut-and-Cover Tunnel in compliance with all statutory requirements and the requirements specified under the Contract while maintaining the traffic with all necessary provisions
  - ii. Construction and subsequent handover of Yau Ma Tei Access Shaft for facilitating the access and use by the contractor of Central Kowloon Route Central Tunnel contract
  - iii. Demolition of existing buildings including Yau Ma Tei Multi-storey Carpark Building, Yau Ma Tei Specialist Clinic Extension Building and Yau Ma Tei Jade Hawker Bazaars
  - iv. Demolition and re-provisioning of Gascoigne Road Flyover(GRF) and the underpinning works for the existing Ferry Street Flyover and Yau Ma Tei Police Station New Wing Building
  - v. Construction of civil provisions and coordination with the contractor of Central Kowloon Route Tunnel Electrical & Mechanical contract
  - vi. Design and construction of Noise Barrier Works
  - vii. Prepare TTA proposals, discuss at TMLG meeting and obtain its agreement and approval/ endorsement from relevant authorities at suitable times to enable the execution of the Works

The alignment and works area for the Contract No. HY/2014/08 - are shown in Appendix A.

1.4. A summary of the major construction activities undertaken in this reporting period is shown in Table 1.1. The construction programme is presented in Appendix B.

Table 1.1 Summary of the construction activities reported by Main Contractor during the Reporting Month

### **Construction Activities undertaken**

- Construct Roof Slab/Lintel Beam, excavate soil below roof slab and install ELS L7 & L8 at Zone E (Access Shaft)
- Install 406mm pipe piles at YMTPS
- ABWF and BS Works including Lift Installation and T&C Works at TPLCJHB
- Construction of Ceiling Slab at Zone A
- Excavation below Ceiling Slab to Formation Level at Zone A
- Construction of Stage 1 D-wall panels at Zone B
- Construction of Stage 1 D-wall panels at Zone C
- 1.5. The project organisational chart specifying management structure and contact details are shown in Appendix C.
- 1.6. A summary of the valid permits, licences, and /or notifications on environmental protection for this Project is presented in Table 1.2

Table 1.2 Summary of the Status of Valid Environmental Licence, Notification, Permit and Documentations

Permit/ Licences/	Valid	Period		
Notification /Reference No.	From	То	Status	Remark
<b>Environmental Permit</b>				
EP-457/2013/C	23 Apr 2019	End of Project	Valid	-
<b>Further Environmental 1</b>	Permit			·
FEP-02/457/2013/C	5 Mar2018	End of Project	Valid	
Wastewater Discharge Li	cense			
WT00030660-2018	28 Mar 2018	31 Mar 2023	Valid	-
<b>Notification of Constructi</b>	on Works under	the Air Pollution	Control (Construct	tion Dust) Regulation
429806	18 Jan 2018	End of Project	Notified	-
<b>Chemical Waste Produce</b>	r Registration			
WPN5213-225-B2526-01	14 March 2018	End of Project	Valid	-
<b>Billing Account for Dispo</b>	sal of Constructi	on Waste		
7029997	1 Feb 2018	End of Project	Valid	-
<b>Construction Noise Permi</b>	it	<u> </u>		•
GW-RE0210-20	28 Mar 2020	23 Sep 2020	Valid	Construction Noise Permit at Zone C
GW-RE0130-20	13 Mar 2020	15 Jun 2020	Valid	Construction Noise Permit at Zone E
GW-RE1068-19	31 Dec 2019	30 Jun 2020	Valid	Construction Noise Permit at Zone A, B & MCHC.
GW-RE0190-20	20 Mar 2020	19 Jun 2020	Valid	Construction Noise Permit at Temporary Library
GW-RE0830-19	19 Oct 2019	18 Apr 2020	Valid	Construction Noise Permit at Methadone Clinic
Marine Dumping Permit				
EDA (D. /20. 125	20.16 2022	10 4 2020	Valid until	Sediments requiring Type
EP/MD/20-135	20 Mar 2020	19 Apr 2020	19 Apr 2020	1- Dedicated Site and
ED 4 (D /20 474	22 4 2020	21.16 2020		Type 2 - Confined Marine
EP/MD/20-151	22 Apr 2020	21 May 2020	Valid	Disposal
EP-MD-20-095	7 Dec 2019	6 Jun 2020	Valid	Sediments requiring Type 1- Open Sea Disposal

### 2. ENVIRONMENTAL STATUS

2.1. Environmental permit (EP) conditions under the EIAO, submission status under the EP and implementation status of mitigation measures had been reviewed and implemented on schedule. The status of required submissions under the EP (EP-457/2013/C) and FEP (FEP-02/457/2013/C) as of the reporting period for the Project are summarised in Table 2.1

Table 2.1 Summary of Status of Required Submission for EP-457/2013/C and FEP-02/457/2013/C for the Project

EP/FEP Condition (EP-457/2013/C) (FEP-02/457/2013/C)	Submission	Submission date
Condition 1.12	Notification of Commencement Date of Construction of the Project	20 Mar 2018
Condition 2.3	Community Liaison Group	23 Nov 2017
Condition 2.4	Management organisation of the main construction companies	9 Feb 2018
Condition 2.5	Construction Programme and EP Submission Schedule	26 Feb 2018
Condition 2.6	Design Drawing	26 Feb 2018
Condition 2.7	Cultural Heritage Mitigation Plan	5 Oct 2019
Condition 2.8	Landscape Mitigation Plan	9 Mar 2018
Condition 2.9	Construction Noise Mitigation Measure Plan (CNMMP)	28 Feb 2020
Condition 3.3	Baseline Monitoring Report	6 Apr 2018
Condition 3.4	Monthly EM&A Report (Mar 2020)	14 Apr 2020

2.2. Details of the major construction activities reported by Main Contractor in this reporting period are shown in Table 2.2.

Table 2.2 Summary of the construction activities reported by Main Contractor during the Reporting Month.

Co	nstruction activities undertaken	Remarks on progress
•	Construct Roof Slab/Lintel Beam, excavate soil below roof slab and	•75% completion
	install ELS L7 & L8 at Zone E (Access Shaft)	
•	Install 406mm pipe piles at YMTPS	•2% completion
•	ABWF and BS Works including Lift Installation and T&C Works at	•80% completion
	TPLCJHB	
•	Construction of Ceiling Slab at Zone A	•Completed
•	Excavation below Ceiling Slab to Formation Level at Zone A	•16% completion
•	Construction of Stage 1 D-wall panels at Zone B	•50% completion

	Construction activities undertaken	Remarks on progress
•	Construction of Stage 1 D-wall panels at Zone C	●6% completion

2.3. The drawing showing the the project layout and the location of the monitoring station and environmental sensitive receivers are attached in Appendix A and Appendix K. Co-ordinates of the monitoring location and temporary alternative monitoring location are shown in Table 2.3 and Table 2.4 respectively:

Table 2.3 Summary for the location of the monitoring station

<b>Monitoring Location</b>	<b>Location ID</b>	Latitude	Longitude
Yau Ma Tei Catholic Primary School (Hoi Wang Road)	W-A1/ W-N1A	22.313357	114.16409
Man Cheong Building	W-A6	22.308185	114.166033
Hydan Place	W-N18	22.30858	114.170185
Prosperous Garden Block 1	W-N25A	22.309846	114.168072
The Coronation Tower 1	W-P11	22.309824	114.165616

Table 2.4 Summary for the location of the temporary alternative monitoring station

<b>Monitoring Location</b>	<b>Location ID</b>	Latitude	Longitude
Roadside in front of Prosperous Garden Block 1	W-N25A-T	22.309733	114.167993

### 3. MONITORING RESULTS

3.1. Monitoring Parameters

### **Air Quality**

- 3.1.1. The impact monitoring had been carried out in accordance with section 5.8 of the approved EM&A Manual to determine the 1-hour and 24-hour total suspended particulates (TSP) levels at the monitoring locations in the reporting month.
- 3.1.2. The sampling frequency of at least once in every 6 days, shall be strictly observed at the monitoring stations for 24-hour TSP monitoring. For 1-hour TSP monitoring, the sampling frequency of at least 3 times in every 6 days should be undertaken when the highest dust impact occurs.
- 3.1.3. General meteorological conditions (wind speed, direction and precipitation) and notes regarding any significant adjacent dust producing sources had also been recorded throughout the impact monitoring period.

### **Noise**

- 3.1.4. Construction noise level shall be measured in terms of the A-weighted equivalent continuous sound pressure level ( $L_{eq}$ ). Leq (30min) shall be used as the monitoring parameter for the time period between 0700 and 1900 hours on normal weekdays.
- 3.1.5. For all other time periods, Leq (5min) shall be employed for comparison with the Noise Control Ordinance (NCO) criteria.
- 3.1.6. As supplementary information for data auditing, statistical results such as  $L_{10}$  and  $L_{90}$  shall also be obtained for reference.
- 3.2. Monitoring Equipment

### **Air Quality**

- 3.2.1. 1-hour TSP levels and 24-hour TSP had been measured with direct reading dust meter and High Volume Samplers respectively. It has been demonstrated its capability in achieving comparable results with high volume sampling method as set out in the Title 40 of the Code of Federal Regulations, Chapter 1 (Part 50).
- 3.2.2. The 1-hour TSP meter was calibrated by the manufacturer prior to purchasing. Zero response of the instrument was checked before and after each monitoring event. Operation of the 1-hour TSP meter followed manufacturer's Operation and Service Manual. The 24-hour TSP meter was calibrated against firmware 80570-8100-V1.0.4, annually. Operation of the 24-hour TSP meter followed manufacturer's Operation and Service Manual. Valid calibration certificate of dust monitoring equipment is attached in Appendix H.
- 3.2.3. A summary of the equipment that was deployed for the 24- hour averaged monitoring is shown in Table 3.1. The TSP monitoring was conducted as per the schedule presented in Appendix G.

3.2.4. The equipment used for 1-hour TSP and 24-hour TSP measurement and calibration are summarised in Table 3.1

Monitoring Parameter	Monitoring Equipment	Serial Number	Date of Calibration	
1-hour TSP	LD-5R Digital Dust Indicator	992818	3 Sep 2019	
1-hour TSP	LD-5R Digital Dust Indicator	851820	23 Aug 2019	
24-hour TSP	TE-5170X High Volume	1049	21 Mar, 8, 25 Apr	
	Sampler		2020	
	TE-5170X High Volume	1050	21 Mar, 8, 25 Apr	
	Sampler		2020	
	TE-5028A Calibration Kit	3702	10 Oct 2019	

Table 3.1 Construction Dust Monitoring Equipment

### **Noise**

- 3.2.5. Sound level meter in compliance with the International Electrotechnical Commission Publications 651: 1979 (Type 1) and 804: 1985 (Type 1) specifications has been used for carrying out the noise monitoring. The sound level meter has been checked using an acoustic calibrator. The wind speed and other metrological data has been recorded from Hong Kong Observatory- King's Park meteorological station, along with portable wind speed meter stand by as back up if malfunction occurred or data was not recorded from HKO.
- 3.2.6. An acoustic calibrator and sound level meter using for the monitoring is within the valid period and were calibrated per year. Valid calibration certificate of noise monitoring equipment is attached in Appendix I.
- 3.2.7. The details of equipment using for monitoring are listed in Table 3.2, as below:

<b>Monitoring Equipment</b>	Serial Number	Date of Calibration
Nti XL2 Sound Level Meter	A2A-13663-E0	12 Sep 2019
Nti XL2 Sound Level Meter	A2A-13548-E0	10 Jan 2020
Pulsar 105 Acoustic Calibrator	63705	28 Sep 2019

Table 3.2 Monitoring Equipment Used in Monitoring

### 3.3. Monitoring Methodology and QA/QC results

### **Air Quality**

- 3.3.1. The 1-hour TSP monitor, portable dust meters (Sibata Digital Dust Indicator Model LD-5R) was used for the impact monitoring. The 1-hour TSP meters provides a real time 1-hour TSP measurement based on 90° light scattering. Three 1-hour TSP level were logged per every six days.
- 3.3.2. The 24-hour TSP monitor, High Volume Samplers (Tisch TE-5170X High Volume Air Sampler) were used for the impact monitoring. The 24-hour TSP monitoring consists of the following:

- ◆ The HVS was set at the monitoring location, with electricity supply connected and secured:
- ♦ HVS was calibrated before commencing the 1<sup>st</sup> measurement;
- ◆ The filter paper was weight and provided by HOKLAS lab (Acumen Laboratory and Testing Limited and ALS Technichem (HK) Pty Ltd) before and after the sampling. Certificate of HOKLAS accredited laboratory can be referred to Appendix J;
- The airflow over time during sampling process was recorded by the HVS.

# 3.3.3. HVSs were free-standing with no obstruction. The following criteria were considered in the installation of the HVS:

- ◆ Appropriate support to secure the samples against gusty wind needed to be provided the monitoring station;
- ◆ A minimum of 2m separation from walls, parapets and penthouses was required for rooftop samplers;
- ◆ No furnace or incinerator flues was nearby;
- ♦ Airflow around the sampler was unrestricted; and
- ◆ Permission could be obtained to set up the samplers and gain access to the monitoring station.

### 3.3.4. Preparation of Filter Papers

- Glass fiber filters were labelled and sufficient filters that were clean and without pinholes were selected;
- ◆ All filters were equilibrated in the conditioning environment for 24 hours before weighing. The conditioning environment temperature was around 25°C and not varied by more than ±3°C; the relative humidity (RH)was 40%; and
- ◆ Acumen Laboratory and Testing Limited and ALS Technichem (HK) Pty Limited, as HOKLAS accredited laboratory, implemented comprehensive quality assurance and quality control programmes on the filters.

### 3.3.5. Field Monitoring

- The power supply was checked to ensure that the HVS was working properly;
- The filter holder and area surrounding the filter were cleaned;
- ◆ The filter holder was removed by loosening the foul bolts and a new filter, with stamped number upward, on a supporting screen was aligned carefully;
- ◆ The filter was properly aligned on the screen so that the gasket formed an airtight seal on the outer edges of the filter;
- ◆ The swing bolts were fastened to hold the filter holder down to the frame. The pressure applied should be sufficient to avoid air leakage at the edges;
- ◆ The shelter lid was closed and secured with an aluminum strip;
- ◆ The HVS was warmed- up for about 5 minutes to establish run- temperature conditions;
- ◆ A new flow rate record sheet was inserted into the flow recorder;
- ◆ The flow rates of the HVS was checked and adjusted to between 1.22-1.37 <sup>m³min-³</sup>, which was within the range specified in the EM&A Manual (i.e. 0.6- 1.7 <sup>m³min-³</sup>);

- ◆ The programmable timer was set for a sampling period of 24 hours ±hour, and the starting time, weather condition and filter number were recorded;
- ◆ The initial elapsed time was recorded;
- ◆ At the end of sampling, the sampled filter was removed carefully and folded in half so that only surfaces with collected particulate matter were in contact;
- ◆ The filter paper was placed in a clean plastic envelope and sealed; all monitoring information was recorded on a standard data sheet and
- ◆ The filters were sent to (Acumen Laboratory and Testing Ltd and ALS Technichem (HK) Pty Ltd) for analysis.

### 3.3.6. Maintenance and Calibration

- ◆ The HVS and their accessories were maintained in a good working condition. For example, motor brushes were replaced routinely and electrical wiring was checked to ensure a continuous power supply; and
- ◆ The flow rate of each HVS with mass flow controller was calibrated using an orifice calibrator, Initial calibrations of the dust monitoring equipment were conducted upon installation and prior to commissioning. Five- point calibration was carried out for HVS using TE-5025 Calibration Kit. HVS is calibrated bimonthly. The calibration records for the HVS is given in Appendix H.

### 3.3.7. Wind Data Monitoring

◆ The wind speed has been recorded from Hong Kong Observatory- King's Park meteorological station, along with portable wind speed meter stand by as back up if malfunction occurred or data was not recorded from HKO

### Noise

- 3.3.8. All noise measurements by the meter were set to FAST response and on the A-weighted equivalent continuous sound pressure level (L<sub>eq</sub>) in decibels dB(A). L<sub>Aeq(30min)</sub> was used as the monitoring metric for the time period between 0700 –1900 hours on normal weekdays. The measured noise levels were logged every 5 minutes throughout the monitoring period.
- 3.3.9. Prior to the noise measurement, the accuracy of the sound level meter was checked using an acoustic calibrator generating a known sound pressure level at a known frequency. Checking was conducted before and after the monitoring. The calibration level before and after the noise measurement is agreed to within 1.0 dB(A).
- 3.3.10. Noise measurements should not be made in presence of fog, rain, wind with a steady speed exceeding 5 ms<sup>-1</sup> or wind with gusts exceeding 10 ms<sup>-1</sup>. The wind speed was checked with a portable wind speed meter capable of measuring with speeds in ms<sup>-1</sup>.

### 3.4. Monitoring Locations

### **Air Quality**

3.4.1. During the site visit, both of the original proposed dust monitoring locations were rejected due to the condition at The Coronation was not favorable for monitoring and the

access was declined by the management office of Hong Kong Community College (HKCC) of PolyU. Two alternative air monitoring stations Yau Ma Tel Catholic Primary School (Hoi Wang Road) and Man Cheong Building had been proposed by ET and approved by IEC. 2 designated air monitoring locations were identified and agreed with IEC and EPD. Details of air monitoring stations are described in Table 3.3. The location plan of air quality monitoring stations is shown in Appendix K.

Air Quality Monitoring Station

W-A1

W-A6

Dust Monitoring
Station

Yau Ma Tei Catholic Primary School (Hoi Wang
Road)

Man Cheong Building

Table 3.3 Location of the Dust Monitoring Stations

### **Noise**

3.4.2. During the site visit, one of the original proposed noise monitoring locations Tak Cheong Building was rejected by the president of the owner's corporation. Alternative noise monitoring station Hydan place had been proposed by ET and approved by IEC. 4 noise sensitive receivers designated noise monitoring locations were identified and agreed with IEC and EPD. The designated monitoring stations are identified and access was granted by the premises. The details of noise monitoring station are described in Table 3.4 and the location plan of noise monitoring station is shown in Appendix K.

Noise Monitoring Station	Identified Noise Monitoring Station	Type of Measurement
W-N1A	Yau Ma Tei Catholic Primary School (Hoi Wang Road)	Façade
W-N18	Hydan Place	Façade
W-N25A	Prosperous Garden Block 1	Façade
W-P11	The Coronation Tower 1	Façade

Table 3.4 Noise Monitoring Stations

3.4.3. Noise monitoring station at Prosperous Garden Block 1 (W-N25A) was temporarily suspended from 24 March 2020 to 6 April 2020, due to a case of novel coronavirus infection at the Prosperous Garden Block 4. Temporary alternative noise monitoring location, W-N25A-T was used to conduct noise monitoring on 3 April 2020. Details of temporary alternative monitoring locations are presented in Temporary Alternative Proposal for Monitoring Station as proposed by ET and agreed by IEC dated 27 March 2020. The details of noise monitoring station are described in Table 3.5 and the location plan of noise monitoring station is shown in Appendix K.

Table 3.5 Temporary Alternative Noise Monitoring Station

Temporary Alternative Noise Monitoring Station	Identified Noise Monitoring Station	Type of Measurement
W-N25A-T	Roadside in front of Prosperous Garden Block 1	Free-field

- 3.5. Monitoring date, time, frequency and duration
- 3.5.1. A summary of impact monitoring duration, sampling parameter and frequency is presented in Table 3.6.

Table 3.6: Summary of Impact Monitoring Programme

Impact Monitoring	Duration	Sampling Parameter	Frequency
Dust	1-hour continuous measurement	1-hour TSP	3 times per six days
Dust	24-hour continuous sampling	24-hour TSP	Once per six days
Noise	30-minute continuous measurement	$L_{eq~30~min}, \\ L_{10}~and~L_{90}~as~reference.$	Once L <sub>eq</sub> 30 min from 0700 – 1900 per seven days

### 3.6. Result Summary

### **Air Quality**

3.6.1. According to our field observations, the major dust source identified at the designated air quality monitoring station in the reporting month are summarised in Table 3.7

Table 3.7 Observation at Dust Monitoring Station

Monitoring Station	Major Dust Source
$\mathbf{W}' = \Delta \mathbf{I}$	Nearby traffic, construction work from West Kowloon Government Offices
W-A6	Nearby traffic

- 3.6.2. Air quality impact monitoring for the reporting month was carried out on 3, 8, 14, 20, 25, 29 April 2020 at W-A6 and W-A1.
- 3.6.3. The results for 1-hour TSP and 24-hour TSP are summarized in Table 3.8 and Table 3.9. The measurement data and details of influencing factors such as weather conditions and site observation are presented in Appendix L.

Table 3.8 Summary of 1-hour TSP Monitoring Results

<b>Monitoring Location</b>	Range(µg/m³)	Action Level(μg/m3)	Limit Level(µg/m3)
W-A1	39-72	319	500
W-A6	43-64	306	500

Table 3.9 Summary of 24-hour TSP Monitoring Results

Monitoring Location	Range(µg/m³)	Action Level(μg/m3)	Limit Level(µg/m3)
W-A1	24-82	167	260
W-A6	31-100	166	260

### **Noise**

3.6.4. According to our field observations, the major noise source identified at the designated noise monitoring station in the reporting month are summarised in Table 3.10:

Table 3.10 Observation at Noise Monitoring Stations

Monitoring Station	Major Noise Source	
W-N1A	Nearby traffic, construction work from West Kowloon Government Offices, school activities	
W-N18	Nearby traffic	
W-N25A	Nearby traffic	
W-N25A-T	Nearby traffic	
W-P11	Nearby traffic	

3.6.5. The construction noise impact monitoring for the reporting month was carried out on 3, 8, 14, 20, 25, 29 April 2020. The measurement data are shown in Appendix M and summarized in Tables 3.11:

Table 3.11 Summary of Noise Monitoring Results

		1		71 1 (0150 1/1011	<u> </u>	1	
Time	Monitoring	D 4		Range, dB(A	.)		
Period	location	Parameter	$\mathbf{L}_{\mathbf{eq}}$	$L_{10}$	L <sub>90</sub>	Action Level	Limit Level#
	W-N1A		61.5-63.5	63.6-65.5	57.8-61.1		70dB(A) or 65 dB(A) during examination
hour	W-N18	- L <sub>eq 30min</sub>	67.8-70.2	70.1-72.7	64.4-67.3	When one documented complaint is received	
from 0700-19 00	W-N25A*	Ded 30mm	68.3-70.7	70.6-72.6	65.0-68.7		75dB(A)#
	W-N25A-T*		74.7	76.5	72.2		

|--|

Remarks:

- . # If works are to be carried out during restricted hours, the conditions stipulated in the construction noise permit by the Noise Control Authority have to be followed.
- 2. \*Noise monitoring station at Prosperous Garden Block 1 (W-N25A) was temporarily suspended from 24 March 2020 to 6 April 2020 due to a case of novel coronavirus infection at Prosperous Garden Block 4. Temporary alternative noise monitoring location, W-N25A-T was used to conduct noise monitoring on 3 April 2020. A correction of +3dB(A) was made to the free field measurement for W-N25A-T.

### Waste management

3.6.6. The waste generated from this Project includes inert C&D materials, and non-inert C&D materials. Non-inert C&D materials are made up of general refuse, vegetative wastes and recyclable wastes such as plastics and paper/cardboard packaging waste. Steel materials generated from the project are also grouped into non-inert C&D materials as the materials were not disposed of with other inert C&D materials. With reference to relevant handling records and trip tickets of this Project, the quantities of different types of waste generated in the reporting month are summarised in Table 3.12. Details of cumulative waste management data are presented as a waste flow table in Appendix N.

Table 3.12 Quantities of waste generated from the Project

			(	Quantity		
				Non-inert C&	D Materials	
			Others,			
			e.g.	Recy	ycled materials	S
D 1	Inert C&D	Chemical	General			
Reporting period	Materials	Waste	Refuse			
	(in 'tonnes)	(in'000 Kg)	disposed			
			at	Paper/card board		Metals
			Landfill	(in '000 Kg)	(in '000 Kg)	(in '000 Kg)
			(in			
			'tonnes)			
Apr-2020	26085.1	0.8	94.9	0.0	0.0	0.0

# 4. SUMMARY OF COMPLAINTS, NOTIFICATION OF SUMMONS AND PROSECUTIONS

4.1. The Environmental Complaint Handling Procedure is shown in below Table 4.1:

Table 4.1 Environmental Complaint Handling Procedure

Tuble 1.1 Environmental Complaint Handing 1 locedule						
Complaint Received via Project Hotline Complaint Received via 1823 or from o						
	government departments					
Contractor notify ER, ET	and IEC	ER notify Contractor, ET and IEC				
Contractor log complain	Contractor log complaint and date of receipt onto the complaint database. Contractor, ER and ET to					
	conduct investig	gation of complaint				
If complaint is considered	d not valid	If complaint is found valid				
ET or ER to reply the complainant if necessary   Contractor to identify and implement remedia.						
measures in consultation with the IEC, ET						
ER.						
The ER, ET and IEC to review the effectiveness						
of the Contractor's remedial measures and the						
updated situation; ET to undertake additional						
monitoring and audit to verify the situation						
necessary, and oversee that circumstances leading						
		to the complaint do not recur. ER to condu	_			
further inspection as necessary.						
If the complaint is referred by the EPD, the Contractor to prepare interim report on the status of the						
complaint investigation and follow-up actions stipulated above, including the details of the remedial						
measures and additional monitoring identified or already taken, for submission to EPD within the						
	_	igned by the EPD				
The ET to record the deta	The ET to record the details of the complaint, results of the investigation, subsequent actions taken to					

address the complaint and updated situation including the effectiveness of the remedial measures, supported by regular and additional monitoring results in the monthly EM&A reports

- 4.2. Should non-compliance of the criteria occur, action in accordance with the Action Plan in Appendix D and Appendix E shall be carried out.
- 4.3. No exceedance of the Action and Limit Levels of construction noise, 24-hour TSP and 1-hour TSP monitoring were recorded during the reporting month.
- 4.4. One environmental complaint was received on 27th April 2020 regarding noise nuisance at the access shaft underground working area in Zone E during restricted hours. Investigation with the Contractor reflected that all required noise mitigation measures for working in restricted hours, as stipulated in the EM&A Manual and CNP, were implemented. The interim report for the complaint is shown in Appendix Q.
- 4.5. No non-compliance was received in the reporting month.
- 4.6. No notification of summons and prosecution was received in the reporting period.
- 4.7. Statistics on complaints, notifications of summons and successful prosecutions are summarized in Appendix O.

### 5. EM&A SITE INSPECTION

- 5.1. Site inspections were carried out on a weekly basis to monitor the implementation of proper environmental pollution control and mitigation measures under the Contract. In the reporting period, five (5) site inspections were carried out on 2, 9, 16, 23, 29 April 2020 along with bi-weekly inspection of the implementation of landscape and visual mitigation measures conducted on 2, 16, 29 April 2020.
- 5.2. One joint site inspection with IEC also undertaken on 9 April 2020. Minor deficiencies were observed during weekly site inspection. Key observations during the site inspections are summarized in Table 5.1.

**Environmental Observations Date Follow-up Status** 1. A pile of trash was observed near the Good house keeping was 2 April 2020 confined space area. Good house keeping implemented in Temporary was reminded to be implemented. Library. 1. Stagnant water was observed in Zone B Stagnant water was removed in the drip tray outside temporary and 9 April 2020 in drip tray outside temporary library. library. Stagnant water has to be removed. 1. Chemicals in Zone E access shaft was 1. Chemicals were stored into 16 April 2020 observed not having drip trays under the chemical storage at Zone E. containers. 1. Bags of cement was covered on top but not Bags of cement were covered on the other 3 sides in Zone A & B. top, and other three sides (Zone 23 April 2020 2. A pool of stagnant water was observed at A &B). Zone C under the bridge. 2. Stagnant water was cleared at Zone C under the bridge, Chemical containers have to be put on drip 1. Chemical containers were put on 29 April 2020 tray in restricted area in Zone A. drip tray in restricted area in Zone A.

Table 5.1 Site Observations


- 5.3. The Contractor had rectified all observation identified during environmental site inspection in the reporting period.
- 5.4. According to the EIA Study Report, Environmental Permit, contract documents and EM&A Manual, the mitigation measures detailed in the documents are implemented as much as practical during the reporting period. An updated Implementation Status of Environmental Mitigation Measures (EMIS) is provided in Appendix F.


### 6. FUTURE KEY ISSUES

- 6.1. The construction activities provided by Main Contractor in the next reporting month are:
- Complete construction of lintel beam during the reporting period at Zone E(Access Shaft)
- Continue excavation below roof slab including installation of ELS (L7) at Zone E(Access Shaft)
- Removal of temporary D-wall and commence construction of underpinning walls at Zone E(Access Shaft)
- Continue pumping test (stage 2) and excavation below ceiling slab at Zone A
- Continue predrilling works, guide wall construction, D-wall construction and utility diversion at Zone B
- Complete jacking works (as remedial works) and resume Pipe Piling Works at YMTPS
- Continue D-wall construction at Zone C
- Backfill and sub-structure works at TPLCJHB
- Erect hoarding at existing TPLCJHB
- Continue for ABWF, BS works drainage works at TPLCJHB
- Continue external drainage work for TPLCJHB along Kansu Street
- T&C for Lift at TPLCJHB
- Monitoring of instrumentation for all areas
- 6.2. Potential environmental impacts arising from the above construction activities are mainly associated with dust, construction noise and waste management.
- 6.3. The tentative schedule of regular construction noise monitoring, 1-hour TSP and 24-hour TSP monitoring in the next reporting period is presented in Appendix P.
- 6.4. The construction programme for the Project for the next reporting month is presented in Appendix B.


### 7. CONCLUSION AND RECOMMENDATIONS

- 7.1. This 25<sup>th</sup> monthly EM&A Report presents the EM&A works undertaken during the period from 1 April 2020 to 30 April 2020 in accordance with the EM&A Manual and the requirement under EP- 457/2013/C and FEP-02/457/2013/C.
- 7.2. Air quality (including 1-hour TSP and 24-hour TSP) and noise impact monitoring were carried out in the reporting period. One Action Level of construction noise was triggered during the reporting period as there was one documented complaint received on 27 April 2020 related to construction noise at access shaft underground working area at Zone E. No exceedance of the Limit Level of 24-hour TSP, 1-hour TSP and construction noise monitoring were recorded during the reporting month.
- 7.3. Noise monitoring station at Prosperous Garden Block 1 (W-N25A) was temporarily suspended from 24 March 2020 to 6 April 2020, due to a case of novel coronavirus infection at the Prosperous Garden Block 4. There was no noise monitoring conducted at W-P11 on 23 March 2020. Temporary alternative noise monitoring location, W-N25A-T was used to conduct noise monitoring on 3 April 2020. Details of temporary alternative monitoring location are presented in Temporary Alternative Proposal for Monitoring Station as proposed by ET and agreed by IEC dated 27 March 2020.
- 7.4. Weekly environmental site inspections were conducted during the reporting period. Joint site inspection with IEC were carried out on 9 April 2020. Minor deficiency was observed during site inspection and was rectified within the specified deadlines. The environmental performance of the Project was therefore considered satisfactory.
- 7.5. One environmental complaint was received on 27th April 2020 regarding noise nuisance at the access shaft underground working area in Zone E during restricted hours. Investigation with the Contractor reflected that all required noise mitigation measures for working in restricted hours, as stipulated in the EM&A Manual and CNP, were implemented. The interim report for the complaint is shown in Appendix Q.
- 7.6. No non-compliance was received in the reporting month.
- 7.7. No notification of summons or prosecution was received in the reporting month...
- 7.8. The ET will keep track on the construction works to confirm compliance of environmental requirements and the proper implementation of all necessary mitigation measures.

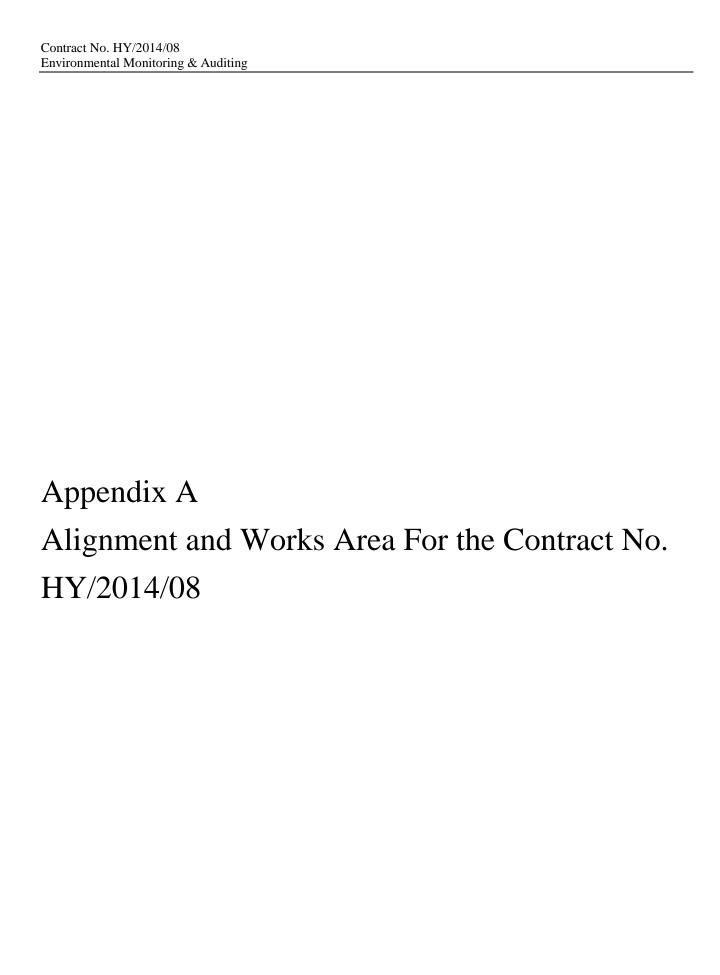


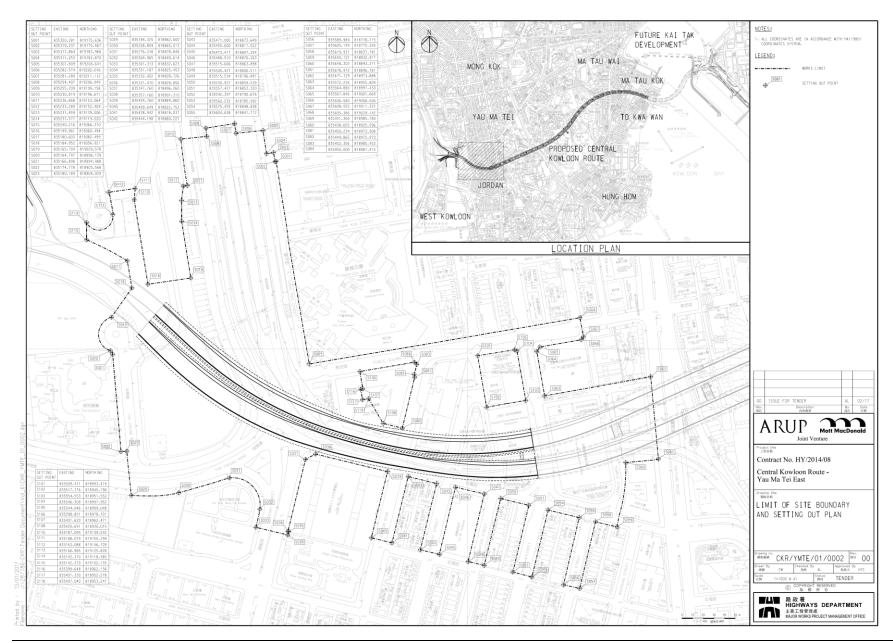


Acuity Sustainability Consulting Ltd.




# Appendix B Construction Programme

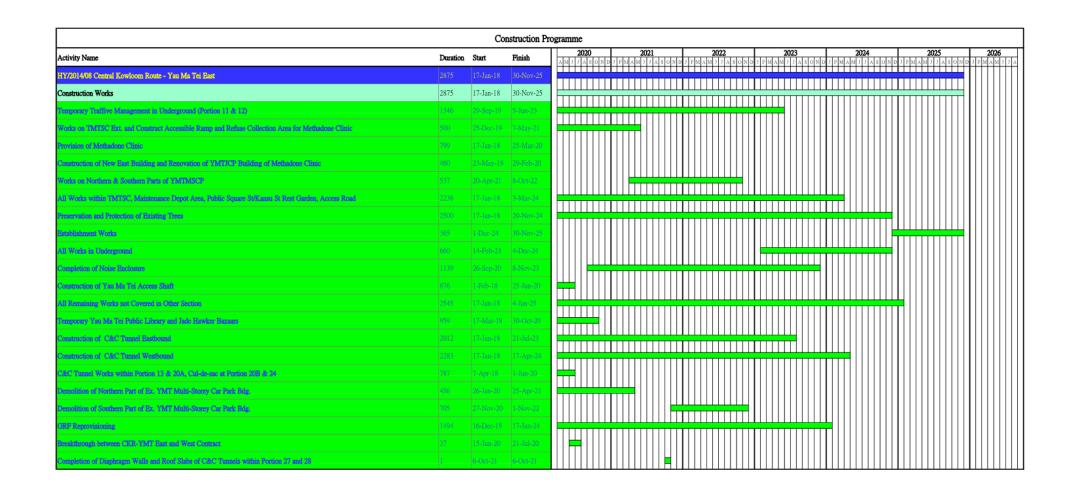




Appendix C Project Organization Chart

# **Project O-Chart**

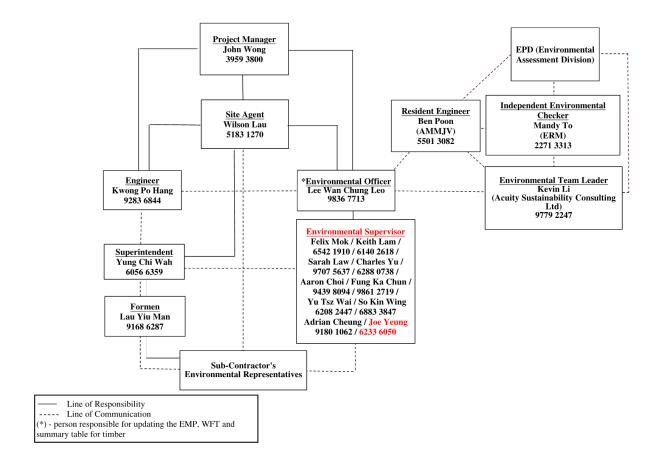

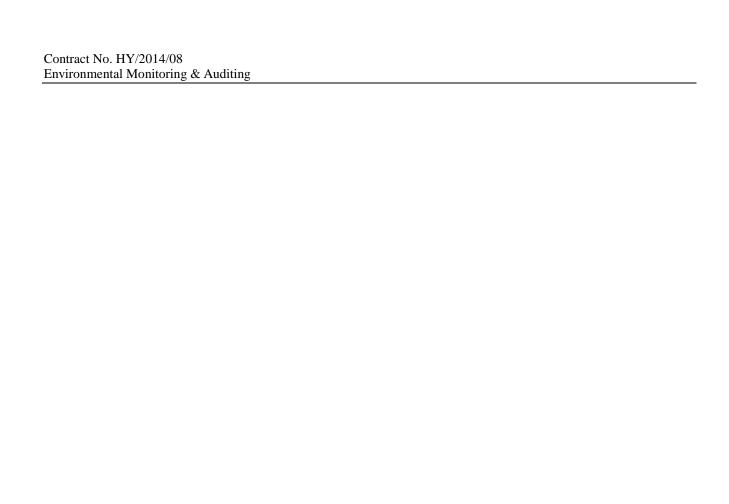

# Appendix D Dust Event-Action Plan (EAP)

EVENT	ACTION					
EVENI	ET	IEC	ER	CONTRACTOR		
ACTION LEVEL						
1.Exceedance for one sample	<ol> <li>Identify source, investigate the causes of exceedance and propose remedial measures;</li> <li>Inform IEC and ER;</li> <li>Repeat measurement to confirm finding;</li> <li>Increase monitoring frequency to daily.</li> </ol>	<ol> <li>Check monitoring data submitted by ET;</li> <li>Check Contractor's working method.</li> </ol>	1. Notify Contractor.	<ol> <li>Rectify any unacceptable practice;</li> <li>Amend working methods if appropriate.</li> </ol>		
2.Exceedance for two or more consecutive samples	<ol> <li>Identify source;</li> <li>Inform IEC and ER;</li> <li>Advise the ER on the effectiveness of the proposed remedial measures;</li> <li>Repeat measurements to confirm findings;</li> <li>Increase monitoring frequency to daily;</li> <li>Discuss with IEC and Contractor on remedial actions required;</li> <li>If exceedance continues, arrange meeting with IEC and ER;</li> <li>If exceedance stops, cease additional monitoring.</li> </ol>	<ol> <li>Check monitoring data submitted by ET;</li> <li>Check Contractor's working method;</li> <li>Discuss with ET and Contractor on possible remedial measures;</li> <li>Advise the ET on the effectiveness of the proposed remedial measures;</li> <li>Supervise Implementation of remedial measures.</li> </ol>	<ol> <li>Confirm receipt of notification of failure in writing;</li> <li>Notify Contractor;</li> <li>Ensure remedial measures properly implemented.</li> </ol>	<ol> <li>Submit proposals for remedial to ER within 3 working days of notification;</li> <li>Implement the agreed proposals;</li> <li>Amend proposal if appropriate.</li> </ol>		
LIMIT LEVEL	LIMIT LEVEL					
1.Exceedance for one sample	Identify source, investigate the causes of exceedance and propose remedial measures;     Inform ER, Contractor and	<ol> <li>Check monitoring data submitted by ET;</li> <li>Check Contractor's working method;</li> </ol>	<ol> <li>Confirm receipt of notification of failure in writing;</li> <li>Notify Contractor;</li> </ol>	Take immediate action to avoid further exceedance;     Submit proposals for remedial actions to IEC		


EVENT	ACTION ACTION					
EVENI	ET	IEC	ER	CONTRACTOR		
	<ul> <li>EPD;</li> <li>3. Repeat measurement to confirm finding;</li> <li>4. Increase monitoring frequency to daily;</li> <li>5. Assess effectiveness of Contractor's remedial actions and keep IEC, EPD and ER informed of the results.</li> </ul>	<ul> <li>3. Discuss with ET and Contractor on possible remedial measures;</li> <li>4. Advise the ER on the effectiveness of the proposed remedial measures;</li> <li>5. Supervise implementation of remedial measures.</li> </ul>	3. Ensure remedial measures properly implemented.	within 3 working days of notification; Implement the agreed proposals; 4. Amend proposal if appropriate.		
2.Exceedance for two or more consecutive samples	<ol> <li>Notify IEC, ER, Contractor and EPD;</li> <li>Identify source;</li> <li>Repeat measurement to confirm findings;</li> <li>Increase monitoring frequency to daily;</li> <li>Carry out analysis of Contractor's working procedures to determine possible mitigation to be implemented;</li> <li>Arrange meeting with IEC and ER to discuss the remedial actions to be taken;</li> <li>Assess effectiveness of Contractor's remedial actions and keep IEC, EPD and ER informed of the results;</li> <li>If exceedance stops, cease additional monitoring.</li> </ol>	<ol> <li>Discuss amongst ER, ET, and Contractor on the potential remedial actions;</li> <li>Review Contractor's remedial actions whenever necessary to assure their effectiveness and advise the ER accordingly;</li> <li>Supervise the implementation of remedial measures.</li> </ol>	<ol> <li>Confirm receipt of notification of failure in writing;</li> <li>Notify Contractor;</li> <li>In consultation with the IEC, agree with the Contractor on the remedial measures to be implemented;</li> <li>Ensure remedial measures properly implemented;</li> <li>If exceedance continues, consider what portion of the work is responsible and instruct the Contractor to stop that portion of work until the exceedance is abated.</li> </ol>	<ol> <li>Take immediate action to avoid further exceedance;</li> <li>Submit proposals for remedial actions to IEC within 3 working days of notification;</li> <li>Implement the agreed proposals;</li> <li>Resubmit proposals if problem still not under control;</li> <li>Stop the relevant portion of works as determined by the ER until the exceedance is abated.</li> </ol>		

Note:

ET – Environmental Team

ER – Engineer's Representative

IEC – Independent Environmental Checker

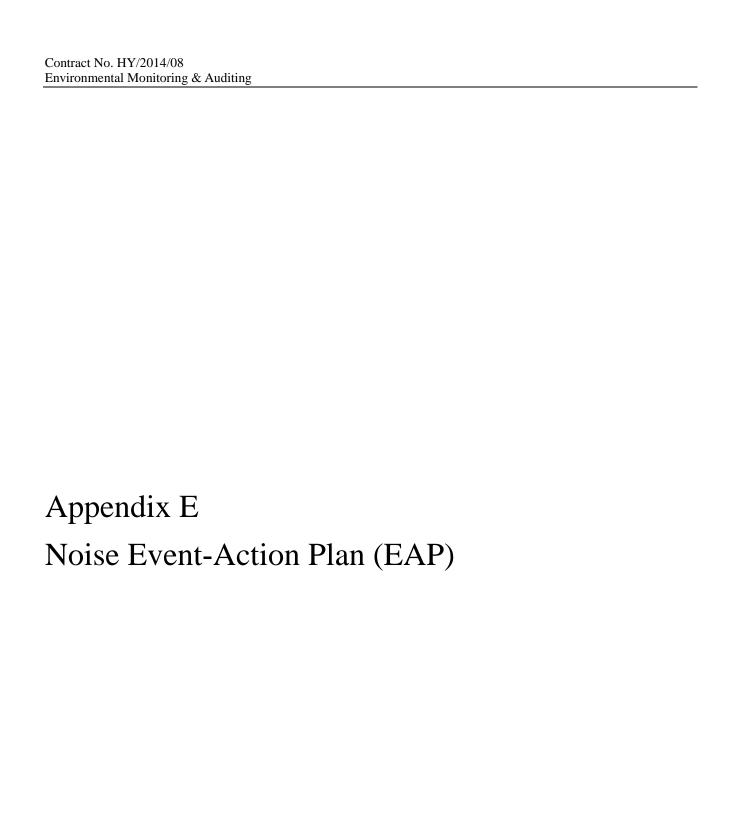

EVENT		ACTIO	ON	
	ET	IEC	ER	CONTRACTOR
Action Level	<ol> <li>Identify source, investigate the causes of exceedance and propose remedial measures;</li> <li>Notify IEC and Contractor;</li> <li>Report the results of investigation to the IEC, ER and Contractor;</li> <li>Discuss with the Contractor and formulate remedial measures;</li> <li>Increase monitoring frequency to check mitigation effectiveness.</li> </ol>	<ol> <li>Review the analysed results submitted by the ET;</li> <li>Review the proposed remedial measures by the Contractor and advise the ER accordingly;</li> <li>Supervise the implementation of remedial measures.</li> </ol>	<ol> <li>Confirm receipt of notification of failure in writing;</li> <li>Notify Contractor;</li> <li>Require Contractor to propose remedial measures for the analysed noise problem;</li> <li>Ensure remedial measures are properly implemented</li> </ol>	Submit noise mitigation proposals to IEC;      Implement noise mitigation proposals.
Limit Level	<ol> <li>Identify source;</li> <li>Inform IEC, ER, EPD and Contractor;</li> <li>Repeat measurements to confirm findings;</li> <li>Increase monitoring frequency;</li> <li>Carry out analysis of Contractor's working procedures to determine</li> </ol>	<ol> <li>Discuss amongst ER, ET, and Contractor on the potential remedial actions;</li> <li>Review Contractors remedial actions whenever necessary to assure their effectiveness and advise the ER accordingly;</li> <li>Supervise the implementation of remedial measures.</li> </ol>	<ol> <li>Confirm receipt of         notification of failure in         writing;</li> <li>Notify Contractor;</li> <li>Require Contractor to         propose remedial measures         for the analysed noise         problem;</li> <li>Ensure remedial measures</li> </ol>	<ol> <li>Take immediate action to avoid further exceedance;</li> <li>Submit proposals for remedial actions to IEC within 3 working days of notification;</li> <li>Implement the agreed proposals;</li> <li>Resubmit proposals if problem still not under control;</li> <li>Stop the relevant portion of</li> </ol>


EVENT		ACTIO	ON	
	ET	IEC	ER	CONTRACTOR
	possible mitigation to be implemented; 6. Inform IEC, ER and EPD the causes and actions taken for the exceedances;		properly implemented; 5. If exceedance continues, consider what portion of the work is responsible and instruct the Contractor to	works as determined by the ER until the exceedance is abated.
	<ul> <li>7. Assess effectiveness of Contractor's remedial actions and keep IEC, EPD and ER informed of the results;</li> <li>8. If exceedance stops, cease additional monitoring.</li> </ul>		stop that portion of work until the exceedance is abated.	

Note:

ET – Environmental Team

IEC – Independent Environmental Checker

ER – Engineer's Representative



Appendix F
Environmental Mitigation Implementation
Schedule (EMIS)

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
			Constru	ction Dust Impact				
\$4.3.10	D1	The contractor shall follow the procedures and requirements given in the Air Pollution Control (Construction Dust) Regulation	Minimize dust impact at the nearby sensitive receivers	Contractor	All construction sites	Construction stage	APCO     To control the dust impact     To meet     HKAQO and     TM-EIA     criteria	Implemented
\$4.3.10	D2	<ul> <li>Mitigation measures in form of regular watering under a good site practice should be adopted. Watering once per hour on exposed worksites and haul road should be conducted to achieve dust removal efficiencies of 91.7%. While the above watering frequencies are to be followed, the extent of watering may vary depending on actual site conditions but should be sufficient to maintain an equivalent intensity of no less than 1.3 L/m² to achieve the dust removal efficiency.</li> </ul>	Minimize dust impact at the nearby sensitive receivers	Contractor	All construction sites	Construction stage	APCO     To control the dust impact     To meet     HKAQO and     TM-EIA     criteria	• Implemented
\$4.3.10	D3	<ul> <li>Proper watering at exposed spoil should be undertaken throughout the construction phase;</li> <li>Any excavated or stockpile of dusty material should be covered entirely by impervious sheeting or sprayed with water to maintain the entire surface wet and then removed or backfilled or reinstated where practicable within 24 hours of the excavation or unloading;</li> <li>Any dusty materials remaining after a stockpile is removed should be wetted with water and cleared from the surface of roads;</li> <li>A stockpile of dusty material should not be</li> </ul>	Minimize dust impact at the nearby sensitive receivers	Contractor	All construction sites	Construction stage	APCO     To control the dust impact     To meet     HKAQO and     TM-EIA     criteria	Implemented, deficiency rectified after observation

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		extended beyond the pedestrian barriers, fencing or traffic cones;  The load of dusty materials on a vehicle leaving a construction site should be covered entirely by impervious sheeting to ensure that the dusty materials do not leak from the vehicle.  Where practicable, vehicle washing facilities with high pressure water jet should be provided at every discernible or designated vehicle exit point. The area where vehicle washing takes place and the road section between the washing facilities and the exit point should be paved with concrete, bituminous materials or hardcores;  When there are open excavation and reinstatement works, hoarding of not less than 2.4m high should be provided and properly maintained as far as practicable along the site boundary with provision for public crossing. Good site practice shall also be adopted by the Contractor to ensure the conditions of the hoardings are properly maintained throughout the construction period;  The portion of any road leading only to construction site that is within 30m of a vehicle entrance or exit should be kept clear of dusty materials;  Surfaces where any pneumatic or power-driven drilling, cutting, polishing or other mechanical breaking operation takes place should be sprayed with water or a dust suppression chemical						

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		<ul> <li>continuously;</li> <li>Any area that involves demolition activities should be sprayed with water or a dust suppression chemical immediately prior to, during and immediately after the activities so as to maintain the entire surface wet;</li> <li>Any skip hoist for material transport should be totally enclosed by impervious sheeting;</li> <li>Every stock of more than 20 bags of cement or dry-pulverised fuel ash (PFA) should be covered entirely by impervious sheeting or placed in an area sheltered on the top and the 3 sides;</li> <li>Loading, unloading, transfer, handling or storage of bulk cement or dry PFA should be carried out in a totally enclosed system or facility, and any vent or exhaust should be fitted with an effective fabric filter or equivalent air pollution control system</li> <li>Exposed earth should be properly treated by compaction, turfing, hydroseeding, vegetation planting or sealing with latex, vinyl, bitumen, shotcrete or other suitable surface stabilizer within six months after the last construction activity on the construction site or part of the construction site where the exposed earth lies.</li> </ul>						
S4.3.10	D6	Implement regular dust monitoring under EM&A programme during the construction stage.	Monitoring of dust impact	Contractor	Selected rep. dust monitoring station	Construction stage	• TM-EIA	Implemented

Acuity Sustainability Consulting Ltd.

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
S5.4.1	N1	<ul> <li>Implement the following good site practices:</li> <li>Only well-maintained plant should be operated on-site and plant should be serviced regularly during the construction programme;</li> <li>Machines and plant (such as trucks, cranes) that may be in intermittent use should be shut down between work periods or should be throttled down to a minimum;</li> <li>Plant known to emit noise strongly in one direction, where possible, be orientated so that the noise is directed away from nearby NSRs;</li> <li>Silencers or mufflers on construction equipment should be properly fitted and maintained during the construction works;</li> <li>Mobile plant should be sited as far away from NSRs as possible and practicable;</li> <li>Material stockpiles, mobile container site office and other structures should be effectively utilized, where practicable, to screen noise from on-site construction activities.</li> </ul>	Control construction airborne noise	Contractor	All construction sites	Construction stage	• Annex 5, TM-EIAO	• Implemented
\$5.4.1	N2	Install temporary hoarding located on the site boundaries between noisy construction activities and NSRs. The conditions of hoardings shall be properly maintained throughout the construction period.	Reduce the construction noise levels at low-level zone of NSRs through partial screening	Contractor	All construction sites	Construction stage	• Annex 5, TM-EIAO	Implemented
\$5.4.1	N3	Install movable noise barriers (typical design is wooden framed barrier with a small-cantilevered on a skid footing with 25mm thick internal sound absorptive lining), acoustic mat or full enclosure,	Sreen the noisy plant items to be used at all construction	Contractor	All construction sites where practicable	Construction stage	Annex 5,     TM-EIAO	Implemented

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		screen the noisy plants including air compressors, generators and handheld breakers, etc.	sites					
S5.4.1	N4	Use 'Quiet plant'	Reduce the noise levels of plant items	Contractor	All construction sites where practicable	Construction stage	Annex 5,     TM-EIAO	Implemented
S5.4.1	N5	Loading/ unloading activities should be carried out inside the full enclosure of mucking out points.	Reduce the noise levels of loading/ unloading activities	Contractor	Mucking out locations	Construction stage	• Annex 5, TM-EIAO	Implemented
S5.4.1	N6	Sequencing operation of construction plants where practicable.	Operate sequentially within the same work site to reduce the construction airborne noise	Contractor	All construction sites where practicable	Construction stage	• Annex 5, TM-EIAO	Implemented
\$5.4.1	N7	Implement a noise monitoring programme under EM&A programme.	Monitor the construction noise levels at the selected representative locations	Contractor	Selected rep. noise monitoring station	Construction stage	• TM-EIAO	Implemented

Water Quality (Construction Phase)

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
S6.9.1.1		In accordance with the Practice Note for Professional Persons on Construction Site Drainage, Environmental Protection Department, 1994 (ProPECC PN1/94), construction phase mitigation measures shall include the following:  Construction Runoff  • At the start of site establishment, perimeter cut-off drains to direct off-site water around the site should be constructed with internal drainage works and erosion and sedimentation control facilities implemented. Channels (both temporary and permanent drainage pipes and culverts), earth bunds or sand bag barriers should be provided on site to direct stormwater to silt removal facilities. The design of the temporary on-site drainage system will be undertaken by the contractor prior to the commencement of construction;  • The dikes or embankments for flood protection should be implemented around the boundaries of earthwork areas. Temporary ditches should be provided to facilitate the runoff discharge into an appropriate watercourse, through a silt/ sediment trap. The sediment/ silt traps should be incorporated in the permanent drainage channels to enhance deposition rates;  • The design of efficient silt removal facilities should be based on the guidelines in Appendix A1 of ProPECC PN 1/94, which states that the retention time for silt/ sand traps should be 5 minutes under	To minimize water quality impact from the construction site runoff and general construction activities	Contractor	All construction sites where practicable	Construction stage	Water     Pollution     Control     Ordinance     ProPECC PN     1/94     TM-EIAO     TM-DSS	• Implemented

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		maximum flow conditions. Sizes may vary depending upon the flow rate, but for a flow rate of 0.1 m3/s a sedimentation basin of 30 m3 would be required and for a flow rate of 0.5 m3/s the basin would be 150 m3. The detailed design of the sand/ silt traps shall be undertaken by the contractor prior to the commencement of construction;  • All exposed earth areas should be completed and vegetated as soon as possible after earthworks have been completed, or alternatively, within 14 days of the cessation of earthworks where practicable. Exposed slope surfaces should be covered by tarpaulin or other means;  • The overall slope of the site should be kept to a minimum to reduce the erosive potential of surface water flows, and all traffic areas and access roads protected by coarse stone ballast. An additional advantage accruing from the use of crushed stone is the positive traction gained during prolonged periods of inclement weather and the reduction of surface sheet flows;  • All drainage facilities and erosion and sediment control structures should be regularly inspected and maintained to ensure proper and efficient operation at all times and particularly following rainstorms. Deposited silt and grit should be removed regularly and disposed of by spreading evenly over stable, vegetated areas;  • Measures should be taken to minimize the ingress						

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		of site drainage into excavations. If the excavation of trenches in wet periods is necessary, they should be dug and backfilled in short sections wherever practicable. Water pumped out from trenches or foundation excavations should be discharged into storm drains via silt removal facilities;  Open stockpiles of construction materials (for example, aggregates, sand and fill material) of more than 50m3 should be covered with tarpaulin or similar fabric during rainstorms. Measures should be taken to prevent the washing away of construction materials, soil, silt or debris into any drainage system;  Manholes should always be adequately covered and temporarily sealed so as to prevent silt, construction materials or debris being washed into the drainage system and storm runoff being directed into foul sewers;  Precautions be taken at any time of year when rainstorms are likely, actions to be taken when a rainstorm is imminent or forecasted, and actions to be taken during or after rainstorms are summarized in Appendix A2 of ProPECC PN 1/94. Particular attention should be paid to the control of silty surface runoff during storm events, especially for areas located near steep slopes;  All vehicles and plant should be cleaned before leaving a construction site to ensure no earth, mud,						
		debris and the like is deposited by them on roads.  An adequately designed and site wheel washing						

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		facilities should be provided at every construction site exit where practicable. Wash-water should have sand and silt settled out and removed at least on a weekly basis to ensure the continued efficiency of the process. The section of access road leading to, and exiting from, the wheel wash bay to the public road should be paved with sufficient backfall toward the wheel wash bay to prevent vehicle tracking of soil and silty water to public roads and drains;  Oil interceptors should be provided in the drainage system downstream of any oil/ fuel pollution sources. The oil interceptors should be emptied and cleaned regularly to prevent the release of oil and grease into the storm water drainage system after accidental spillage. A bypass should be provided for the oil interceptors to prevent flushing during heavy rain;  Construction solid waste, debris and rubbish on site should be collected, handled and disposed of properly to avoid water quality impacts;  All fuel tanks and storage areas should be provided with locks and sited on sealed areas, within bunds of a capacity equal to 110% of the storage capacity of the largest tank to prevent spilled fuel oils from reaching water sensitive receivers nearby;  Adopt best management practices;  All earth works should be conducted sequentially to limit the amount of construction runoff generated from exposed areas during the wet						

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		season (April to September) as far as practicable.						
S6.9.1.2	W2	<ul> <li>Cut-&amp;-cover tunneling work should be conducted sequentially to limit the amount of construction runoff generated from exposed areas during the wet season (April to September) as far as practicable.</li> <li>Uncontaminated discharge should pass through sedimentation tanks prior to off-site discharge;</li> <li>The wastewater with a high concentration of SS should be treated (e.g. by sedimentation tanks with sufficient retention time) before discharge. Oil interceptors would also be required to remove the oil, lubricants and grease from the wastewater;</li> <li>Direct discharge of the bentonite slurry (as a result of D-wall) is not allowed. It should be reconditioned and reused wherever practicable. Temporary storage locations (typically a properly closed warehouse) should be provided on site for any unused bentonite that needs to be transported away after all the related construction activities area completed. The requirements in ProPECC PN 1/94 should be adhered to in the handling and disposal of bentonite slurries.</li> </ul>	To minimize construction water quality impact from tunneling works	Contractor	All tunneling portion	Construction stage	Water     Pollution     Control     Ordinance     ProPECC PN     1/94     TM-DSS     TM-EIAO	• Implemented

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
\$6.9.1.3	W3	Portable chemical toilets and sewage holding tanks are recommended for handling the construction sewage generated by the workforce. A licensed contractor should be employed to provide appropriate and adequate portable toilets and be responsible for appropriate disposal and maintenance.	To minimize water quality from sewage effluent	Contractor	All construction sites where practicable	Construction stage	Water     Pollution     Control     Ordinance     TM-DSS	Implemented
S6.9.1.5	W4	<ul> <li>No direct discharge of groundwater from contaminated areas should be adopted.</li> <li>A discharge license under the WPCO through the Regional Office of EPD for groundwater discharge should be applied. Prior to the excavation works within these potentially contaminated areas, the groundwater quality should be reviewed during the process of discharge license application. The compliance to the Technical Memorandum on Standards for Effluents Discharged into Drainage on Sewerage Systems, Inland and Coastal Waters (TM-DSS) and the existence of prohibited substance should be confirmed. If the review results indicated that the groundwater to be generated from the excavation works would be contaminated, the contaminated groundwater should be either properly treated in compliance with the requirements of the TM-DSS or properly</li> </ul>	To minimize groundwater quality impact from contaminated area	Contractor	Excavation areas where contamination is found	Construction stage	Water     Pollution     Control     Ordinance     TM-DSS     TM-EIAO	Implemented, deficiency rectified after observation

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		<ul> <li>If wastewater treatment is deployed, the wastewater treatment unit shall deploy suitable treatment process (e.g. oil interceptor / activated carbon) to reduce the pollution level to an acceptable standard and remove any prohibited substances (e.g. TPH) to undetectable range. All treated effluent from wastewater treatment plant shall meet the requirements as stated in TM-DSS and should be discharged into the foul sewers.</li> <li>If groundwater recharging wells are deployed, recharging wells should be installed as appropriate for recharging the contaminated groundwater back into the ground. The recharging wells should be selected at places where the groundwater quality will not be affected by the recharge operation as indicated in the Section 2.3 of TM-DSS. The baseline groundwater quality shall be determined prior to the selection of the recharge wells, and submit a working plan (including the laboratory analytical results showing the quality of groundwater at the proposed recharge location(s) as well as the pollutant levels of groundwater to be recharged) to EPD for agreement. Pollution levels of groundwater to be recharged shall not be higher than pollutant levels of ambient groundwater at the recharge well. Prior to recharge, any prohibited substances such as TPH products should be removed as necessary by installing the petrol</li> </ul>						

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		interceptor.						
\$6.9.1.6	W6	In order to prevent accidental spillage of chemicals, the following is recommended:  • All the tanks, containers, storage area should be bunded and the locations should be locked as far as possible from the sensitive watercourse and stormwater drains;  • The Contractor should register as a chemical waste producer if chemical wastes would be generated. Storage of chemical waste arising from the construction activities should be stored with suitable labels and warnings.  Disposal of chemical wastes should be conducted in compliance with the requirements as stated in the Waste Disposal (Chemical Waste) (General) Regulation.	To minimize water quality impact from accidental spillage	Contractor	All construction site where practicable	Construction stage	Water     Pollution     Control     Ordinance     ProPECC PN     1/94     TM-EIAO     TM-DSS	• Implemented
			Waste Manage	ement (Construction	Waste)			
\$7.4.1	WM1	Geological assessment should be carried out by competent persons on site during excavation to identify materials which are not suitable to use as aggregate in structural concrete (e.g. volcanic rock, Aplite dyke rock, etc.). Volcanic rock and Aplite	Separation of unsuitable rock from ending up at concrete batching plants and be turned into concrete for	Contractor	All construction sites	Construction stage	• DEVB (W) No. 6/2010	Implemented

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		dyke rock should be separated at the source sites as far as practicable and stored at designated stockpile area preventing them from delivering to crushing facilities. The crushing plant operator should also be reminded to set up measures to prevent unsuitable rock from ending up at concrete batching plants and be turned into concrete for structural use. Details regarding control measures at source site and crushing facilities should be submitted by the Contractor for the Engineer to review and agree. In addition, site records should also be kept for the types of rock materials excavated and the traceability of delivery will be ensured with the implementation of Trip Ticket System and enforced by site supervisory staff as stipulated under DEVB TC(W) No. 6/2010 for tracking of the correct delivery to the rock crushing facilities for processing into aggregates. Alternative disposal option for the reuse of volcanic rock and Aplite Dyke rock, etc. should be explored.	structural use					
S7.5.1	WM2	<ul> <li>Construction and Demolition Material</li> <li>Maintain temporary stockpiles and reuse excavated fill material for backfilling and reinstatement;</li> <li>Carry out on-site sorting;</li> <li>Make provisions in the Contract documents to allow and promote the use of recycled aggregates where appropriate;</li> <li>Adopt 'selective demolition' technique to demolish the existing structures and facilities with a view to</li> </ul>	Good site practice to minimize the waste generation and recycle the C&D materials as far as practicable so as to reduce the	Contractor	All construction sites	Construction stage	Land     (Miscellaneo     us Provisions)     Ordinance     Waste     Disposal     Ordinance     ETWB TCW     No. 19/2005	<ul> <li>Implemented, deficiency rectified after observation</li> </ul>

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
\$7.5.1	WM3	recovering broken concrete effectively for recycling purpose, where possible;  Implement a trip-ticket system for each works contract to ensure that the disposal of C&D materials are properly documented and verified; and  Implement an enhanced Waste Management Plan similar to ETWBTC (Works) No. 19/2005 – "Environmental Management on Construction Sites" to encourage on-site sorting of C&D materials and to minimize their generation during the course of construction.  C&D Waste  Standard formwork or pre-fabrication should be used as far as practicable in order to minimize the arising of C&D materials. The use of more durable formwork or plastic facing for the construction works should be considered. Use of wooden hoardings should not be used, as in other projects. Metal hoarding should be used to enhance the possibility of recycling. The purchasing of construction materials will be carefully planned in order to avoid over ordering and wastage;  The Contractor should recycle as much of the C&D materials as possible on-site. Public fill and C&D waste should be segregated and stored in different containers or skips to enhance reuse or recycling of materials and their proper disposal. Where practicable, concrete and masonry can be crushed	Good site practice to minimize the waste generation and recycle the C&D materials as far as practicable so as to reduce the amount for final disposal	Contractor	All construction sites	Construction stage	Land     (Miscellaneo     us Provisions)     Ordinance     Waste     Disposal     Ordinance     ETWB TCW     No. 19/2005	• Implemented

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		and used as fill. Steel reinforcement bar can be used by scrap steel mills. Different areas of the sites should be considered for such segregation and storage.						
\$7.5.1	WM5	<ul> <li>All construction plant and equipment shall be designed and maintained to minimize the risk of silt, sediments, contaminants or other pollutants being released into the water column or deposited in the locations other than designated location;</li> <li>All vessels shall be sized such that adequate draft is maintained between vessels and the sea bed at all states of the tide to ensure that undue turbidity is not generated by turbulence from vessel movement or propeller wash;</li> <li>Before moving the vessels which are used for transporting dredged material, excess material shall be cleaned from the decks and exposed fittings of vessels and the excess materials shall never be dumped into the sea except at the approved locations;</li> <li>Adequate freeboard shall be maintained on barges to ensure that decks are not washed by wave action.</li> <li>The Contractors shall monitor all vessels transporting material to ensure that no dumping outside the approved location takes place. The Contractor shall keep and produce logs and other records to demonstrate compliance and that journeys are consistent with designated locations</li> </ul>	To control pollution due to marine sediment	Contractor	Along CKR alignment	Construction stage	• ETWB TCW No. 34/2002	• Implemented

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		<ul> <li>and copies of such records shall be submitted to the engineers;</li> <li>The Contractors shall comply with the conditions in the dumping licence.</li> <li>All bottom dumping vessels (Hopper barges) shall be fitted with tight fittings seals to their bottom openings to prevent leakage of material;</li> <li>The material shall be placed into the disposal pit by bottom dumping;</li> <li>Contaminated marine mud shall be transported by spit barge of not less than 750m3 capacity and capable of rapid opening and discharge at the disposal site;</li> <li>Discharge shall be undertaken rapidly and the hoppers shall be closed immediately. Material adhering to the sides of the hopper shall not be washed out of the hopper and the hopper shall remain closed until the barge returns to the disposal site.</li> <li>For Type 3 special disposal treatment, sealing of contaminant with geosynthetic containment before dropping designated mud pit would be a possible arrangement. A geosynthetic containment method is a method whereby the sediments are sealed in geosynthetic containers and, the containers would be dropped into the designated contaminated mud pit where they would be covered by further mud disposal and later by the mud pit capping at the disposal site, thereby fulfilling the requirements for fully confined mud disposal.</li> </ul>						

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
\$7.5.1	WM6	<ul> <li>Chemical Waste</li> <li>Chemical waste that is produced, as defined by Schedule 1 of the Waste Disposal (Chemical Waste) (General) Regulation, should be handled in accordance with the Code of Practice on the Packaging, Labelling and Storage of Chemical Wastes;</li> <li>Containers used for the storage of chemical wastes should be suitable for the substance they are holding, resistant to corrosion, maintained in a good condition, and securely closed, have a capacity of less than 450 L unless the specification has been approved by EPD, and display a label in English and Chinese in accordance with instructions prescribed in Schedule 2 of the regulation;</li> <li>The storage area for chemical wastes should be clearly labelled and used solely for the storage of chemical waste, enclosed on at least 3 sides, have an impermeable floor and bunding of sufficient capacity to accommodate 110% of the volume of the largest container or 20% of the total volume of waste stored in that area, whichever is the greatest, have adequate ventilation, covered to prevent rainfall entering, and arranged so that incompatible materials are adequately separated;</li> <li>Disposal of chemical waste should be via a licensed waste collector, be to a facility licensed to receive chemical waste, such as the Chemical Waste Treatment Centre which also offers a chemical</li> </ul>	Control the chemical waste and ensure proper storage, handling and disposal	Contractor	All construction sites	Construction stage	Waste     Disposal     (Chemical     Waste)     (General)     Regulation     Code of     Practice on     the     Packaging,     Labelling and     Storage of     Chemical     Waste	Implemented, deficiency rectified after observation.

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		waste collection service and can supply the necessary storage containers, or be to a reuser of the waste, under approval from EPD.						
\$7.5.1	WM7	<ul> <li>General Refuse</li> <li>General refuse generated on-site should be stored in enclosed bins or compaction units separately from construction and chemical wastes;</li> <li>A reputable waste collector should be employed by the Contractor to remove general refuse from the site, separately from construction and chemical wastes, on a daily basis to minimize odour, pest and litter impacts. Burning of refuse on construction sites is prohibited by law.</li> <li>Aluminum cans are often recovered from the waste stream by individual collectors if they are segregated and made easily accessible. Separate labelled bins for their deposit should be provided if feasible;</li> <li>Office wastes can be reduced through the recycling of paper if volumes are large enough to warrant collection. Participation in a local collection scheme should be considered by the Contractor.</li> </ul>	Minimize production of the general refuse and avoid odour, pest and litter impacts	Contractor	All construction sites	Construction stage	Waste     Disposal     Ordinance	• Implemented
Land Contamination								
S8.9 & Appendix 8.4	LC2	Excavation of the Contaminated Soil     Prior to commencement of the excavation works at the contamination zone, the zone should be clearly marked out on site and the surface levels recorded. Excavation of contaminated material should be undertaken using dedicated earth-moving plant.	The contaminated soil will be excavated for on-site reuse	Contractor	PBH4	Prior to commencement of construction works within the contaminated area	Practice     Guide (PG)     for     Investigation     and     Remediation	Implemented

EIA Ref.	EM&A Log Ref.	Recommended Mi	tigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
S8.9 & Appendix 8.4	LC3	by sheet to prevent disduring stockpiling.  The Contractor should selection of suitable schemes and discharge table is higher than the excavation. The Contract valid Water Pollution Codischarge licence from EF.  Following completion of specified depth, at least of the excavation and distributed along the book specified specified depth.	area on site and covered persion of contamination  pay attention to the groundwater lowering points if the groundwater contaminated soils during tor should also obtain a portrol Ordinance (WPCO) PD where applicable.  If the excavation to the one sample from the base of four samples evenly bundary of the excavation posure assessment testing, is shown below:  Acceptance Criteria RBRGS (Public Park)  below the RBRGs (Public on will be required.					of Contaminate d Land Guidance Notes for Contaminate d Land Assessment and Remediation Guidance Manual for Use of Risk-Based Remediation Goals (RBRGs) for Contaminate d Land Management	• Implemented

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		the location(s) of the sample(s) which has exceeded the acceptance criteria. Further sampling shall also be conducted for compliance testing. The process of excavation, sampling and compliance testing should continue until all contaminated materials are removed and should be supervised by a Land Contamination Specialist.						
Appendix 8.4	LC4	A Remediation Report (RR) to demonstrate adequate clean-up shall be prepared and submitted to EPD for endorsement prior to the commencement of any construction/development works within the sites. No construction/development works shall be carried out prior to the endorsement of the RR by EPD.						Implemented
				Hazard to Life				
\$9.18	H1	Blasting activities regarding transport and use of explosives should be supervised and audited by competent site staff to ensure full compliance with the blasting permit conditions.	To ensure that the risks from the proposed explosives handling and transport would be acceptable	Contractor	Works areas at which explosives would be used	Construction stage	Dangerous Goods Ordinance	• N/A
S9.6, para.4	H2	Detonators shall not be transported in the same vehicle with other Category 1 Dangerous Goods.	To reduce the risk of explosion during the transport of cartridged emulsion	Contractor	-	Construction stage	Dangerous     Goods     Ordinance	• N/A

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
S9.6, para.8	Н3	The explosives delivery trucks should be approved by Mines Division and should meet the regulatory requirements for transport of explosives.	To comply with the requirements for approval of an explosives delivery vehicle	Contractor	-	Construction stage	Dangerous     Goods     Ordinance	• N/A
S9.10, para.7 and S9.18	Н4	Blast cover should be provided for shaft at HMT, and kept closed during blasting.  Provision of blast doors or heavy duty blast curtains should be implemented at the shaft to prevent flyrock and control the air overpressure.	To ensure safe use of explosives	Contractor	Shaft	Construction stage	-	• N/A
\$9.16	H5	Only the required quantity of explosives for a particular blast should be transported to avoid the return.	To reduce risks during explosives transport	Contractor	Works areas at which explosives would be used	Construction stage	-	• N/A
S9.18	Н7	The approved truck dedicated for transport of explosives should comply with the "Guidance Note on Requirements for Approval of an Explosives Delivery Vehicle" issued by CEDD Mines Division. The truck should be periodically inspected and properly maintained in good operation conditions. The fuel carried in the fuel tank should be minimized to reduce the duration of fire. Adequate fire fighting equipment shall be provided, inspected and replaced periodically (e.g. fire extinguishers).	To reduce the risk during explosives transport	Contractor	Works areas of which explosives would be used	Construction stage	Dangerous     Goods     Ordinance	• N/A

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
S9.18	Н8	The driver and his assistant should be physically healthy, experienced and have good safe driving records. The driver should hold a proper driving licence for the approved transport truck. Dedicated training programme and regular road safety briefing sessions/ workshops should be provided to enhance their safe driving attitude and practice. Smoking should be strictly prohibited.	To reduce the risk during explosives transport	Contractor	Works areas at which explosives would be used	Construction stage	-	• N/A
S9.18	Н9	Emergency response plans in case of road accident should be prepared and implemented. The driver and his assistant should be familiar with the emergency procedures including evacuation, and proper communication/ fire-fighting equipment should be provided to the driver and his assistant.	To reduce the risk during explosives transport	Contractor	Works areas at which explosives would be used	Construction stage	-	• N/A
\$9.18	H10	Close liaison and communication among Mines Division, Contractors for transport of explosives, and working staff of the blasting should be established. In case of any change of work schedule leading to cancellation or variation of explosives required, relevant parties should be informed in time to avoid unused explosives at the work sites.	To reduce the risk during explosives transport	Contractor	Works areas at which explosives would be used	Construction stage	-	• N/A
\$9.18	H11	Close liaison and communication with Fire Services Department should be established to reduce the accidental detonation escalated from a fire. The contractors for transport of explosives should use the preferred transport routes as far as practicable.	To reduce the risk during explosives transport	Contractor	Works areas at which explosives would be used	Construction stage	-	• N/A
S9.18	H12	Contingency plan should be prepared for transport of explosives under severe weather conditions such as rainstorms and thunderstorms.	To reduce the risk during explosives transport	Contractor	Works areas at which explosives would be	Construction stage	-	• N/A

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status		
					used					
\$9.18	H13	For explosive transport, all packages of explosives on the truck should be properly stored in the truck compartment as required. Packaging of the explosives should remain intact (i.e. damage free) until they are transferred to the blasting site.	To reduce the risk during explosives transport	Contractor	Works areas at which explosives would be used	Construction stage	-	• N/A		
\$9.18	H14	Availability of a parking space should be ensured before commencement of transport of explosives. Location for loading and unloading of explosives should be as close as possible to the shaft. No hot work should be performed in the vicinity during the time of loading and unloading.	To reduce the risk during explosives transport	Contractor	Works areas at which explosives would be used	Construction stage	-	• N/A		
\$9.18	H22	It is recommended to explore to minimize the use of the cartridged emulsion explosives and maximize the use of bulk emulsion explosive as far as practicable.	To reduce the risk during explosives transport	Contractor	Works areas at which explosives would be used	Construction stage	-	• N/A		
\$9.18	H24	It is recommended to explore to use smaller explosive charges such as 'cast boosters' or 'mini-cast booster' instead of cartridged emulsion as primers for bulk emulsion. This option reduces the quantity of explosives required for transportation for the sections where bulk emulsion will be used.	To reduce the risk during explosives transport	Contractor	Works areas at which explosives would be used	Construction stage	-	• N/A		
	Landscape & Visual									

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
S10.10.1 Table 10.11	LV3	<ul> <li>Good Site Management</li> <li>Large temporary stockpiles of excavated material shall be covered with unobtrusive sheeting to prevent dust and dirt spreading to adjacent</li> </ul>	Minimize visual impact	Contractor	Within Project site	Construction stage	-	Implemented
		<ul> <li>landscape areas and vegetation, and to create a neat and tidy visual appearance.</li> <li>Construction plant and building material shall be orderly and carefully stored in order to create a neat and tidy visual appearance.</li> </ul>						
S10.10.1 Table 10.11	LV4	<ul> <li>Screen Hoarding</li> <li>Decorative screen hoarding should be erected to screen the public from the construction area. It should be designed to be compatible with the existing urban context.</li> </ul>	Minimize visual impact	Contractor	Within Project site	Construction stage	-	Implemented
S10.10.1 Table 10.11	LV5	Lighting Control during Construction     All lighting in the construction site shall be carefully controlled to minimize light pollution and night-time glare to nearby residencies and GIC. The Contractor shall consider other security measures, which shall minimize the visual impacts.	Minimize visual impact	Contractor	Within Project site	Construction stage	-	• N/A
S10.10.1 Table 10.11	LV6	The potential for soil erosion shall be reduced by minimizing the extent of vegetation disturbance on site and by providing a protective cover over newly exposed soil.	Minimize landscape impact	Contractor	Within Project site	Construction stage	-	• N/A
S10.10.1 Table 10.11	LV7	Tree Protection & Preservation  • Carefully protected during construction. Tree protection measures will be detailed at the Tree Removal Application stage and plans submitted to the relevant Government Department for approval	Minimize landscape and visual impact	Contractor	Within Project site	Construction stage	'Guidelines for Tree Risk Management and Assessment	Implemented

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		in due course in accordance with ETWB TC no. 3/2006.					Arrangement on an Area Basis and on a Tree Basis', Greening, Landscape and Tree Management (GLTM) Section, DEVB  Latest recommende d horticultural practices from GLTM Section, DEVB	
S10.10.1 Table 10.11	LV8	Tree Transplantation  For trees unavoidably affected by the Project that have to be removed, where practical transplantation will be chosen as the top priority method of removal. If this is not possible or practical compensatory planting will be provided for trees unavoidably felled (See LV10). For trees unavoidably affected by the Project works that are transplanted, transplantation must be carried out in accordance with ETWB TCW 2/2004 and 3/2006.	Minimize landscape and visual impact	Contractor	Within Project site and designated off-site locations	Prior to Construction stage	ETWB TCW 3/2006     Latest     recommende     d     horticultural     practices     from     Greening,     Landscape     and Tree	• N/A


EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
\$10.10.1	LV9	Compository Planting	Minimize visual	Contractor	Within Broject	Construction store	Management (GLTM) Section, DEVB • ETWB TCW 2/2004	a N/A
Table 10.11	LV9	<ul> <li>Compensatory Planting</li> <li>For trees unavoidably affected by the Project that have to be removed, where practical transportation will be chosen as the top priority method of removal but if this is not possible or practical compensatory planting will be provided for trees unavoidably felled. All felled trees shall be compensated for by planting trees to the satisfaction of relevant Government projects. Required numbers and locations of compensatory trees shall be determined and agreed separately with Government during the Tree Felling Application process under ETWBTC 3/2006.</li> <li>Compensatory tree planting may be incorporated into public open spaces and along roadside amenity areas affected by the construction works and therefore be part of the bigger wider planting plans. Onsite compensation planting is preferred but if necessary, additional receptor sites outside the Works Area shall be agreed separately with Government during the Tree Felling Application process.</li> </ul>	impact and also enhance landscape	Contractor	Within Project site	Construction stage	ETWB TCW 3/2006  Latest recommende d horticultural practices from Greening, Landscape and Tree Management (GLTM) Section, DEVB  ETWB TCW 2/2004	• N/A


Cultural Heritage Impact (Construction Phase)

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
S11.4.4	CH1	The contractor should be alerted during the construction on the possibility of locating archaeological remains and as a precautionary measure, AMO shall be informed immediately in case of discovery of antiquities or supposed antiquities in the subject sites.	To preserve any cultural heritage items which may be removed and damaged by the excavation	Contractor	During construction works for cut and cover tunnels	Construction stage	AMOs requirements	Implemented
\$12.6.1	CH3	<ul> <li>Protective covering should be provided for the buildings in the form of plastic sheeting;</li> <li>Buffer zones should be provided between the construction works and the external walls of the buildings and should be as large as site restrictions allow and be marked out by temporary fencing or hoarding;</li> <li>An underpinning scheme is required to transfer the existing column loadings to a deeper rock stratum. The supporting system includes cutting the existing ground floor slab to expose the existing pile caps and then construct transfer beams at both sides of the pile caps. The transfer beams will tie up with the existing caps. Loadings of the transfer beams will be transferred to the rock socket piles installed at the two ends of the beams;</li> <li>The AAA settlement and tilting limit should be 6/8/10 mm and 1/2000, 1/1500 and 1/1000;</li> <li>Monitoring of vibration levels will be undertaken during the construction phase and the Alert, Alarm and Action (AAA) vibration limit will be set at 5/6/7.5 mm/s. The monitoring proposal should be sent to AMO for comment;.</li> <li>Regular site inspections and monitoring works will</li> </ul>	Protect the building from damage from construction works	Contractor	Yau Ma Tei Police Station (Old Wing) (CKR-01)	Prior to commencement of and during the construction phase	Guidelines     for Cultural     Heritage     Impact     Assessment     EIAO-TM     Annex 10 and     Annex 19     AMO     Proposed     Vibration     Limits	• Implemented

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		be carried out by the contractor and the monitoring results will be submitted to the resident site staff of HyD to ensure compliance.						
S12.6.1		<ul> <li>Adopting diaphragm wall construction method;</li> <li>Grout curtain should be provided in front of the building;</li> <li>Recharging system should be installed as a contingency measure to mitigate the fluctuation of water table;</li> <li>the AAA settlement and tilting limit should be 6/8/10 mm and 1/2000, 1/1500 and 1/1000;</li> <li>Monitoring of vibration levels will be undertaken during the construction phase and the Alert, Alarm and Action (AAA) vibration limit will be set at 5/6/7.5 mm/s. The monitoring proposal should be sent to AMO for comment;.</li> <li>Regular site inspections and monitoring works will be carried out by the contractor and the monitoring results will be submitted to the resident site staff of HyD to ensure compliance.</li> </ul>	Protect the building from damage from construction works	Contractor	Yau Ma Tei Police Station (Old Wing) (CKR-01)	Prior to commencement of and during the construction phase	Guidelines for Cultural Heritage Impact Assessment EIAO-TM Annex 10 and Annex 19 AMO Proposed Vibration Limits	• Implemented
S12.6.1 Table 12.2		<ul> <li>The Alert, Alarm and Action (AAA) vibration limit will be set at 3/4/5 mm/s and a condition survey shall be carried out by the project proponent prior to the construction phase to confirm this assessment</li> <li>Vibration monitoring of the structure shall be employed during the construction phase to ensure that the level is not exceeded. The monitoring proposal should be sent to AMO for comment.</li> </ul>	Protect the building from damage from construction works	Contractor	Tin Hau Temple (CKR-02)	Prior to commencement of and during the construction phase	Guidelines     for Cultural     Heritage     Impact     Assessment     EIAO-TM     Annex 10 and     Annex 19     AMO	Implemented

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
							Proposed Vibration Limits	
				EM&A Project				
S13.2	EM1	An Independent Environmental Checker needs to be employed as per the EM&A Manual	Control EM&A Performance	Highways Department	All construction sites	Construction stage	• EIAO Guidance Note No. 4/2010 • TM-EIAO	Implemented
S13.2-13.4	EM2	<ul> <li>An Environmental Team needs to be employed as per the EM&amp;A Manual;</li> <li>Prepare a systematic Environmental Management Plan to ensure effective implementation of the mitigation measures;</li> <li>An environmental impact monitoring needs to be implemented by the Environmental Team to ensure all the requirements given in the EM&amp;A Manual are fully complied with.</li> </ul>	Perform environmental monitoring & auditing	Highways Department/ Contractor	All construction sites	Construction stage	• EIAO Guidance Note No. 4/2010 • TM-EIAO	Implemented

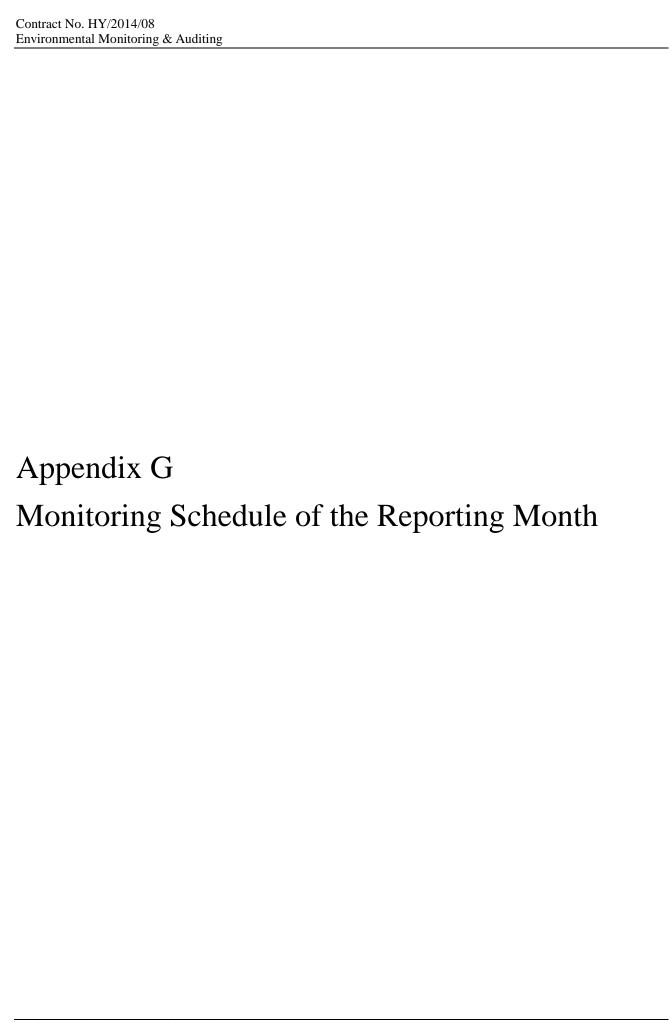

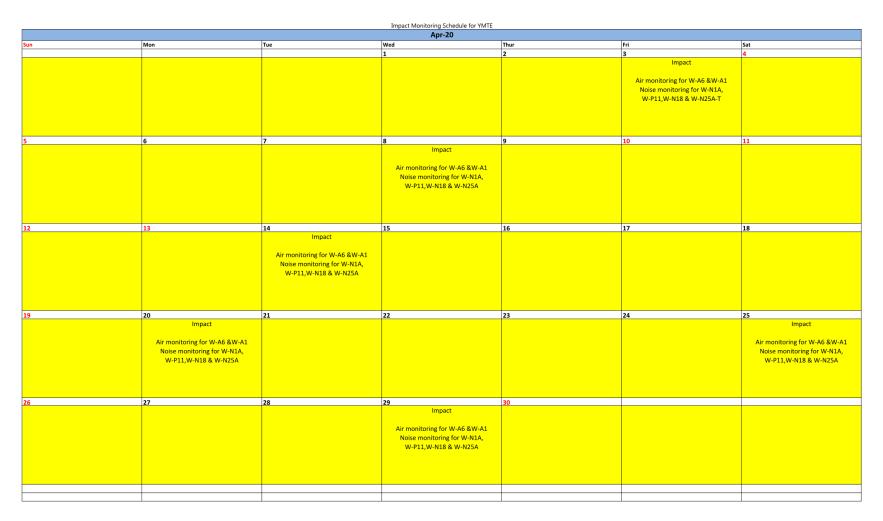

Remark: Noise monitoring station at Prosperous Garden Block 1 (W-N25A) was temporarily suspended from 24 March 2020 to 6 April 2020 due to a case of novel coronavirus infection at the Prosperous Garden Block 4. A temporary alternative noise monitoring location, W-N25A-T was used on 3 April 2020.

Appendix H
Calibration Certificates
(Air Monitoring)



## SIBATA SCIENTIFIC TECHNOLOGY LTD.

1-1-62, Nakane, Soka, Saitama, 340-0005 Japan

TEL: 048-933-1582 FAX: 048-933-1591

### **CALIBRATION CERTIFICATE**

Date: September 24th, 2019

Equipment Name : Digital Dust Indicator, Model LD-5R

 Code No.
 : 080000-72

 Quantity
 : 1 unit

 Serial No.
 : 992818

 Sensitivity
 : 0.001 mg/m3

Sensitivity Adjustment : 638CPM

Scale Setting : September 3rd, 2019

We hereby certify that the above mentioned instrment has been calibrated satisfactory.

Sincerely

SIBATA SCIENTIFIC TECHNOLOGY LTD.

Tong Zhang

Overseas & New Business Group

Overseas Sales Department



### SIBATA SCIENTIFIC TECHNOLOGY LTD.

1-1-62, Nakane, Soka, Saitama, 340-0005 Japan

TEL: 048-933-1582 FAX: 048-933-1591

### **CALIBRATION CERTIFICATE**

Date: August 28th, 2019

Equipment Name : Digital Dust Indicator, Model LD-5R

Code No. : 080000-72

Quantity : 1 unit

Serial No. : 851820

Sensitivity : 0.001 mg/m3

Sensitivity Adjustment : 640

Scale Setting : August 23rd, 2019

We hereby certify that the above mentioned instrument has been calibrated satisfactory.

Sincerely

SIBATA SCIENTIFIC TECHNOLOGY LTD.

Tong Zhang

Overseas & New Business Group

Overseas Sales Department



### RECALIBRATION DUE DATE:

October 10, 2020

# Certificate of Calibration

Calibration Certification Information

Cal. Date: October 10, 2019

Rootsmeter S/N: 438320

Ta: 296

Pa: 748.03 ·

°K

Operator: Jim Tisch

mm Hg

Calibration Model #:	TE-5028A	Calibrator S/N: 3/U2

Run	Vol. Init (m3)	Vol. Final (m3)	ΔVol. (m3)	ΔTime (min)	ΔP (mm Hg)	ΔH (in H2O)
1	1	2	1	1.3100	4.1	1.50
2	3	4	1	1.0240	6.7	2.50
3	5	6	1	0.9260	8.0	3.00
4	7	8	1	0.8620	9.4	3.50
5	9	10	1	0.6540	16.2	6.00

Data Tabulation							
Vstd	Qstd	$\sqrt{\Delta H\left(\frac{Pa}{Pstd}\right)\left(\frac{Tstd}{Ta}\right)}$		Qa	√∆H(Ta/Pa)		
(m3)	(x-axis)	(y-axis)	Va	(x-axis)	(y-axis)		
0.9855	0.7523	1.2192	0.9945	0.7592	0.7704		
0.9820	0.9590	1.5739	0.9910	0.9678	0.9946		
0.9803	1.0586	1.7242	0.9893	1.0684	1.0895		
0.9784	1.1351	1.8623	0.9874	1.1455	1.1768		
0.9694	1.4823	2.4383	0.9783	1.4959	1.5409		
	m=	1.66723		m=	1.04399		
QSTD	b=	-0.03281	QA	b=	-0.02074		
	r=	0.99991		r=	0.99991		

	Calculation	s	
Vstd=	ΔVol((Pa-ΔP)/Pstd)(Tstd/Ta)	Va=	ΔVol((Pa-ΔP)/Pa)
Qstd=	Vstd/ΔTime	Qa= Va/ΔTime	
	For subsequent flow rate	e calculatio	ns:
Qstd=	$1/m\left(\left(\sqrt{\Delta H\left(\frac{Pa}{Pstd}\right)\left(\frac{Tstd}{Ta}\right)}\right)-b\right)$	Qa=	$1/m\left(\left(\sqrt{\Delta H\left(Ta/Pa\right)}\right)-b\right)$

	Standard Conditions
Tstd:	298.15 °K
Pstd:	760 mm Hg
	Key
ΔH: calibrator	manometer reading (in H2O)
ΔP: rootsmete	er manometer reading (mm Hg)
Ta: actual abs	olute temperature (°K)
Pa: actual bar	ometric pressure (mm Hg)
b: intercept	
m: slope	

### RECALIBRATION

US EPA recommends annual recalibration per 1998 40 Code of Federal Regulations Part 50 to 51, Appendix B to Part 50, Reference Method for the Determination of Suspended Particulate Matter in the Atmosphere, 9.2.17, page 30.

Tisch Environmental, Inc. 145 South Miami Avenue Village of Cleves, OH 45002

www.tisch-env.com

TOLL FREE: (877)263-7610 FAX: (513)467-9009

創新科儀有限公司

# HIVOL SAMPLER CALIBRATION DATA SHEET (TSP)

### Site Information

	YMT Catholic Primary				
Location:	School	Site ID:	W-A1	Date:	21-Mar-2020
Serial No:	1049	Model:	TE-5170X	Operator:	Tim

### **Ambient Condition**

Corrected Pressure (mm Hg):	761.6	Temperature (deg K):	294.2

### **Calibration Orifice**

Model:	TE-5028	Slope:	1.66723
Serial No.:	3702	Intercept:	-0.03281
Calibration Due Date:	10-Oct-20	Corr. Coeff:	0.99991

### **Calibration Data**

Plate or	In,H2O	Qa, X-Axis	I, CFM	IC, Y-Axis
Test#	(in)	(m3/min)	(chart)	(corrected)
1	2.04	0.883	29.1	29.32
2	2.93	1.054	33.7	33.95
3	3.20	1.101	35.0	35.26
4	3.94	1.219	38.2	38.49
5	4.37	1.283	39.8	40.10

### Sampler Calibtation Relationship (Oa on x-axis, IC on v-axis)

Sampler Cambe	ation iterationship (Qa on x	-axis, i	ic on y-axis,			
m=	27.0458	b=	5.4589		Corr. Coeff=	0.9999
Sampler set point(SSP) 38		38	CFM			
			Calculations			
Qstd = 1/m[Sqr	t(H2O(Pa/Pstd)(Tstd/Ta))-b]		m = sampler s	lope		
IC = I[Sqrt(Pa/P	std)(Tstd/Ta)]		b = sampler in I = chart respo			
Qstd = standard	d flow rate		Tav = average to	emperature		
IC = corrected of	chart response		Pav = average p	ressure		
	Qstd slope Qstd intercept perature during calibration (c ssure during calibration (mm	<b>J</b>				
•	Hg calculation of sampler flow: rt(298/Tav)(Pav/760)]					
	Tim					
Checked by:				Date:	21-M	ar-20

創新科儀有限公司

## HIVOL SAMPLER CALIBRATION DATA SHEET (TSP)

### Site Information

	YMT Catholic Primary				
Location:	School	Site ID:	W-A1	Date:	08-Apr-2020
Serial No:	1049	Model:	TE-5170X	Operator:	Tim

### **Ambient Condition**

Corrected Pressure (mm Hg):	/62.4	remperature (deg K):	293.6

### **Calibration Orifice**

Model:	TE-5028	Slope:	1.66723
Serial No.:	3702	Intercept:	-0.03281
Calibration Due Date:	10-Oct-20	Corr. Coeff:	0.99991

Plate or	ln,H2O	Qa, X-Axis	I, CFM	IC, Y-Axis
Test #	(in)	(m3/min)	(chart)	(corrected)
1	2.26	0.930	28.6	28.86
2	2.83	1.038	32.7	33.00
3	3.15	1.094	34.9	35.22
4	3.87	1.210	38.9	39.25
5	4.24	1.266	40.7	41.07

Sampler Calibta	ation Relationship (Qa on x	-axis,	IC on y-axis)			
m=	36.3114	b=	-4.7361	-	Corr. Coeff=	0.9994
Sampl	er set point(SSP)	39	CFM	_		
			Calculations			
Qstd = 1/m[Sqrt]	t(H2O(Pa/Pstd)(Tstd/Ta))-b]		m = sampler s	slope		
IC = I[Sqrt(Pa/Ps	std)(Tstd/Ta)]		b = sampler ii	ntercept		
			I = chart resp	onse		
Qstd = standard	I flow rate		Tav = average	temperature		
IC = corrected c	hart response		Pav = average	pressure		
I = actual chart i	response					
m = calibrator (	Qstd slope					
b = calibrator C	2std intercept					
Ta = actual temp	perature during calibration (d	deg K)				
Pa = actual pres	sure during calibration (mm	Hg)				
Tstd = $298 \text{ deg}$	K					
Pstd = 760 mm	На					
For subsequent	calculation of sampler flow:					
(1.21*m+b)/[Sqr	t(298/Tav)(Pav/760)]					
	Tim					
Checked by:				Date:	8-Ap	r-20

創新科儀有限公司

## HIVOL SAMPLER CALIBRATION DATA SHEET (TSP)

### Site Information

	YMT Catholic Primary				
Location:	School	Site ID:	W-A1	Date:	25-Apr-2020
Serial No:	1049	Model:	TE-5170X	Operator:	1

### **Ambient Condition**

Corrected Pressure (mm Hg):	763.6	remperature (deg K):	293.5

### **Calibration Orifice**

Model:	TE-5028	Slope:	1.66723
Serial No.:	3702	Intercept:	-0.03281
Calibration Due Date:	10-Oct-20	Corr. Coeff:	0.99991

Plate or	In,H2O	Qa, X-Axis	I, CFM	IC, Y-Axis
Test #	(in)	(m3/min)	(chart)	(corrected)
1	2.11	0.900	31.4	31.71
2	2.87	1.046	35.2	35.55
3	3.04	1.076	36.1	36.46
4	3.79	1.199	38.9	39.29
5	4.52	1.308	41.4	41.81

Sampler Calibta	ition Relationship (Qa on x	r-axis, l	IC on y-axis)			
m=	24.6631	b=	9.6978	-	Corr. Coeff=	0.9991
Sampl	er set point(SSP)	39	CFM	_		
		1	Calculations			
Qstd = 1/m[Sqrt]	(H2O(Pa/Pstd)(Tstd/Ta))-b]		m = sampler s	slope		
IC = I[Sqrt(Pa/Ps	td)(Tstd/Ta)]		b = sampler ir	ntercept		
			I = chart respo	onse		
Qstd = standard	flow rate		Tav = average t	temperature		
IC = corrected cl	hart response		Pav = average	pressure		
I = actual chart r	esponse					
m = calibrator (	2std slope					
b = calibrator Q	std intercept					
Ta = actual temp	perature during calibration (d	deg K)				
Pa = actual pres	sure during calibration (mm	Hg)				
Tstd = 298 deg l	<					
Pstd = 760 mm l	Hg					
For subsequent	calculation of sampler flow:					
(1.21*m+b)/[Sqr	t(298/Tav)(Pav/760)]					
	Tim					
Checked by:				Date:	25-Aı	or-20

創新科儀有限公司

## HIVOL SAMPLER CALIBRATION DATA SHEET (TSP)

### Site Information

Location:	Man Cheong Building	Site ID:	W-A6	Date:	21-Mar-2020
Serial No:	1050	Model:	TE-5170X	Operator:	Tim

### **Ambient Condition**

Corrected Pressure (mm Hg):	761.6	Temperature (deg K):	294.2
-----------------------------	-------	----------------------	-------

### **Calibration Orifice**

Model:	TE-5028	Slope:	1.66723
Serial No.:	3702	Intercept:	-0.03281
Calibration Due Date:	10-Oct-20	Corr. Coeff:	0.99991

Plate or	In,H2O	Qa, X-Axis	I, CFM	IC, Y-Axis
Test #	(in)	(m3/min)	(chart)	(corrected)
1	0.62	0.496	26.7	26.90
2	1.38	0.730	30.2	30.43
3	2.46	0.967	34.0	34.26
4	3.49	1.149	36.7	36.98
5	4.31	1.274	38.6	38.89

Sampler Camble	ition kelationship (Qa on x	-axis,	ic on y-axis)		
m=	15.4550	b=	19.2233	Corr. Coeff	= 0.9999
Sampl	er set point(SSP)	38	CFM		
			Calculations		
Qstd = 1/m[Sqrt]	(H2O(Pa/Pstd)(Tstd/Ta))-b]		m = sampler slope		
IC = I[Sqrt(Pa/Ps	td)(Tstd/Ta)]		<ul><li>b = sampler intercep</li><li>I = chart response</li></ul>	t	
Qstd = standard	flow rate		Tav = average temper	ature	
IC = corrected cl	hart response		Pav = average pressur	e	
I = actual chart r	esponse				
m = calibrator (	2std slope				
b = calibrator Q	std intercept				
Ta = actual temp	perature during calibration (d	deg K)			
Pa = actual pres	sure during calibration (mm	Hg)			
Tstd = 298 deg I	<				
•	Hg calculation of sampler flow: t(298/Tav)(Pav/760)]				
	Tim				
Checked by:			Date:	2	1-Mar-20

創新科儀有限公司

## HIVOL SAMPLER CALIBRATION DATA SHEET (TSP)

### Site Information

Location:	Man Cheong Building	Site ID:	W-A6	Date:	08-Apr-2020
Serial No:	1050	Model:	TE-5170X	Operator:	Tim

### **Ambient Condition**

Corrected Pressure (mm Hg):	762.4	Temperature (deg K):	293.6
-----------------------------	-------	----------------------	-------

### **Calibration Orifice**

Model:	TE-5028	Slope:	1.66723
Serial No.:	3702	Intercept:	-0.03281
Calibration Due Date:	10-Oct-20	Corr. Coeff:	0.99991

### **Calibration Data**

Plate or	In,H2O	Qa, X-Axis	I, CFM	IC, Y-Axis
Test #	(in)	(m3/min)	(chart)	(corrected)
1	1.17	0.674	27.7	27.95
2	1.84	0.841	30.5	30.78
3	2.46	0.969	33.1	33.40
4	3.57	1.163	36.7	37.03
5	4.17	1.256	38.3	38.65

### Sampler Calibtation Relationship (Qa on x-axis, IC on y-axis)

Jumpier Camb	ation iterationsing (Qu on	х ахіз, .	c on y ums,			
m=	18.6178	b=	15.3055	_	Corr. Coeff=	0.9997
Samp	oler set point(SSP)	37	CFM	_		
		(	Calculations			
Qstd = 1/m[Sqi	rt(H2O(Pa/Pstd)(Tstd/Ta))-b]		m = sampler	slope		
IC = I[Sqrt(Pa/P	'std)(Tstd/Ta)]		b = sampler i I = chart resp	•		
Qstd = standar	d flow rate		Tav = average	temperature		
IC = corrected	chart response		Pav = average	pressure		
I = actual chart	response					
m = calibrator	Qstd slope					
b = calibrator	Qstd intercept					
Ta = actual tem	perature during calibration	(deg K)				
Pa = actual pre	ssure during calibration (mn	n Hg)				
Tstd = 298 deg	K					
	Hg calculation of sampler flow rt(298/Tav)(Pav/760)]	:				
	Tim					
Checked by:				Date:	8-Ap	r-20

創新科儀有限公司

## HIVOL SAMPLER CALIBRATION DATA SHEET (TSP)

### Site Information

Location:	Man Cheong Building	Site ID:	W-A6	Date:	25-Apr-2020
Serial No:	1050	Model:	TE-5170X	Operator:	Tim

### **Ambient Condition**

Corrected Pressure (mm Hg):	763.6	Lemperature (deg K):	293.5
` "		1 ' ' '	

### **Calibration Orifice**

Model:	TE-5028	Slope:	1.66723
Serial No.:	3702	Intercept:	-0.03281
Calibration Due Date:	10-Oct-20	Corr. Coeff:	0.99991

Plate or	In,H2O	Qa, X-Axis	I, CFM	IC, Y-Axis
Test #	(in)	(m3/min)	(chart)	(corrected)
1	0.74	0.541	25.3	25.55
2	1.39	0.734	28.9	29.19
3	2.48	0.974	33.6	33.94
4	3.52	1.156	36.9	37.27
5	4.24	1.267	38.7	39.09

Sampler Calibta	rtion Relationship (Qa on )	c-axis, l	C on y-axis)			
m=	18.8023	b=	15.4393		Corr. Coeff=	0.9997
Sample	er set point(SSP)	38	CFM			
			Calculations			
Qstd = 1/m[Sqrt IC = I[Sqrt(Pa/Ps	(H2O(Pa/Pstd)(Tstd/Ta))-b] td)(Tstd/Ta)]		m = sampler slope b = sampler intercept	:		
	nart response esponse Qstd slope	<b>J</b>	I = chart response  Tav = average tempera  Pav = average pressure			
Tstd = 298 deg k	<					
•	Hg calculation of sampler flow: t(298/Tav)(Pav/760)]					
	Tim					
Checked by:			Date:		25-A <sub>J</sub>	or-20

Appendix I Calibration Certificates (Noise)
Calibration Certificates (Noise)



# Certificate of Calibration

for

Description: Sound Level Meter

Manufacturer: NTi Audio

Type No.: XL2 (Serial No.: A2A-13663-E0)

Microphone: ACO 7052 (Serial No.:73784)

Preamplifier: NTi Audio MA220 (Serial No.:6282)

Submitted by:

Customer: Acuity Sustainability Consulting Limited

Address: Unit 1908, Nos. 301-305 Castle Peak Road, Kwai Chung, N.T.

Upon receipt for calibration, the instrument was found to be:

**✓** Within ☐ Outside

the allowable tolerance.

The test equipment used for calibration are traceable to National Standards via:

The Government of The Hong Kong Special Administrative Region Standard & Calibration Laboratory

Date of receipt: 11 September 2019

Date of calibration: 12 September 2019

Calibrated by:

Calibration Technician

Certified by:

Mr. Ng Yan Wa Laboratory Manager

Date of issue: 12 September 2019

Page 1 of 4 Certificate No.: APJ19-078-CC001

Room 422, Leader Industrial Centre, 57-59 Au Pui Wan Street, Fo Tan, Shatin, N.T., Hong Kong Tel: (852) 2668 3423 Fax: (852) 2668 6946 Homepage: http://www.aa-lab.com E-mail: inquiry@aa-lab.com

# (**A+A**) \* L Acoustics and Air Testing Laboratory Co. Ltd. 聲學及空氣測試實驗室有限公司

### 1. Calibration Precaution:

- The unit-under-test (UUT) was allowed to stabilize in the laboratory for over 24 hours, and switched on to warm up for over 10 minutes before the commencement of the test.
- The results presented are the mean of 3 measurements at each calibration point.

### 2. Calibration Conditions:

Air Temperature: 24.2 °C
Air Pressure: 1008 hPa
Relative Humidity: 69.2 %

### 3. Calibration Equipment:

	Type	Serial No.	Calibration Report Number	Traceable to
Multifunction Calibrator	B&K 4226	2288467	AV180064	HOKLAS

### 4. Calibration Results

Sound Pressure Level

Reference Sound Pressure Level

Sett	etting of Unit-under-test (UUT)		Applied value		UUT Reading,	IEC 61672 Class 1	
Range, dB	Freq.	Weighting	Time Weighting	Level, dB	Frequency, Hz	dB	Specification, dB
30-130	dBA	SPL	Fast	94	1000	94.0	±0.4

### Linearity

Setting of Unit-under-test (UUT)			App	lied value	UUT Reading,	IEC 61672 Class 1	
Range, dB	Freq. W	eighting	Time Weighting	Level, dB	Frequency, Hz	dB	Specification, dB
				94		94.0	Ref
30-130	dBA	SPL	Fast	104	1000	104.0	±0.3
				114		114.0	±0.3

### Time Weighting

Setting of Unit-under-test (UUT)			Appl	ied value	UUT Reading,	IEC 61672 Class 1	
Range, dB	Freq. W	eighting	Time Weighting	Level, dB Frequency, Hz		dB	Specification, dB
30-130	dBA	SPL	Fast	94	1000	94.0	Ref
30-130	UDA	SPL	Slow	94	1000	94.0	+0.3

Certificate No.: APJ19-078-CC001

(A+A) \*L

Page 2 of 4

Room 422, Leader Industrial Centre, 57-59 Au Pui Wan Street, Fo Tan, Shatin, N.T., Hong Kong
Tel: (852) 2668 3423 Fax: (852) 2668 6946



Frequency Response

Linear Response

Setting of Unit-under-test (UUT)			App	lied value	UUT Reading,	IEC 61672 Class 1	
Range, dB	Freq. We	eighting	Time Weighting	Level, dB	Frequency, Hz	dB	Specification, dB
			31.5	94.1	EC 61672 Class I Specification, dB  ±2.0  ±1.5  ±1.5  ±1.4  ±1.4  Ref  ±1.6  ±1.6		
				63	94.1	±1.5	
					125	94.2	±1.5
					250	94.1	±1.4
30-130	dB	SPL	Fast	94	500	94.1	±1.4
					1000	94.0	Ref
					2000	93.7	±1.6
					4000	94.1	±1.6
					8000	93.7	+2.1; -3.1

### A-weighting

Setting of Unit-under-test (UUT)			Appl	ied value	UUT Reading,	IEC 61672 Class 1	
Range, dB	Freq. W	eighting	Time Weighting	Level, dB	Frequency, Hz	dB	Specification, dB
					31.5	54.6	-39.4 ±2.0
					63	67.9	-26.2 ±1.5
					125	78.1	-16.1 ±1.5
					250	85.5	-8.6±1.4
30-130	dBA	SPL	Fast	94	500	90.8	-3.2±1.4
					1000	94.0	Ref
					2000	94.9	+1.2±1.6
					4000	95.1	+1.0±1.6
					8000	92.6	-1.1+2.1; -3.1

### C-weighting

Setting of Unit-under-test (UUT)			Appl	ied value	UUT Reading,	IEC 61672 Class 1	
Range, dB	Freq. W	eighting	Time Weighting	Level, dB	Frequency, Hz	dB	Specification, dB
					31.5	91.1	-3.0 ±2.0
					63	93.3	-0.8 ±1.5
					125	94.0	-0.2 ±1.5
					250	94.1	-0.0 ±1.4
30-130	dBC	SPL	Fast	94	500	94.1	-0.0 ±1.4
					1000	94.0	Ref
					2000	93.6	-0.2 ±1.6
					4000	93.4	-0.8 ±1.6
					8000	90.7	-3.0+2.1; -3.1

(A+A) \*L

Page 3 of 4

Certificate No.: APJ19-078-CC001

Room 422, Leader Industrial Centre, 57-59 Au Pui Wan Street , Fo Tan, Shatin, N.T., Hong Kong Tel: (852) 2668 3423 Fax: (852) 2668 6946



### 5. Calibration Results Applied

The results apply to the particular unit-under-test only. All calibration points are within manufacture's specification as IEC 61672 Class 1.

Uncertainties of Applied Value:

94 dB	31.5 Hz	± 0.05
	63 Hz	± 0.05
	125 Hz	± 0.05
	250 Hz	± 0.05
	500 Hz	± 0.05
	1000 Hz	± 0.05
	2000 Hz	± 0.05
	4000 IIz	± 0.05
	8000 Hz	+ 0.10
104 dB	1000 Hz	± 0.05
114 dB	1000 Hz	± 0.05

The uncertainties are evaluated for a 95% confidence level.

### Note:

The values given in this certification only related to the values measured at the time of the calibration and any uncertainties quoted will not allow for the equipment long-term drift, variations with environmental changes, vibration and shock during transportation, overloading, mis-handling, or the capability of any other laboratory to repeat the calibration. (A+A)\*L shall not be liable for any loss or damage resulting from the use of the equipment.



Certificate No.: APJ19-078-CC001

Page 4 of 4



# Certificate of Calibration

for

Description: Sound Level Meter

Manufacturer: NTi Audio

 Type No.:
 XL2 (Serial No.: A2A-13548-E0)

 Microphone:
 ACO 7052 (Serial No.:73780)

Preamplifier: NTi Audio MA220 (Serial No.:5235)

Submitted by:

Customer: Acuity Sustainability Consulting Limited

Address: Unit 1908, iPlace, Nos. 301-305 Castle Peak Road,

Kwai Chung, New Territories

Upon receipt for calibration, the instru	ument was found to be:
--	------------------------

✓ Within☐ Outside

the allowable tolerance.

The test equipment used for calibration are traceable to National Standards via:

- The Government of The Hong Kong Special Administrative Region Standard & Calibration Laboratory

Date of receipt: 6 January 2020

Date of calibration: 10 January 2020

Calibration Technician

Certified by:

Tang Cheuk Hang Quality Manager

Date of issue: 10 January 2020

Certificate No.: APJ19-143-CC001

Page 1 of 4

Room 422, Leader Industrial Centre, 57-59 Au Pui Wan Street , Fo Tan, Shatin, N.T., Hong Kong
Tel: (852) 2668 3423 Fax: (852) 2668 6946

Homepage: http://www.aa-lab.com E-mail:inquirv@aa-lab.com



### 1. Calibration Precaution:

- The unit-under-test (UUT) was allowed to stabilize in the laboratory for over 24 hours, and switched on to warm up for over 10 minutes before the commencement of the test.
- The results presented are the mean of 3 measurements at each calibration point.

### 2. Calibration Conditions:

Air Temperature: 23.0 °C
Air Pressure: 1006 hPa
Relative Humidity: 71.0 %

### 3. Calibration Equipment:

	Type	Serial No.	Calibration Report Number	Traceable to
Multifunction Calibrator	B&K 4226	2288467	AV180064	HOKLAS

### 4. Calibration Results

Sound Pressure Level

Reference Sound Pressure Level

Sett	ing of U	nit-under-t	est (UUT)	Applied value		UUT Reading,	IEC 61672 Class 1
Range, dB	Freq. V	Weighting	Time Weighting	Level, dB Frequency, Hz		dB	Specification, dB
30-130	dBA	SPL	Fast	94	1000	94.0	±0.4

### Linearity

Setting of Unit-under-test (UUT)			Appl	ied value	UUT Reading,	IEC 61672 Class 1	
Range, dB	Freq. W	eighting	Time Weighting	Level, dB	Frequency, Hz	dB	Specification, dB
				94		94.0	Ref
30-130	dBA	SPL	Fast	104	1000	104.0	±0.3
				114		114.0	±0.3

### Time Weighting

Setting of Unit-under-test (UUT)			Appl	ied value	UUT Reading,	IEC 61672 Class 1	
Range, dB Freq. Weighting Time Weighting		Level, dB	Frequency, Hz	dB	Specification, dB		
20 120	30-130 dBA SPL Fast Slow		Fast	94	1000	94.0	Ref
30-130			94	1000	94.0	±0.3	

Certificate No.: APJ19-143-CC001

A+A) \*L Page 2 of 4

Room 422, Leader Industrial Centre, 57-59 Au Pui Wan Street , Fo Tan, Shatin, N.T., Hong Kong
Tel: (852) 2668 3423 Fax: (852) 2668 6946

Homepage: http://www.aa-lab.com E-mail:inguirv@aa-lab.com



Frequency Response

### Linear Response

Sett	Setting of Unit-under-test (UUT)			Appl	ied value	UUT Reading,	IEC 61672 Class 1	
Range, dB	Freq. Weighting		Time Weighting	Level, dB	Frequency, Hz	dB	Specification, dB	
				31.5	94.0	±2.0		
					63	94.1	±1.5	
			125	94.1	±1.5			
				250	94.0	±1.4		
30-130	dB	SPL	Fast	94	500	94.0	±1.4	
					1000	94.0	Ref	
					2000	93.8	±1.6	
					4000	93.4	±1.6	
					8000	92.4	+2.1; -3.1	

### A-weighting

Sett	Setting of Unit-under-test (UUT)			Appl	ied value	UUT Reading,	IEC 61672 Class 1	
Range, dB	Freq. Weighting		Time Weighting	Level, dB	Frequency, Hz	dB	Specification, dB	
				31.5	54.8	-39.4 ±2.0		
				63	67.9	-26.2 ±1.5		
			125	78.0	-16.1 ±1.5			
				250	85.4	-8.6 ±1.4		
30-130	dBA	SPL	Fast	94	500	90.8	-3.2 ±1.4	
					1000	94.0	Ref	
					2000	95.0	+1.2±1.6	
					4000	94.4	+1.0±1.6	
					8000	91.3	-1.1+2.1; -3.1	

### C-weighting

Setti	Setting of Unit-under-test (UUT)			Appl	ied value	UUT Reading,	IEC 61672 Class 1	
Range, dB	Freq. Weighting		Time Weighting	Level, dB	Frequency, Hz	dB	Specification, dB	
			31.5	91.0	-3.0 ±2.0			
				63	93.3	-0.8 ±1.5		
			125	93.9	-0.2 ±1.5			
			250	94.1	-0.0 ±1.4			
30-130	dBC	SPL	Fast	94	500	94.1	-0.0 ±1.4	
					1000	94.0	Ref -0.2±1.6 -0.8±1.6	
					2000	93.6		
					4000	92.6		
				8000	89.4	-3.0 +2.1: -3.1		

Certificate No.: APJ19-143-CC001

(A+A)\*L

Page 3 of 4

Room 422, Leader Industrial Centre, 57-59 Au Pui Wan Street , Fo Tan, Shatin, N.T., Hong Kong Tel: (852) 2668 3423 Fax: (852) 2668 6946



### 5. Calibration Results Applied

The results apply to the particular unit-under-test only. All calibration points are within manufacture's specification as IEC 61672 Class 1.

Uncertainties of Applied Value:

94 dB	31.5 Hz	± 0.10
	63 Hz	± 0.05
	125 Hz	± 0.10
	250 Hz	± 0.10
	500 Hz	± 0.10
	1000 Hz	± 0.05
	2000 Hz	± 0.05
	4000 Hz	± 0.05
	8000 Hz	± 0.10
104 dB	1000 Hz	± 0.05
114 dB	1000 Hz	± 0.05

The uncertainties are evaluated for a 95% confidence level.

### Note:

The values given in this certification only related to the values measured at the time of the calibration and any uncertainties quoted will not allow for the equipment long-term drift, variations with environmental changes, vibration and shock during transportation, overloading, mis-handling, or the capability of any other laboratory to repeat the calibration. (A+A)\*L shall not be liable for any loss or damage resulting from the use of the equipment.



Page 4 of 4

Certificate No.: APJ19-143-CC001

Room 422, Leader Industrial Centre, 57-59 Au Pui Wan Street , Fo Tan, Shatin, N.T., Hong Kong
Tel: (852) 2668 3423 Fax: (852) 2668 6946



### **CALIBRATION CERTIFICATE**

Certificate Informati	on		<b>电影,种外</b>	<b>有声象</b>					
Date of Issue	28-Sep-2019		Ce	rtificate Number	MLCN192490S				
Customer Informatio	on				THE STREET				
Company Name Address	Unit C, 11/F, Fo No. 37-39 Wing	bility Consulting Lim ord Glory Plaza, g Hong Street, an, Kowloon, Hong Ko							
Equipment-under-To	est (EUT)								
Description Manufacturer Model Number Serial Number Equipment Number	Acoustic Calibr Pulsar 105 63705	rator							
Calibration Particula	ar				THE PERSON NAMED IN				
Date of Calibration Calibration Equipment	I have a second a second and a second								
Calibration Procedure	MLCG00, ML	CG15							
Calibration Conditions	Laboratory	Temperature Relative Humidity Stabilizing Time Warm-up Time Power Supply	23 °C ± 5 °C 55% ± 25% Over 3 hour Not applica Internal bat	rs ble					
Calibration Results		a were detailed in the cresults were within EU		1 D					
Approved By & Date			10	K.O. Lo	28-Sep-2019				
* Calibration equipment used The results on this Calibrat not include allowance for it overloading, mishandling, MaxLab Calibration Centre The copy of this Certificate prior written approval of M	ion Certificate only the EUT long term do misuse, and the capa a Limited shall not b is owned by MaxL	relate to the values measur rift, variation with environ city of any other laborator e liable for any loss or dan ab Calibration Centre Lim	red at the time o mental changes, y to repeat the r nage resulting fr	f the calibration and the vibration and shock dur- neasurement. From the use of the EUT.	ring transportation,				

Page 1 of 2

萬 儀 校 正 中 心 有 限 公 司 MaxLab Calibration Centre Limited 香港新界葵涌華星街 16-18 號保盈工業大廈 9 樓 B 室 Unit B. 9/F., Boldwin Industriat Bldg., 16-18 Wah Sing Street, Kwai Chung, N.T., Hong Kong Tel: (852) 2116 1380 Fax: (852) 2264 6480 Email: info@maxlab.com.hk



Certificate No. MLCN192490S

Calibration Data	THE RESERVE OF THE PARTY OF THE			217 324
EUT Setting	Standard Reading	EUT Error from Setting	Calibration Uncertainty	EUT Specification
94 dB	93.8 dB	-0.2 dB	0.20 dB	± 0.2 dB

- END -

Calibrated By: Date:

Dan 28-Sep-19


Checked By:

Date:

K.O. Lo 28-Sep-19

Page 2 of 2

香港新界裝滿華星街 16-18 號保盈工業大廈 9 樓 B 室 Unit B, 9/F., Boldwin Industrial Bldg., 16-18 Wah Sing Street, Kwai Chung, N.T., Hong Kong Tel: (852) 2116 1380 Fax: (852) 2264 6480 Email: info@maxlab.com.hk



Appendix J
The Certification of Laboratory with HOKLAS
Accredited Analytical Tests



Hong Kong Accreditation Service 香港認可處

### **Certificate of Accreditation**

認可證書

This is to certify that 特此證明

### ALS TECHNICHEM (HK) PTY LIMITED

11/F., Chung Shun Knitting Centre, 1-3 Wing Yip Street, Kwai Chung, New Territories, Hong Kong 香港新界葵涌永業街1-3號忠信針織中心11樓

has been accepted by the HKAS Executive, on the recommendation of the Accreditation Advisory Board, as a 為香港認可處執行機關根據認可諮詢委員會建議而接受的

### **HOKLAS Accredited Laboratory** 「香港實驗所認可計劃」認可實驗所

This laboratory meets the requirements of ISO / IEC 17025 : 2005 - General requirements for the competence 此實驗所符合ISO / IEC 17025: 2005 - (测試及校正實驗所能力的通用規定)所訂的要求 of testing and calibration laboratories and it has been accredited for performing specific tests or calibrations as 機認可進行截於香港實驗所認可計劃(認可實驗所名冊)內下溫測試類別中的指定 listed in the HOKLAS Directory of Accredited Laboratories within the test category of 测试或校正工作

### **Environmental Testing** 環境測試

This laboratory is accredited in accordance with the recognised international Standard ISO / IEC 17025 ; 2005. 本實驗所乃根據公認的國際標準 ISO / IEC 17025 ; 2005 獲得認可。 This accreditation demonstrates technical competence for a defined scope and the operation of a laboratory 透項認可資格深示在指定範疇所開的技術能力及實驗所質量管理關系的運作 quality management system (see joint IAF-ILAC-ISO Communiqué), (見國際認可論權、國際實驗所認可合作組織及國際標準化組織的聯合公報)。

The common seal of the Hong Kong Accreditation Service is affixed hereto by the authority of the HKAS Executive 香港認可處根據認可處執行機關的權限在此蓋上通用印章

CHAN Sing Sing, Terence, Executive Administrator

執行幹事 陳成城 Issue Date: 5 May 2009

簽發日期:二零零九年五月五日

Registration Number : NONLAS 066

註冊號碼:

Date of First Registration: 15 September 1995 首次註冊日期:一九九五年九月十五日

This certificate is issued subject to the terms and conditions laid down by HKAS 本题者按照香港如可應訂立的複數及條件發出

L 000552



**Hong Kong Accreditation Service** 香港認可處

### **Certificate of Accreditation**

認可證書

This is to certify that 特此證明

### ACUMEN LABORATORY AND TESTING LIMITED

浩科檢測中心有限公司

Lot 12, Tam Kon Shan Road, North Tsing Yi, New Territories, Hong Kong 香港新界青衣北担杆山路12路段

has been accepted by the HKAS Executive, on the recommendation of the Accreditation Advisory Board, as a 在認可諮詢委員會的建議下獲香港認可處執行機關接受為

> **HOKLAS Accredited Laboratory** 「香港實驗所認可計劃」認可實驗所

This laboratory meets the requirements of ISO/IEC 17025:2005 and it has been accredited for performing specific tests or calibrations as listed in the scope of accreditation within the test category of

### **Environmental Testing**

此實驗所符合ISO/IEC 17025:2005所訂的要求 並獲認可進行載於認可範圍內下述測試類別中的指定測試或校正工作

### 環境測試

This accreditation to ISO/IEC 17025:2005 demonstrates technical competence for a defined scope and the operation of a laboratory quality management system (see joint IAF-ILAC-ISO Communiqué). 此項 ISO/IEC 17025:2005 的認可資格證明此實驗所具備指定範疇內所須的技術能力並 實施一套實驗所質量管理體系(見國際認可論壇、國際實驗所認可合作組織及國際標準化組織的聯合公報)。

The common seal of the Hong Kong Accreditation Service is affixed hereto by the authority of the HKAS Executive 現經香港認可處執行機關授權在此蓋上香港認可處的印章

WONG Wang-wah, Executive Administrator

執行幹事 黃宏華 Issue Date: 16 July 2014

簽發日期:二零一四年七月十六日

註冊號碼:

Registration Number : HOKLAS 241


Date of First Registration: 16 July 2014 首次註冊日期:二零一四年七月十六日


This certificate is issued subject to the terms and conditions laid down by HKAS 本證書按照香港認可處訂立的條款及條件發出

L 001195

Contract No. HY/2014/08
Environmental Monitoring & Auditing

Appendix K
Location Plan of Noise and Air Quality
Monitoring Station

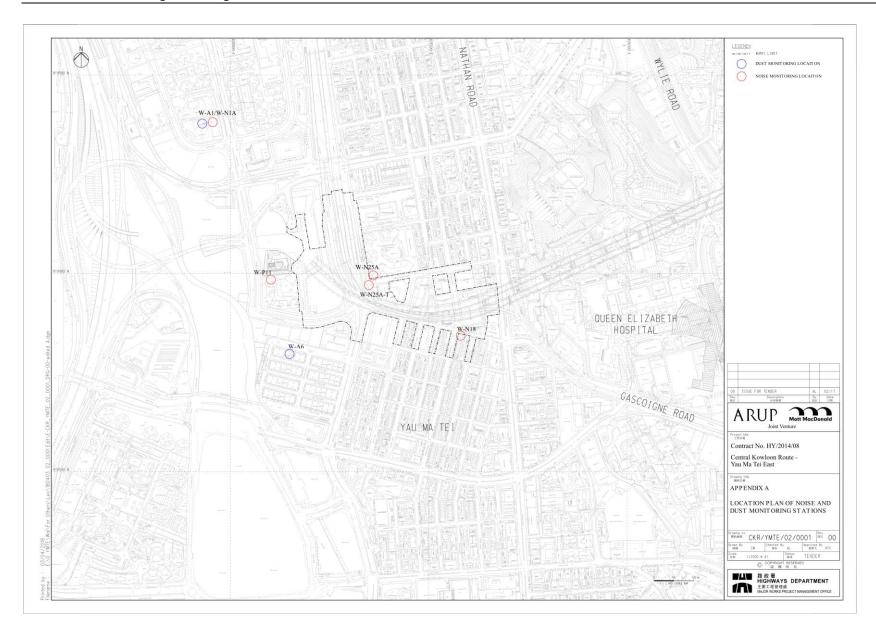

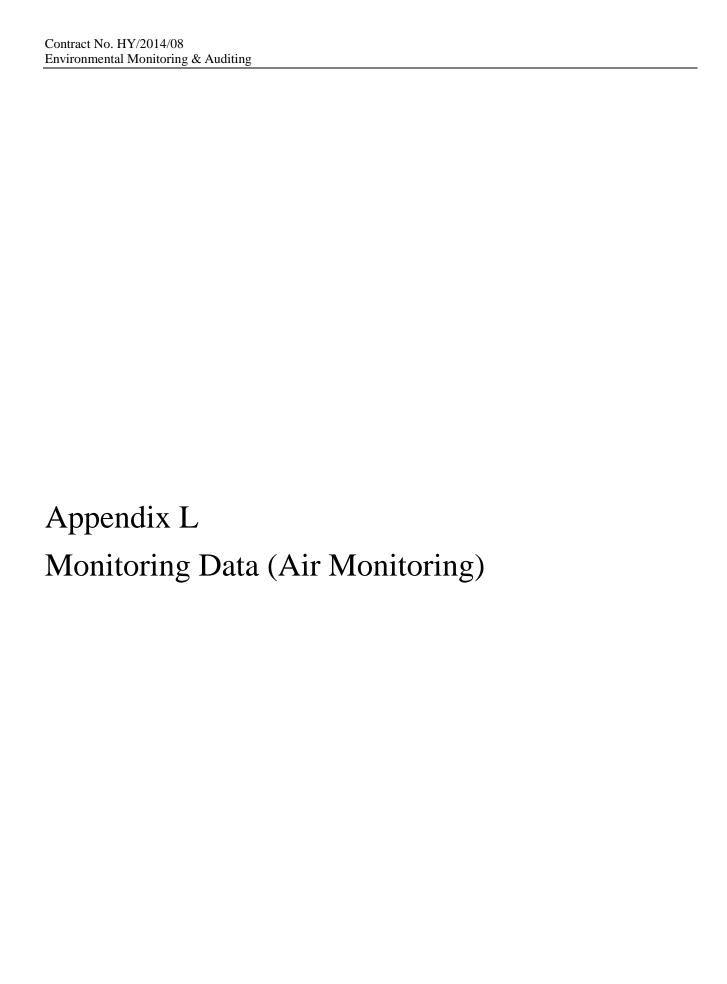

Location: Yau Ma Tei Catholic Primary School (Hoi Wang Road) (W-A1)

Monitoring date: 3, 8, 14, 20, 25, 29 April 2020

Parameter: TSP 1-hour

Other Factors Nearby traffic, construction work from West Kowloon Government

Offices, school activities

	1-hour TSP (μg/m³)									
Date	Weather	Start Time	1 <sup>st</sup> Hour (μg/m³)	2 <sup>nd</sup> Hour (μg/m³)	3 <sup>rd</sup> Hour (μg/m³)					
03/04/2020	Cloudy	13:15	46	68	61					
08/04/2020	Sunny	11:30	65	72	61					
14/04/2020	Sunny	9:03	44	40	51					
20/04/2020	Sunny	11:40	60	67	54					
25/04/2020	Fine	9:16	46	40	47					
29/04/2020	Sunny	14:30	39	52	50					

Location: Man Cheong Building (W-A6)
Monitoring date: 3, 8, 14, 20, 25, 29 April 2020

Parameter: TSP 1-hour
Other Factors Nearby traffic

			1-hour TSP (µ	ιg/m³)	
Date	Weather	Start Time	1 <sup>st</sup> Hour (μg/m³)	2 <sup>nd</sup> Hour (μg/m³)	3 <sup>rd</sup> Hour (μg/m³)
03/04/2020	Cloudy	12:35	43	48	57
08/04/2020	Sunny	10:20	58	53	64
14/04/2020	Sunny	9:28	52	58	60
20/04/2020	Sunny	9:00	58	51	63
25/04/2020	Fine	9:41	43	47	53
29/04/2020	Sunny	13:00	44	49	53

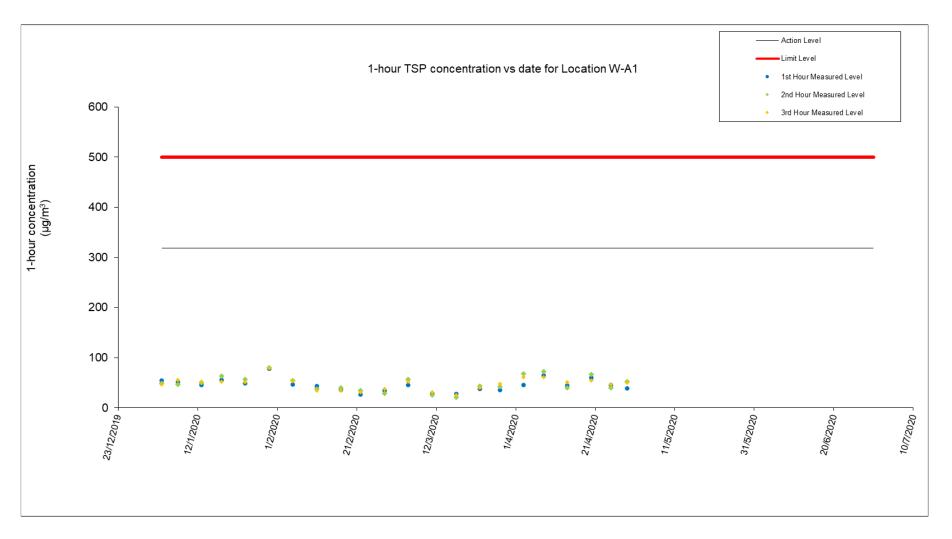


Figure 1: Graphical Illustration of Measured 1-hour TSP ( $\mu g/m^3$ ) Levels at W-A1

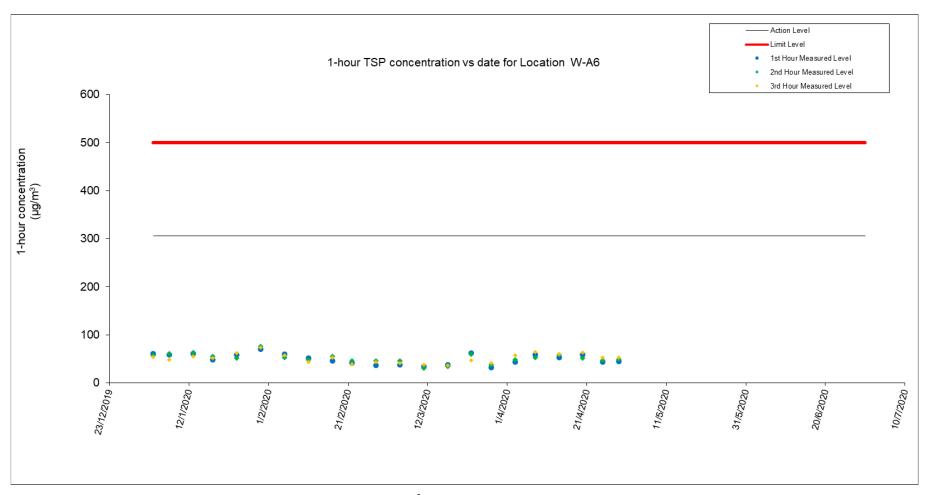


Figure 2: Graphical Illustration of Measured 1-hour TSP (μg/m³) Levels at W-A6

Location: Yau Ma Tei Catholic Primary School (Hoi Wang Road) (W-A1)

Monitoring date: 3, 8, 14, 20, 25, 29 April 2020

Parameter: TSP 24-hour

Other Factors Nearby traffic, construction work from West Kowloon Government Offices

Date of Calibration:	25-Apr-20	Slope =	24.6631
Calibration due date:	10-May-20	Intercept =	9.6978
Date of Calibration:	8-Apr-20	Slope =	36.3114
Calibration due date:	23-Apr-20	Intercept =	-4.7361
Date of Calibration:	21-Mar-20	Slope =	27.0458
Calibration due date:	5-Apr-20	Intercept =	5.4589

IStart Date	Weather Condition		Elapse Time		C	Chart Reading		Avg Air Temp	Avg Atmospheric Pressure		Standard Air Volume	Filter Weight	(g)	Particulate weight	Conc.
		Initial	Final	Actual (min)	Min	Max	Avg	(°C)	(hPa)	(m³/min)	(m <sup>3</sup> )	Initial	Final	(g)	$(\mu g/m^3)$
03/04/2020	Cloudy	3434.1	3458.1	1440.0	38	39	38.5	20.4	1017.2	1.24	1783	2.7378	2.7798	0.0420	24
08/04/2020	Sunny	3459.1	3483.1	1440.0	37	39	38.0	20.6	1016.5	1.19	1711	2.6918	2.7632	0.0714	42
14/04/2020	Sunny	3483.1	3507.1	1440.0	38	40	39.0	21.1	1017.5	1.22	1751	2.7186	2.8427	0.1241	71
20/04/2020	Sunny	3507.1	3531.1	1440.0	39	40	39.5	26.4	1012.5	1.21	1749	2.7321	2.7973	0.0652	37
25/04/2020	Fine	3532.1	3556.1	1440.0	37	40	38.5	20.5	1018.1	1.19	1710	2.6922	2.8319	0.1397	82
29/04/2020	Sunny	3556.1	3580.1	1440.0	38	40	39.0	24.2	1017.0	1.20	1722	2.7202	2.8303	0.1101	64

Location: Man Cheong Building (W-A6)
Monitoring date: 3, 8, 14, 20, 25, 29 April 2020

Parameter: TSP 24-hour
Other Factors Nearby traffic

Date of Calibration:	25-Apr-20	Slope =	18.8023
Calibration due date:	10-May-20	Intercept =	15.4393
Date of Calibration:	8-Apr-20	Slope =	18.6178
Calibration due date:	23-Apr-20	Intercept =	15.3055
Date of Calibration:	21-Mar-20	Slope =	15.4550
Calibration due date:	5-Apr-20	Intercept =	19.2233

Start Date	Weather Condition	Elapse Time		Chart Reading		Avg Air Temp	Avg Atmospheric Pressure	Flow Rate	Standard Air Volume	Filter Weight	( <b>o</b> )	Particulate weight	Conc.		
		Initial	Final	Actual (min)	Min	Max	Avg	(°C)	(hPa)	(m³/min)	( <b>m</b> <sup>3</sup> )	Initial	Final	(g)	$(\mu g/m^3)$
03/04/2020	Cloudy	3072.5	3096.5	1440.00	36	39	37.5	20.4	1017.2	1.21	1744	2.762	2.8164	0.0544	31
08/04/2020	Sunny	3097.5	3121.5	1440.00	36	38	37.0	20.6	1016.5	1.19	1709	2.7409	2.8253	0.0844	49
14/04/2020	Sunny	3121.5	3145.5	1440.00	37	39	38.0	21.1	1017.5	1.24	1787	2.7489	2.8897	0.1408	79
20/04/2020	Sunny	3145.5	3169.5	1440.00	35	38	36.5	26.4	1012.5	1.13	1631	2.7329	2.8082	0.0753	46
25/04/2020	Fine	3170.5	3194.5	1440.00	36	39	37.5	20.5	1018.1	1.20	1725	2.7163	2.8881	0.1718	100
29/04/2020	Sunny	3194.5	3218.5	1440.00	37	38	37.5	24.2	1017.0	1.18	1704	2.7190	2.8559	0.1369	80

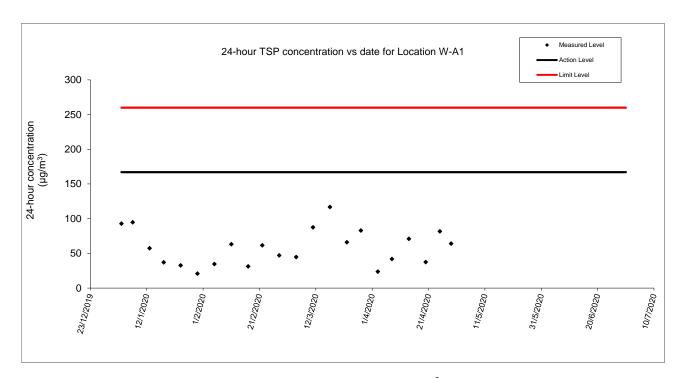


Figure 3: Graphical Illustration of Measured 24-hour TSP (µg/m³) Levels at W-A1

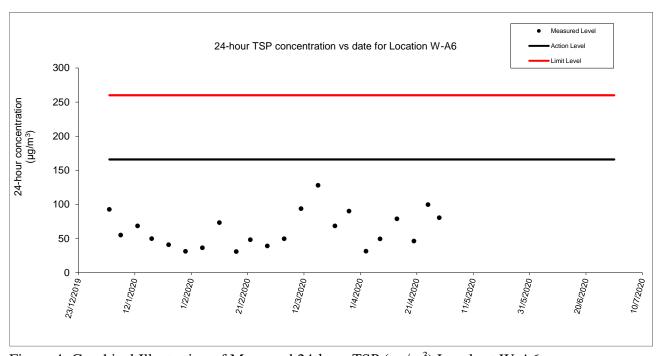



Figure 4: Graphical Illustration of Measured 24-hour TSP ( $\mu g/m^3$ ) Levels at W-A6

### Wind direction data for 3, 4, 8, 9, 14, 15, 20, 21, 25, 26, 29, 30 April 2020


### Wind Direction:




### Wind Direction:

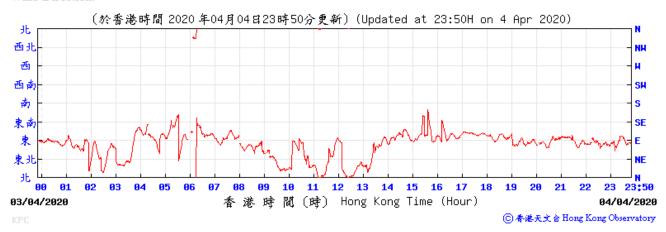


### Wind Direction:

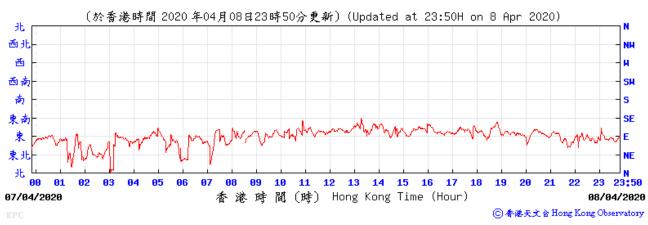


### Wind Direction:

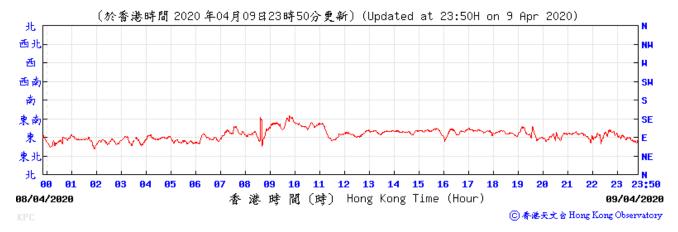


### Wind Direction:

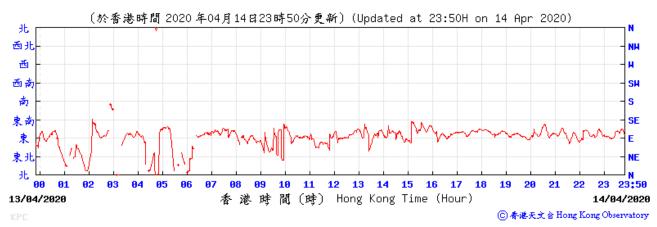

### Wind Direction:

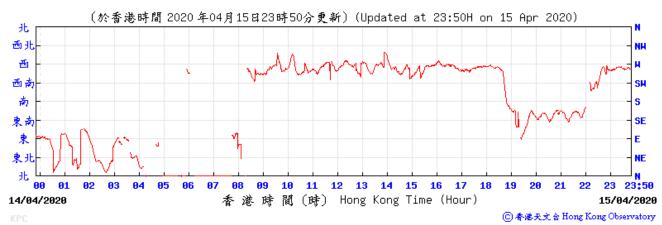


#### Wind Direction:

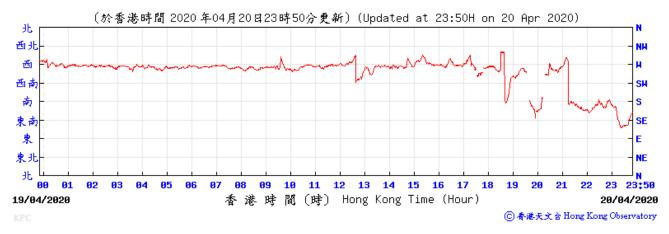


#### Wind Direction:



#### Wind Direction:

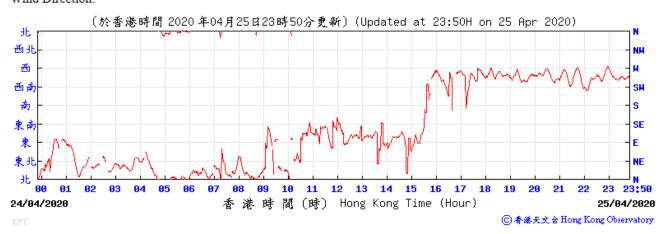


#### Wind Direction:

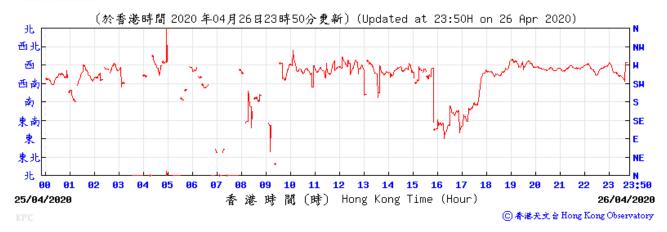


#### Wind Direction:



#### Wind Direction:

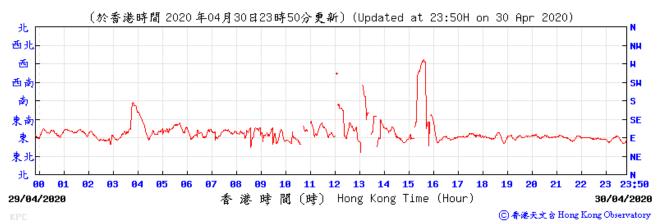

#### Wind speed data for 3, 4, 8, 9, 14, 15, 20, 21, 25, 26, 29, 30 April 2020

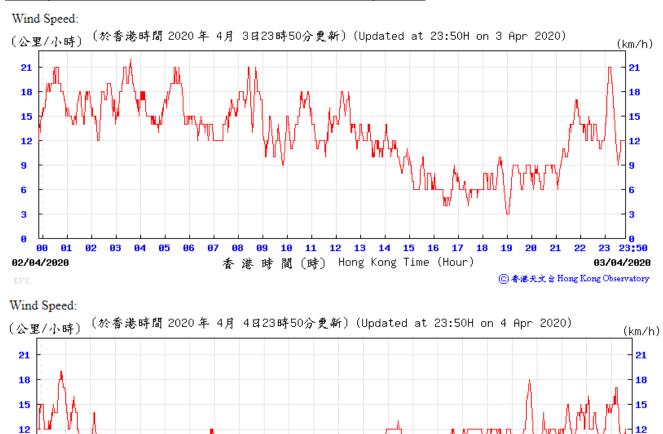




03/04/2020

**91** 

04 05 06 07

9

3

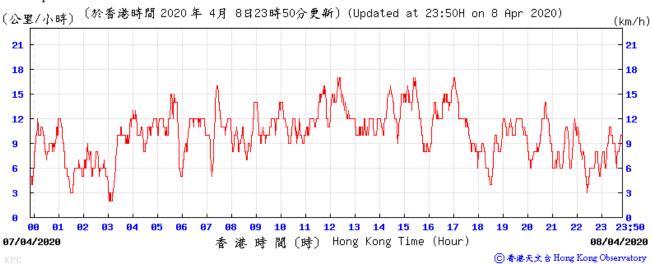

12 13 14 15 16

香港時間(時) Hong Kong Time (Hour)

23 23:50

⑥香港天文含 Hong Kong Observatory


04/04/2020

10







#### Wind Speed:

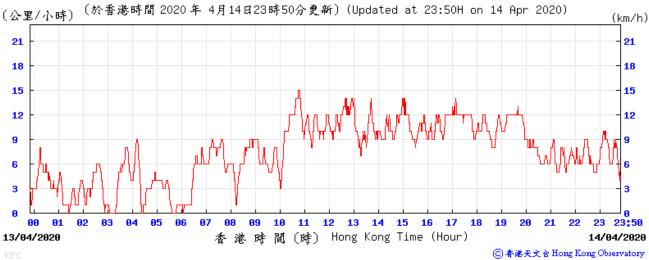


#### Wind Speed:

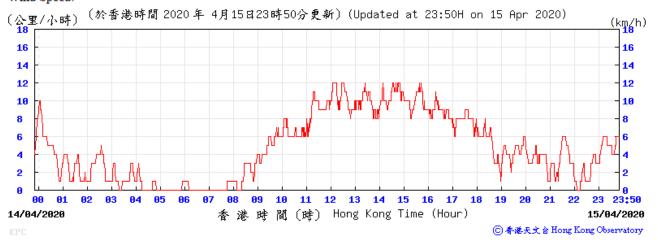



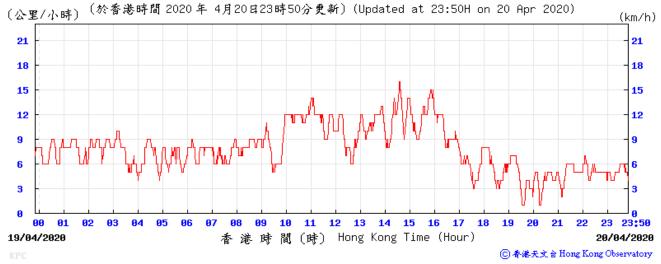


### Wind Speed:

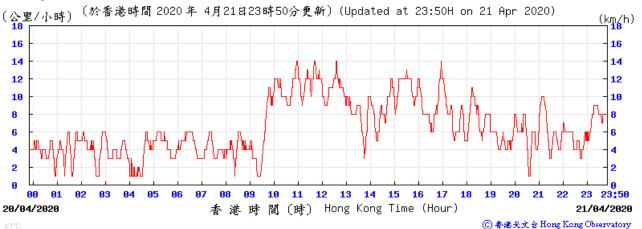

#### Wind Speed:



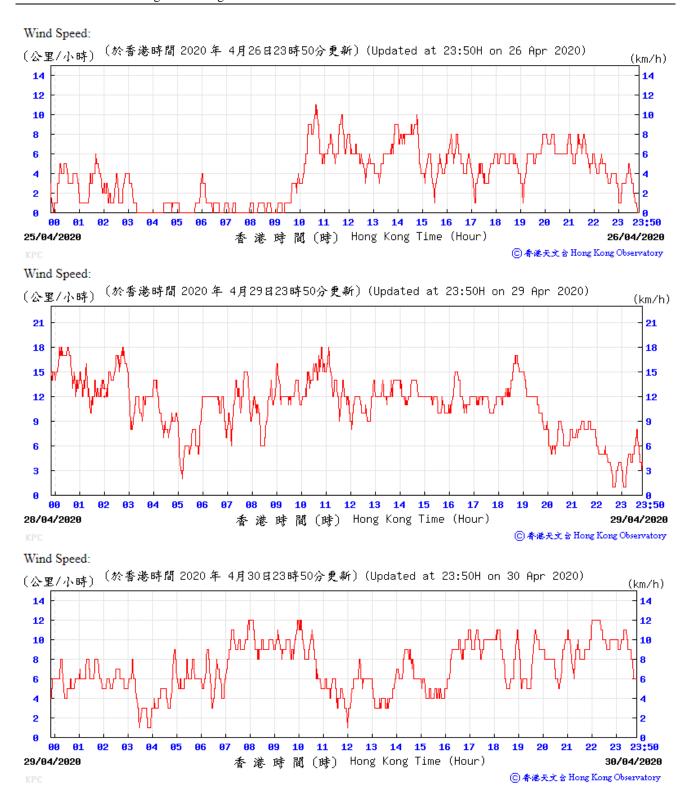

Contract No. HY/2014/08 Environmental Monitoring & Auditing
Α 1' Έν
Appendix M
Monitoring Data (Noise)

Location: Yau Ma Tei Catholic Primary School (Hoi Wang Road) (W-N1A)

Monitoring date: 3, 8, 14, 20, 25, 29 April 2020

Parameter :  $L_{eq}$ ,  $L_{10}$ ,  $L_{90}$ 

Other Factors Nearby traffic, construction work from West Kowloon Government

Offices, school activities

Date	Weather	Start Time	-	End Time	$L_{ m eq}$	$L_{10}$	L <sub>90</sub>	Wind speed (m/s)
03/04/2020	Cloudy	13:15	-	13:45	61.5	63.7	58.5	3.3
08/04/2020	Sunny	11:30	-	12:00	61.9	63.6	58.5	3.1
14/04/2020	Sunny	11:54	-	12:24	62.5	63.9	57.8	2.9
20/04/2020	Sunny	11:40	-	12:10	63.5	65.5	61.1	2.8
25/04/2020	Fine	12:30	-	13:00	61.8	64.3	59.1	3.3
29/04/2020	Sunny	14:30	-	15:00	62.0	64.0	59.8	3.9

Location: Hydan Place (W-N18)

Monitoring date: 3, 8, 14, 20, 25, 29 April 2020

 $\begin{array}{ll} Parameter: & L_{eq}, L_{10}, \ L_{90} \\ \\ Other \ Factors & Nearby \ traffic \\ \end{array}$ 

Date	Weather	Start Time	_	End Time	$L_{eq}$	$L_{10}$	L <sub>90</sub>	Wind
Bute	vv cather	Start Time		End Time	<b>L</b> eq	1210	L90	speed (m/s)
03/04/2020	Cloudy	14:05	-	14:35	68.1	71.3	64.4	2.8
08/04/2020	Sunny	12:25	-	12:55	68.2	70.2	65.3	4.4
14/04/2020	Sunny	11:12	-	11:42	68.6	71.0	65.5	3.3
20/04/2020	Sunny	9:30	-	10:00	67.8	70.1	65.6	1.4
25/04/2020	Fine	10:46	-	11:16	70.2	72.7	67.3	2.5
29/04/2020	Sunny	13:30	-	14:00	68.4	70.6	65.3	3.1

Location: Prosperous Garden Block 1 (W-N25A),

Roadside in front of Prosperous Garden Block 1 (W-N25A-T)

Monitoring date: 3, 8, 14, 20, 25, 29 April 2020

 $\begin{array}{lll} \mbox{Parameter}: & L_{eq}, L_{10}, \ L_{90} \\ \mbox{Other Factors} & \mbox{Nearby traffic} \end{array}$ 

Date	Weather	Start Time	_	End Time	$L_{eq}$	$L_{10}$	Las	Wind
Date	w camer	Start Time	_	End Time	Leq	L <sub>10</sub>	$L_{90}$	speed (m/s)
03/04/2020^	Cloudy	17:05	-	17:35	74.7	76.5	72.2	1.7
08/04/2020	Sunny	9:15	-	9:45	69.5	71.4	66.4	3.6
14/04/2020	Sunny	10:35	-	11:05	68.3	71.1	65.0	3.3
20/04/2020	Sunny	10:12	-	10:42	70.1	72.4	67.1	3.1
25/04/2020	Fine	10:04	-	10:34	68.7	70.6	65.1	0.6
29/04/2020	Sunny	15:15	-	15:45	70.7	72.6	68.7	3.2

<sup>^</sup>Remark: Noise monitoring station at Prosperous Garden Block 1 (W-N25A) was temporarily suspended from 24 March 2020 to 6 April 2020 due to a case of novel coronavirus infection at the Prosperous Garden Block 4. A temporary alternative noise monitoring location, W-N25A-T was used on 3 April 2020. A correction of +3dB(A) was made to the free field measurement for W-N25A-T.

Location: The Coronation Tower 1 (W-P11),

Monitoring date: 3, 8, 14, 20, 25, 29 April 2020

 $\begin{array}{lll} Parameter: & L_{eq}, L_{10}, \ L_{90} \\ \\ Other \ Factors & Nearby \ traffic \end{array}$ 

Date	Weather	Start Time	-	End Time	$L_{\rm eq}$	$L_{10}$	L <sub>90</sub>	Wind speed (m/s)
03/04/2020	Cloudy	16:20	-	16:50	70.6	74.0	65.3	1.4
08/04/2020	Sunny	10:45	-	11:15	68.3	70.4	65.5	3.3
14/04/2020	Sunny	9:53	-	10:23	71.5	72.3	70.2	0.8
20/04/2020	Sunny	13:00	-	13:30	68.9	71.0	65.3	2.5
25/04/2020	Fine	11:44	-	12:14	68.9	71.3	66.6	2.5
29/04/2020	Sunny	16:00	-	16:30	68.2	70.2	64.4	2.8

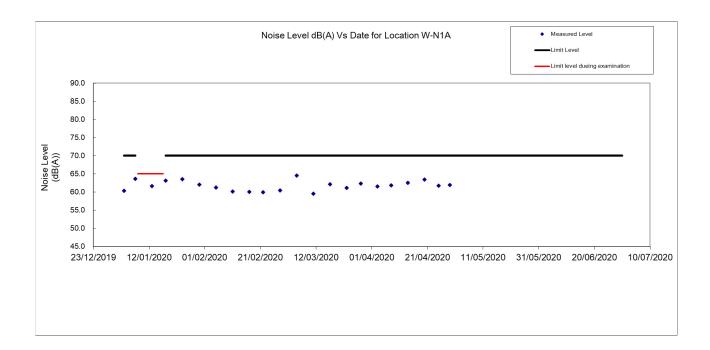


Figure 1: Graphical Illustration of Measured Noise Levels at W-N1A

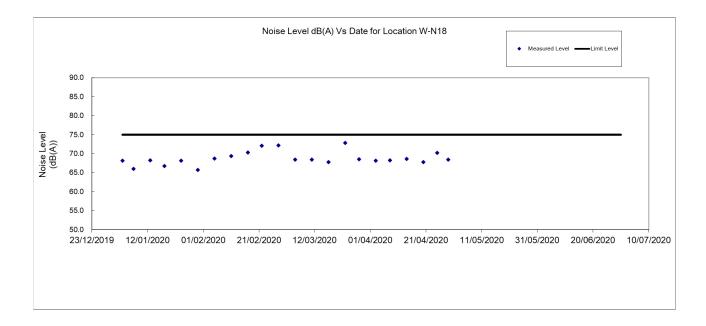


Figure 2: Graphical Illustration of Measured Noise Levels at W-N18

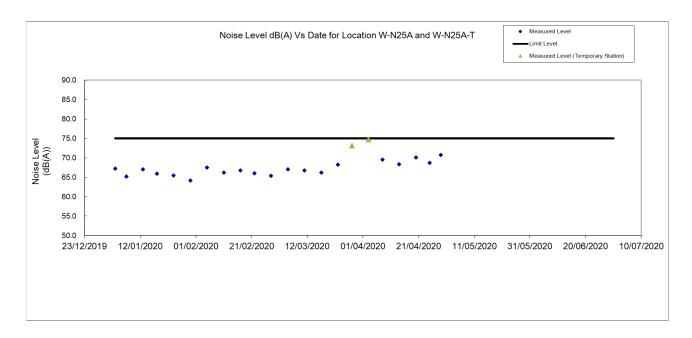


Figure 3: Graphical Illustration of Measured Noise Levels at W-N25A

Remark: Noise monitoring station at Prosperous Garden Block 1 (W-N25A) was temporarily suspended from 24 March 2020 to 6 April 2020 due to a case of novel coronavirus infection at the Prosperous Garden Block 4. A temporary alternative noise monitoring location, W-N25A-T was used on 3 April 2020. A correction of +3dB(A) was made to the free field measurement for W-N25A-T.

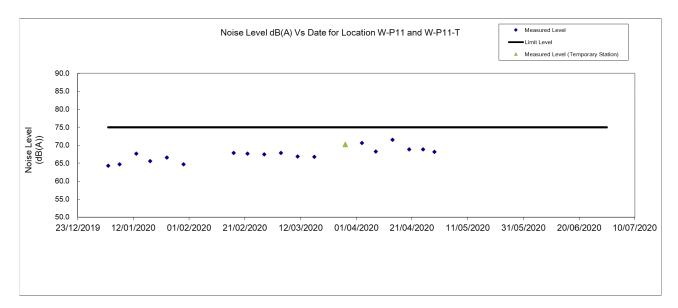


Figure 4: Graphical Illustration of Measured Noise Levels at W-P11

Contract No. HY/2014/08
Environmental Monitoring & Auditing

Appendix N Waste Flow Table **Monthly Summary Waste Flow Table** 

Highways Department **Name of Department:** 

Contract No. / Works Order No.: <u>HY/2014/08</u>

Monthly Summary Waste Flow Table for April 2020
[to be submitted not later than the 15<sup>th</sup> day of each month following reporting month] (All quantities shall be rounded off to 1 decimal place.)

			Actual Quantities of Inert Co	onstruction Waste Genera	ted Monthly	
Month	(a)=(b)+(c)+(d)+(e)+ (f)+ (g)+ (h)+ (i)+ (j)+ (k) Total Quantity Generated	(b) Hard Rock and Large Broken Concrete	(c) Reused in the Contract	(d) Reused in other Projects	(e) Disposed of as Public Fill	(f) Imported Fill
	(in 'tonnes)	(in 'tonnes)	(in 'tonnes)	(in 'tonnes)	(in 'tonnes)	(in 'tonnes)
2018	51058.0	0.0	0.0	0.0	47715.6	2877.4
2019	112830.2	541.0	1523.8	13525.0	93132.9	3155.6
Jan-20	22974.4	3.9	214.2	3916.7	18717.6	0.0
Feb-20	25194.9	381.7	434.6	7601.1	16661.9	0.0
Mar-20	2019.1	0.0	0.0	0.0	1897.2	0.0
Apr-20	26180.8	2129.3	4630.4	41.1	19284.3	0.0
May-20						
Jun-20						
Sub-total	76368.7	2514.9	5279.2	11558.9	56561.0	0.0
Jul-20						
Aug-20						
Sep-20						
Oct-20						
Nov-20						
Dec-20						
Total	76368.7	2514.9	5279.2	11558.9	56561.0	0.0

		Actual Quantities of Non-inert Construction Waste Generated Monthly							
Month	(g) Metals			(h) poard packaging P.		) tics	(j) Chemical Waste		(k) Others, e.g. General Refuse disposed at Landfill
	(in '0	00kg)	(in '0	00kg)	(in '00	00kg)	(in '0	000kg)	(in 'tonnes)
	generated	recycled	generated	recycled	generated	recycled	generated	recycled	generated
2018	28.4	0.0	0.0	0.0	0.0	0.0	2.0	0.0	434.5
2019	0.0	9.1	3.4	6.8	0.0	0.0	5.2	0.0	927.3
Jan-20	0.0	0.0	0.2	0.0	0.0	0.0	0.0.	0.0	121.3
Feb-20	0.0	0.0	0.0	0.0	0.0	0.0	0.0	0.0	115.6
Mar-20	0.0	0.0	0.4	0.0	0.0	0.0	0.0	0.0	121.6
Apr-20	0.0	0.0	0.0	0.0	0.0	0.0	0.8	0.0	94.9
May-20									
Jun-20									
Sub-total	0.0	0.0	0.6	0.0	0.0	0.0	0.8	0.0	453.4
Jul-20									
Aug-20									
Sep-20									
Oct-20									
Nov-20									
Dec-20									
Total	0.0	0.0	0.6	0.0	0.0	0.0	0.8	0.0	453.4

Remark: Construction waste record for Mar-20 has been updated.

Acuity Sustainability Consulting Ltd.

Appendix O
Statistics on Complaint, Notifications of
Summons and Successful Prosecutions

### Statistical Summary of Exceedances

	Air Quality								
Location	Action Level	Limit Level	Total						
W-A1	0	0	0						
W-A6	0	0	0						
	Noise								
Location	Action Level	Limit Level	Total						
W-N1A	0	0	0						
W-N18	*1	0	*1						
W-N25A	0	0	0						
W-P11	0	0	0						

Remark: \*W-N18 was the nearest NSR to Zone E.

### Statistical Summary of Environmental Complaints

Donauting David	Environmental Complaint Statistics				
Reporting Period	Frequency	Cumulative	Complaint Nature		
1 April 2020- 30 April 2020	1	10	N/A		

Statistical Summary of Environmental Non-compliance


Donouting Donied	Environmental Non-compliance Statistics					
Reporting Period	Frequency	Cumulative	Details			
1 April 2020- 30 April 2020	0	1	N/A			

### Statistical Summary of Environmental Summons

Donouting Donied	Environmental Summons Statistics					
Reporting Period	Frequency	Cumulative	Details			
1 April 2020- 30 April 2020	0	1	N/A			

### Statistical Summary of Environmental Prosecution

	Statistical Sammary of Environmental Prosecution			
Reporting Period	<b>Environmental Prosecution Statistics</b>			
	Frequency	Cumulative	Details	
1 April 2020-	0	0	NI/A	
30 April 2020	Ü	U	N/A	

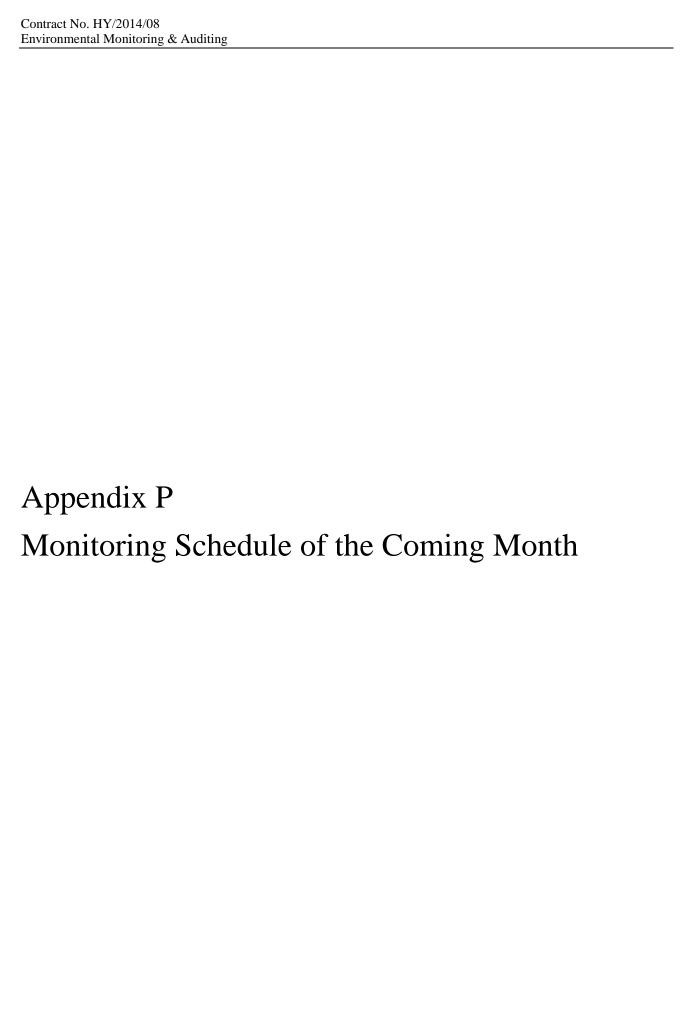

			Impact Monitoring Schedule for YMTE  May-20			
	J	<b>-</b>		I		la .
Sun	Mon	Tue	Wed	Thur	Fri	Sat 2
3	4	5	6	7	8	9
		Impact				
		Air monitoring for W-A6 &W-A1 Noise monitoring for W-N1A, W-P11,W-N18 & W-N25A				
10	11	12	13	14	15	16
	Impact Air monitoring for W-A6 &W-A1 Noise monitoring for W-N1A, W-P11,W-N18 & W-N25A					Impact Air monitoring for W-A6 &W-A1 Noise monitoring for W-N1A, W-P11,W-N18 & W-N25A
17	18	19	20	21	22	23
					Impact Air monitoring for W-A6 &W-A1 Noise monitoring for W-N1A, W-P11,W-N18 & W-N25A	
24	25	26	27		29	30
				Impact  Air monitoring for W-A6 &W-A1  Noise monitoring for W-N1A,  W-P11,W-N18 & W-N25A		
31						

Appendix Q Interim Report for Complaint

# **Interim Report on Environmental Complaint**

Project	Central Kowloon Route, Yau Ma Tei East Section
Complaint Code	EC010-CKRYMTE20200427_001
Complaint description	Complainant complained that the noise was arising from the construction site between Shanghai Street and Reclamation Street.
	"投訴人於27/4 10:59 留言投訴上海街211號傳出打樁噪音,要求環保署跟進
	及回覆。"
Parameter	Construction Noise
Investigation finding	Further communications were made between EPD and the Contractor regarding further information of the complaint. As noted from the Contractor, the complainant was concerning the 24-hour construction noise generated from the access shaft underground working area at Zone E from 20 April 2020 to 27 April 2020.
	Impact noise monitoring had been carried out on 20 and 25 April 2020 and the monitoring results at Hydan Place were 67.8 dB(A) in L <sub>eq30min</sub> and 70.2 dB(A) in L <sub>eq30min</sub> respectively, which were well below the limits levels for the monitoring stations at 75 dB(A) in L <sub>eq30min</sub> . It was believed that the construction noise generated during daytime from 20 April 2020 to 27 April 2020 did not exceed the noise limit level as stipulated under EM&A manual. In addition, no observation regarding construction noise during weekly site inspection conducted on 23 April 2020.
	For evening and night time, frontline staff of the Contractor, Chen Ruifeng, conducted site inspection from 20 April 2020 to 27 April 2020 to confirm the number and type of plants used and implementation of required mitigation measures as stipulated in the CNP. As per discussion between EPD and the Contractor, evening and night time inspection records from 25 April 2020 to 27 April 2020 had to be provided as a reference. Such records were attached in Appendix A, there was no piling and breaking activity or piling and breaking equipment on site. The number of each type of PME used and their grouping combination were in compliance with CNP at the access shaft underground working area at Zone E (Permit No.: GW-RE0130-20).
	Considering the fulfillment of stipulated requirements by the Contractor for CNP at the access shaft underground working area at Zone E (Permit No.: GW-RE0130-20), it is concluded that no non-compliance to the EM&A requirement of the Project regarding noise impact from construction works during restricted hours was observed.
Actions taken / to be taken	As a precautionary measure for daytime, it is suggested that the Contractor has to implement some measures in respect to this complaint case in order to minimize nuisance to the public. The measures include intermittent operation of plants and equipment and use of QPME.
	For night and evening time, the Contractor had followed strictly with the mitigation measures listed in CNP at Zone E, in which the below measures were carried out:
	The entrance of the underground working area (exterior and interior doors) were closed.
	2. The gaps between the acoustic panels were closed and properly sealed by gasket when PMEs were in operation.
	Supporting photos are provided in Appendix B.
Remarks	Construction work carried out during daytime, evening time and night time from 20 April 2020 to 27 April 2020 was mainly rock excavation
	Works locations:

	(next page.)	
Prepared by	Sally Mok	
Date	15 May 2020	



# **Appendix A Site Inspection Checklist**

Build King – SKEC Joint Venture Highways Department - Contract No. HY/2014/08 Central Kowloon Route – Yau Ma Tei East



### 工作許可證

E: Zone E		許可證有效時期:	N-14-7	0,70
100			19=00 -	23:00
		機動設備的檢查	1/	,
诅別	機動設備		許可數目	實際數目
	挖土機 (履帶式)		3	3

組別	機動設備詳情	許可數目	實際數目
	挖土機 (履帶式)	3	3
	裂石器,裝在挖土機上	3	3
	石鑽,履帶型 (油壓)	3	
	破碎機,裝在挖土機上 (油壓)	3	
	焊接機	5	
	吹風機	10	7
	鋼筋彎曲機及切割機 (電動)	5	
Α	圓型木鋸	5	
11	發電機,備有優質機動設備噪音標籤顯示聲功率級 ≦93dB(A)	2	
	破碎機,手提型 (電動),備有優質機動設備噪音標籤顯示聲功率級≦103dB(A)	1	
	抽氣扇	2	1
	潛水泵 (電動)	10	7
	發電機,備有優質機動設備噪音標籤顯示聲功率級 ≤93dB(A) (放置於地面)	1	

訂明建築工程的檢查				
辨認代碼	工程項目		實際 (Y=有, N=沒有)	
PCW 001	模板或棚架的構築或拆卸	許可	Y/M)	
PCW 002	裝卸或處理瓦礫、木板、鋼條、木料或棚架材料	許可	Y/N)	
PCW 003	敲擊	許可	Y(N)	

緩解措施的檢查	_
是否所有機動設備均在有隔音板遮蓋下的地下運作?	(是)/ 否
安裝好的隔音板是否密封隙縫及結構完整?	是 / 否

前線負責人

姓名:

駐地盤人員見證

姓名:


























Build King - SKEC Joint Venture Highways Department - Contract No. HY/2014/08 Central Kowloon Route - Yau Ma Tei East



### 工作許可證

地點:

許可證發出時間: 25/4-86/4-2020

	- 12			1
legir	-1		1	
Phi	4		V	
		1	-	
























	機動設備的檢查	アクシロー 0	/
組別	機動設備詳情	許可數目	實際數目
	挖土機 (履帶式)	3	3
	裂石器, 裝在挖土機上	3	3
	石鑽,履帶型 (油壓)	1	
	焊接機 (電動)	5	
	吹風機 (電動)	10	7
$\alpha$	鋼筋彎曲機及切割機 (電動)	5	Λ
C	圓型木鋸	5	
	發電機,備有優質機動設備噪音標籤顯示聲功率級 ≤93dB(A)	2	
	破碎機,手提型(電動),備有優質機動設備噪音標 籤顯示聲功率級≦103dB(A)	1	
	抽氣扇	2	1
	潛水泵 (電動)	10	5

	訂明建築工程的檢查			
辨認代碼	工程項目		<b>寶</b> (Y=有, ]	<b>際</b> N=沒有`
PCW 001	模板或棚架的構築或拆卸	許可	Y	N
PCW 002	裝卸或處理瓦礫、木板、鋼條、木料或棚架材料	許可	Y	N
PCW 003	敲擊	許可	Y	N/

緩解措施的檢查	$\wedge$
是否所有機動設備均在有隔音板遮蓋下的地下運作?	/是 / 否
安裝好的隔音板是否密封隙縫及結構完整?	是 / 否

前線負責人

姓名:

駐地盤人員見證

簽名:

Build King – SKEC Joint Venture Highways Department - Contract No. HY/2014/08 Central Kowloon Route – Yau Ma Tei East



### 工作許可證

日期:	26 14 / 2020	許可證發出時間:	07 200
地點:	Zone E	許可證有效時期:	17:00 - 23200

	機動設備的檢查		
組別	機動設備詳情	許可數目	實際數目
	挖土機 (履帶式)	3	3
	裂石器,裝在挖土機上	3	
	石鑽,履帶型(油壓)	3	1
	破碎機,装在挖土機上 (油壓)	3	3
	焊接機	5	
	吹風機	10	6
	鋼筋彎曲機及切割機 (電動)	5	
Α	圓型木鋸	5	
	發電機,備有優質機動設備噪音標籤顯示聲功率級 ≦93dB(A)	2	
	破碎機,手提型 (電動),備有優質機動設備噪音標籤顯示聲功率級≦103dB(A)	1	
	抽氣扇	2	2
	潛水泵 (電動)	10	5
	發電機,備有優質機動設備噪音標籤顯示聲功率級 ≤93dB(A) (放置於地面)	1	

訂明建築工程的檢查			
辨認代碼	工程項目		實際 (Y=有, N=沒有)
PCW 001	模板或棚架的構築或拆卸	許可	Y/N)
PCW 002	裝卸或處理瓦礫、木板、鋼條、木料或棚架材料	許可	Y/N;
PCW 003	敲擊	許可	Y/W

緩解措施的檢查	
是否所有機動設備均在有隔音板遮蓋下的地下運作?	() () 否
安裝好的隔音板是否密封隙缝及結構完整?	<b>温</b> / 否

前線負責人

簽名:

Edmond En

駐地盤人員見證

簽名:

姓名: SAm )


























Build King – SKEC Joint Venture Highways Department - Contract No. HY/2014/08 Central Kowloon Route – Yau Ma Tei East



### 工作許可證

日期: <u>16 /4 - 27/4 - 2020</u> 地點: Zone E

許可證發出時間: \_\_\_\_\_23 = 00

地點:

許可證有效時期: \_\_\_\_\_ 23:00 - 07:00

機動設備的檢查			
組別	機動設備詳情	許可數目	實際數目
	挖土機 (履帶式)	3	3
	裂石器,裝在挖土機上	1	
	石鑽,履帶型 (油壓)	2	1
	焊接機 (電動)	5	//
	吹風機 (電動)	10	6
$\mathbf{D}$	鋼筋彎曲機及切割機 (電動)	5	
B	圓型木鋸	5	
	發電機,備有優質機動設備噪音標籤顯示聲功率級 ≦93dB(A)	2	
	破碎機,手提型(電動),備有優質機動設備噪音標 籤顯示聲功率級≦103dB(A)	1	
	抽氣扇	2	2
	潛水泵 (電動)	10	5

訂明建築工程的檢查			
辨認代碼	工程項目		實際 (Y=有, N=沒有)
PCW 001	模板或棚架的構築或拆卸	許可	Y/N
PCW 002	裝卸或處理瓦礫、木板、鋼條、木料或棚架材料	許可	Y/N)
PCW 003	敲擊	許可	YAY

緩解措施的檢查	
是否所有機動設備均在有隔音板遮蓋下的地下運作?	100 / 否
安裝好的隔音板是否密封隙縫及結構完整?	② / 否

前線負責人

簽名: 姓名:

駐地盤人員見證

簽名: 姓名:


23:30










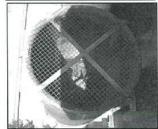











# **Appendix B Supporting Photos**

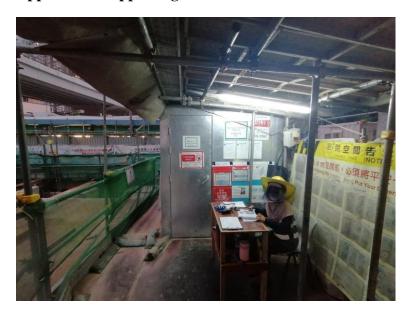


Figure B1: Closure of Exterior Door



**Figure B2: Closure of Interior Door** 



Figure B3: Closure of Acoustic Panel



**Figure B4: Closure of Acoustic Panel**