Vol. 1 of 4 EP-457/2013/C Central Kowloon Route Ho Man Tin Access Shaft Contract No. HY/2014/09 April 2019





Environmental Permit No. EP-457/2013/C

Central Kowloon Route

Independent Environmental Checker Verification

Reference Document/Plan	
Document/ Plan to be Certified / Verified:	Monthly EM&A Report No.15 (April 2019)
Date of Report:	8 May 2019 (Rev. 1)
Date received by IEC:	8 May 2019

Ho Man Tin Access Shaft (HY/2014/09)

Reference EP Condition

Works Contract:

Environmental Permit Condition: 3.4

Submission of Monthly EM&A Report of the Project

3.4 Four hard copies and one electronic copy of monthly EM&A Report shall be submitted to the Director within 2 weeks after the end of each reporting month throughout the entire construction period. The EM&A Reports shall include a summary of all non-compliance. The submissions shall be certified by the ET Leader and verified by the IEC as complying with the requirements as set out in the EM&A Manual before submission to the Director. Additional copies of the submission shall be provided to the Director upon request by the Director.

IEC Verification

Mondy 20.

I hereby verify that the above referenced document/plan complies with the above referenced condition of EP-457/2013/C.

Ms Mandy To Date: 8 May 2019

Independent Environmental Checker

Our ref: 0436942_IEC Verification Cert_HMTS_Monthly EM&A Rpt No.15.docx



Acuity Sustainability Consulting Limited

Unit 1908, iPlace, Nos. 301-305 Castle Peak Road, Kwai Chung, N.T. Tel.: (852) 2333 6823 Fax.: (852) 2333 1316

Nishimatsu Construction Co. Ltd.

Central Kowloon Route Contract HY/2014/09 Ho Man Tin Access Shaft

Monthly EM&A Report No. 15

(Period from 1 to 30 April 2019)

Rev. 1

(8 May 2019)

	Name	Signature
Prepared by	Karen K. Y. Cheung	
Checked & Reviewed by	Nelson T. H. Tsui	74
Approved & Certified by	Kevin W. M. Li (Environmental Team Leader)	K.

TABLE OF CONTENTS

EXECUTIVE SUMMARY

1.	BASIC PROJECT INFORMATION	(
2.	ENVIRONMENTAL STATUS	8
3.	MONITORING RESULTS	10
4.	SUMMARY OF COMPLAINTS, NOTIFICATION OF SUMMONS AND PROSECUTIONS	18
5.	EM&A SITE INSPECTION	20
6.	FUTURE KEY ISSUES	21
7	CONCLUSION AND RECOMMENDATIONS	20

LIST OF APPENDICES

- A. Alignment and Works Area for the Contract No. HY/2014/09
- B. Construction Programme
- C. Project Organization Chart
- D. Dust Event-Action Plan (EAP)
- E. Noise Event-Action Plan (EAP)
- F. Environmental Mitigation Implementation Schedule (EMIS)
- G. Monitoring Schedules of the Reporting Month
- H. Calibration Certificate (Air Monitoring)
- I. Calibration Certificate (Noise)
- J. The Certification of Laboratory with HOKLAS Accredited Analytical Tests
- K. Location Plan of Noise and Air Quality Monitoring Station
- L. Monitoring Data (Air Monitoring)
- M. Monitoring Data (Noise)
- N. Waste Flow Table
- O. Statistics on Complaint, Notifications of Summons and Successful Prosecutions
- P. Monitoring Schedule of the Coming Month

EXECUTIVE SUMMARY

- A.1 NISHIMATSU Construction Company Limited ("Contractor") commenced the construction works of Highway Department (HyD) Central Kowloon Route Contract No. HY/2014/09 Ho Man Tin Access Shaft ("The Project") on 20 February 2018. This is the 15th monthly Environmental Monitoring and Audit (EM&A) report presenting the EM&A works carried out during the period from 1 April 2019 to 30 April 2019.
- A.2 A summary of the construction works that undertaken for the Project during the reporting month is listed below.

Construction Activities undertaken

- Access Shaft Excavation Soil/ Rock excavation from +15mPD down to +11mPD
- Access Shaft Excavation Soil/ Rock excavation from +11mPD down to -9.3mPD
- A.3 A summary of regular construction noise and construction dust monitoring activities in this reporting period is listed below:

Regular construction noise monitoring during normal working hours

M-N3 7 times

Construction dust (24-hour TSP) monitoring

M-A3 7 times

Construction dust (1-hour TSP) monitoring

M-A3 21 times

- A.4 No construction work was conducted during time period other than normal working hours during this reporting month.
- A.5 Inert construction and demolition (C&D) materials and non-inert C&D materials were the wastes that generated from this Project. During the reporting month, 3591 m³ inert C&D material was generated from the Project. No plastics and no paper/ cardboard packaging were generated and sent to recyclers for recycling during reporting period, respectively. About 7 m³ of non-recyclable non-inert C&D materials, such as general refuse, were disposed of at landfill. No metal and chemical waste were generated during this reporting month.
- A.6 Bi-weekly inspection of the implementation of landscape and visual mitigation measures was conducted on 9, 23 April 2019. Details of the audit findings and implementation status are presented in Section 5.
- A.7 Joint weekly site inspections were conducted by representatives of the Contractor, Engineer and Contractor's ET on 2, 9, 16, 23, 30 April 2019. The representative of IEC joined the site inspection on 9 April 2019. Details of the audit findings and implementation status are presented in Section 5.
- A.8 No change has been made from the described in the approved EM&A, such as construction method, mitigation proposals and design changes.

- A.9 No exceedance of the Action and Limit Levels of regular construction noise monitoring was recorded during the reporting period.
- A.10 No exceedance of the Action and Limit Levels of 24-hour TSP and 1-hour TSP monitoring were recorded during the reporting period.
- A.11 No environmental complaint was received in the reporting period.
- A.12 No summon or prosecution was received in this reporting period.
- A.13 No reporting changes were revised in this reporting period.
- A.14 A summary of the construction activities to be undertaken in the in the next reporting month is listed below:

Construction Activities to be undertaken

Access Shaft Rock Excavation

1. BASIC PROJECT INFORMATION

- 1.1. Central Kowloon Route (CKR) is a 4.7 km long dual 3-lane trunk road in Central Kowloon linking Yau Ma Tei Interchange in West Kowloon with the road network on Kai Tak Development and Kowloon Bay in East Kowloon.
- 1.2. The Central Kowloon Route Design and Construction Environmental Impact Assessment Report (Register No.: AEIAR-171/2013) was approved with conditions by the Environmental Protection Department (EPD) on 11 July 2013. An Environmental Permit (EP 457/2013) was issued on 9 August 2013. Variations of EP (VEP) was subsequently applied for and the latest EP (EP-457/2013/C) was issued by EPD on 16 January 2017.
- 1.3. The construction of the CKR had been divided into different sections. This Contract No. HY/2014/09 Ho Man Tin Access Shaft (HMTS) ("The Project") covers part of the construction activities located at Ho Man Tin under the EP which includes:

Central Portion

- i. Decant of Housing Authority Mock Up Centre and Site Establishment
- ii. Diaphragm Walls Construction
- iii. Excavation of Vertical Access Shaft approximately 100m deep and 21m internal diameter

The alignment and works area for the Contract No. HY/2014/09 - are shown in Appendix A.

1.4. A summary of the major construction activities undertaken in this reporting period is shown in Table 1.1. The construction programme is presented in Appendix B.

Table 1.1 Summary of the construction Activities Undertaken during the Reporting Month.

Construction Activities undertaken

- Access Shaft Excavation Soil/ Rock excavation from +15mPD down to +11mPD
- Access Shaft Excavation Soil/ Rock excavation from +11mPD down to -9.3mPD
- 1.5. There are no updates on the scope of works and construction methodologies.
- 1.6. The project organisational chart specifying management structure and contact details are shown in Appendix C.
- 1.7. A summary of the valid permits, licences, and /or notifications on environmental protection for this Project is presented in Table 1.2

Table 1.2 Summary of the Status of Valid Environmental Licence, Notification, Permit and Documentations

D of different cons			
Permit/ Licences/ Notification	Reference	Validity Period	Remarks
Environmental	EP- 457/2013/C	Throughout the	Permit granted on
Permit		Contract	16/01/2018

Permit/ Licences/	Reference	Validity Period	Remarks
Notification	Reference	vanuity i criou	Kemai Ks
Notification of	428806	Throughout the	Notification issued on
Construction Works		Contract	18/12/ 2017
under the Air			
Pollution Control			
(Construction Dust)			
Regulation (Form			
NA)			
Wastewater	WT00030288-2018	Until 28/02/2023	Licence granted on
Discharge Licence			14/02/2018
Chemical Waste	WPN5111-236-N2345-03	Throughout the	Registration complete
Producer		Contract	on 19/12/2017
Registration			
Billing Account for	7029654	Throughout the	Account granted on
Disposal of		Contract	22/12/2017
Construction Waste			
Construction Noise	GW-RE0178-19	Until 24/05/2019	CNP granted on
Permit			22/3/2019

2. ENVIRONMENTAL STATUS

2.1. Environmental permit (EP) conditions under the EIAO, submission status under the EP and implementation status of mitigation measures had been reviewed and implemented on schedule. The status of required submissions under the EP (EP-457/2013/C) as of the reporting period for the Project are summarised in Table 2.1

Table 2.1 Summary of Status of Required Submission for EP-457/2013/C for the Project

EP Condition (EP-457/2013/C)	Submission	Submission date
Condition 1.12	Notification of Commencement Date of Construction of the Project	1 February 2018
Condition 2.3	Community Liaison Group	5 January 2018
Condition 2.4	Management organisation of the main construction companies	22 December 2017
Condition 2.5	Construction Programme and EP	08 January 2018 / 18 January
Condition 2.3	Submission Schedule	2018
Condition 2.6	Design Drawing	08 January 2018
Condition 2.8	Landscape Mitigation Plan	12 January 2018
Condition 2.9	Construction Noise Mitigation Measure Plan (CNMMP)	15 February 2018
Condition 3.3	Baseline Monitoring Report	1 February 2018
Condition 3.4	Monthly EM&A Report (March 2019)	11 April 2019

2.2. Details of the major construction activities undertaken in this reporting period are shown in Table 2.2.

Table 2.2 Summary of the construction Activities Undertaken during the Reporting Month.

Location of works	Construction activities undertaken	Remarks on progress
	• Access Shaft Excavation – Soil/ Rock	• 1,400 out of 1,400 m^3
	excavation from +15mPD down to	
	+11mPD	
	• Access Shaft Excavation – Soil/ Rock	• 1,925 out of $7,100$ m ³
	excavation from +11mPD down to	
	-9.3mPD	

2.3. The drawing showing the project are, environmental sensitive receivers and the location of the monitoring station are attached in Appendix A and Appendix K. Co-ordinates of the monitoring location is shown in below:

SKH Tsoi Kung Po Secondary School (M-A3 / M-N3) under HK80 Geographical Coordinates – Latitude: 22.314719, Longitude: 114.180694

3. MONITORING RESULTS

3.1. Monitoring Parameters

Air Quality

- 3.1.1. The impact monitoring had been carried out in accordance with section 5.8 of the approved EM&A Manual to determine the 1-hour and 24-hour total suspended particulates (TSP) levels at the monitoring location in the reporting report.
- 3.1.2. The sampling frequency of at least once in every 6 days, shall be strictly observed at the monitoring station for 24-hour TSP monitoring. For 1-hour TSP monitoring, the sampling frequency of at least 3 times in every 6 days should be undertaken when the highest dust impact occurs.
- 3.1.3. General meteorological conditions (wind speed, direction and precipitation) and notes regarding any significant adjacent dust producing sources had also been recorded throughout the impact monitoring period.

Noise

- 3.1.4. Construction noise level shall be measured in terms of the A-weighted equivalent continuous sound pressure level (L_{eq}). L_{eq} (30min) shall be used as the monitoring parameter for the time period between 0700 and 1900 hours on normal weekdays.
- 3.1.5. For all other time periods, L_{eq} (5min) shall be employed for comparison with the Noise Control Ordinance (NCO) criteria.
- 3.1.6. As supplementary information for data auditing, statistical results such as L_{10} and L_{90} shall also be obtained for reference.
- 3.2. Monitoring Equipment

Air Quality

- 3.2.1. 1-hour TSP levels and 24-hour TSP had been measured with direct reading dust meter and High Volume Samplers respectively. It has been demonstrated its capability in achieving comparable results with high volume sampling method as set out in the Title 40 of the Code of Federal Regulations, Chapter 1 (Part 50).
- 3.2.2. The 1-hour TSP meter was calibrated by the manufacturer prior to purchasing. Zero response of the instrument was checked before and after each monitoring event. Operation of the 1-hour TSP meter followed manufacturer's Operation and Service Manual. The 24-hour TSP meter was calibrated against firmware 80570-8100-V1.0.4, annually. Operation of the 24-hour TSP meter followed manufacturer's Operation and Service Manual. Valid calibration certificate of dust monitoring equipment is attached in Appendix H.
- 3.2.3. A summary of the equipment that was deployed for the 24- hour averaged monitoring is shown in Table 3.1. The TSP monitoring was conducted as per the schedule presented in Appendix G.

3.2.4. The equipment used for 1-hour TSP and 24-hour TSP measurement and calibration are summarised in Table 3.1

Monitoring Parameter	Monitoring Equipment	Serial Number	Date of Calibration
1-hour TSP	Sibata LD-3B Digital Dust	296093	15 Oct 2018
	Indicator		
24-hour TSP	TE-5170X High Volume Sampler	1048	12, 30 Apr 2019
	TE-5025 Calibration Kit	3465	22 Jan 2019

Table 3.1 Construction Dust Monitoring Equipment

Noise

- 3.2.5. Sound level meter in compliance with the International Electrotechnical Commission Publications 651: 1979 (Type 1) and 804: 1985 (Type 1) specifications has been used for carrying out the noise monitoring. The sound level meter has been checked using an acoustic calibrator. The wind speed and other metrological data has been recorded from Hong Kong Observatory- King's Park meteorological station, along with portable wind speed meter stand by as back up if malfunction occurred or data was not recorded from HKO.
- 3.2.6. An acoustic calibrator and sound level meter using for the monitoring is within the valid period and were calibrated per year. Valid calibration certificate of noise monitoring equipment is attached in Appendix I.
- 3.2.7. The details of equipment using for monitoring are listed in Table 3.2, as below:

Monitoring EquipmentSerial NumberDate of CalibrationNti XL2 Sound Level MeterA2A-13661-E010 Sep 2018Pulsar 105 Acoustic Calibrator6370511 Sep 2018

Table 3.2 Monitoring Equipment Used in Monitoring

3.3. Monitoring Methodology and QA/QC results

Air Quality

- 3.3.1. The 1-hour TSP monitor, portable dust meter (Sibata Digital Dust Indicator LD-3B) was used for the impact monitoring. The 1-hour TSP meter provides a real time 1-hour TSP measurement based on 90° light scattering. Three 1-hour TSP level were logged per every six days.
- 3.3.2. The 24-hour TSP monitor, High Volume Sampler (Tisch TE 5170 High Volume Air Sampler) was used for the impact monitoring. The 24-hour TSP monitoring consists of the following:
 - ◆ The HVS was set at the monitoring location, with electricity supply connected and secured:
 - ♦ HVS was calibrated before commencing the 1st measurement;

- ◆ The filter paper was weight and provided by HOKLAS lab (Acumen Laboratory and Testing Limited and ALS Technichem (HK) Pty Ltd) before and after the sampling. Certificate of HOKLAS accredited laboratory can be referred to Appendix J;
- ◆ The airflow over time during sampling process was recorded by the HVS.
- 3.3.3. HVS was free- standing with no obstruction. The following criteria were considered in the installation of the HVS:
 - ◆ Appropriate support to secure the samples against gusty wind needed to be provided the monitoring station;
 - ◆ A minimum of 2m separation from walls, parapets and penthouses was required for rooftop samplers;
 - ◆ No furnace or incinerator flues was nearby;
 - ◆ Airflow around the sampler was unrestricted; and
 - Permission could be obtained to set up the samplers and gain access to the monitoring station.

3.3.4. Preparation of Filter Papers

- Glass fiber filters were labelled and sufficient filters that were clean and without pinholes were selected;
- ◆ All filters were equilibrated in the conditioning environment for 24 hours before weighing. The conditioning environment temperature was around 25°C and not varied by more than ±3°C; the relative humidity (RH)was 40%; and
- ◆ Acumen Laboratory and Testing Limited and ALS Technichem (HK) Pty Limited, as HOKLAS accredited laboratory, implemented comprehensive quality assurance and quality control programmes on the filters.

3.3.5. Field Monitoring

- The power supply was checked to ensure that the HVS was working properly;
- ◆ The filter holder and area surrounding the filter were cleaned;
- ◆ The filter holder was removed by loosening the foul bolts and a new filter, with stamped number upward, on a supporting screen was aligned carefully;
- ◆ The filter was properly aligned on the screen so that the gasket formed an airtight seal on the outer edges of the filter;
- ◆ The swing bolts were fastened to hold the filter holder down to the frame. The pressure applied should be sufficient to avoid air leakage at the edges;
- ◆ The shelter lid was closed and secured with an aluminum strip;
- ◆ The HVS was warmed- up for about 5 minutes to establish run- temperature conditions;
- ◆ A new flow rate record sheet was inserted into the flow recorder;
- ♦ The flow rates of the HVS was checked and adjusted to between $1.22 \cdot 1.37^{m^3}min^{-3}$, which was within the range specified in the EM&A Manual (i.e. $0.6 \cdot 1.7^{m^3}min^{-3}$);
- ◆ The programmable timer was set for a sampling period of 24 hours ±hour, and the starting time, weather condition and filter number were recorded;
- ◆ The initial elapsed time was recorded;
- ◆ At the end of sampling, the sampled filter was removed carefully and folded in half so that only surfaces with collected particulate matter were in contact;

- ◆ The filter paper was placed in a clean plastic envelope and sealed; all monitoring information was recorded on a standard data sheet and
- ◆ The filters were sent to (Acumen Laboratory and Testing Ltd and ALS Technichem (HK) Pty Ltd) for analysis.

3.3.6. Maintenance and Calibration

- ◆ The HVS and their accessories were maintained in a good working condition. For example, motor brushes were replaced routinely and electrical wiring was checked to ensure a continuous power supply; and
- ◆ The flow rate of each HVS with mass flow controller was calibrated using an orifice calibrator, Initial calibrations of the dust monitoring equipment were conducted upon installation and prior to commissioning. Five- point calibration was carried out for HVS using TE-5025 Calibration Kit. HVS is calibrated bimonthly. The calibration records for the HVS is given in Appendix H.

3.3.7. Wind Data Monitoring

◆ The wind speed has been recorded from Hong Kong Observatory- King's Park meteorological station, along with portable wind speed meter stand by as back up if malfunction occurred or data was not recorded from HKO

Noise

- 3.3.8. All noise measurements by the meter were set to FAST response and on the A-weighted equivalent continuous sound pressure level (L_{eq}) in decibels dB(A). $L_{Aeq(30min)}$ was used as the monitoring metric for the time period between 0700 –1900 hours on normal weekdays. The measured noise levels were logged every 5 minutes throughout the monitoring period.
- 3.3.9. Prior to the noise measurement, the accuracy of the sound level meter was checked using an acoustic calibrator generating a known sound pressure level at a known frequency. Checking was conducted before and after the monitoring. The calibration level before and after the noise measurement is agreed to within 1.0 dB.
- 3.3.10. Noise measurements should not be made in presence of fog, rain, wind with a steady speed exceeding 5 ms⁻¹ or wind with gusts exceeding 10 ms⁻¹. The wind speed was checked with a portable wind speed meter capable of measuring with speeds in ms⁻¹.

3.4. Monitoring Location

Air Quality

3.4.1. In order to identify and seek for the access of the dust monitoring locations designated in the EM&A Manual, site visit was conducted by ET. During the site visit, the original proposed monitoring location was declined by the management office of Ko Fai House, Kwun Fai Court due to the set-up of equipment on the rooftop and the middle level of building. Alternative air monitoring station had been proposed by ET and approved by IEC before the baseline monitoring started. 1 designated monitoring location was identified and agreed with IEC and EPD. Details of air monitoring station are described in Table 3.3. The location plan of air quality monitoring station is shown in Appendix K.

Table 3.3 Location of the Dust Monitoring Station

Air Quality Monitoring Station	Dust Monitoring Station
M-A3	SKH Tsoi Kung Po Secondary School

Noise

3.4.2. According to the EM&A Manual, construction noise impact monitoring should be conducted at designated monitoring station. In order to the access to some of the proposed monitoring locations stated in the EM&A Manual was either rejected or unavailable, alternative location was proposed and agreed by the ER. IEC and EPD. The details of construction noise monitoring location are listed in Table 3.4 and shown in Appendix K along with location of noise sensitive receivers (NSRs) related to this Works Contract.

Table 3.4 Noise Monitoring Station

Noise Monitoring Station	Identified Noise Monitoring Station	Type of Measurement
M-N3	SKH Tsoi Kung Po Secondary School	Free-field

- 3.5. Monitoring date, time, frequency and duration
- 3.5.1. A summary of impact monitoring duration, sampling parameter and frequency is presented in Table 3.5.

Table 3.5: Summary of Impact Monitoring Programme

Impact Monitoring	Duration	Sampling Parameter	Frequency
Dust	1-hour continuous measurement	1-hour TSP	3 times per six days
Dust	24-hour continuous sampling	24-hour TSP	Once per six days
Noise	30-minute continuous measurement	$$L_{\rm eq}$_{30min},$$L_{10}$ and L_{90} as reference.$	Once L _{eq 30 min} from 0700 – 1900 per seven days

3.6. Result Summary

Air Quality

3.6.1. According to our field observations, the major dust source identified at the designated air quality monitoring station in the reporting month are summarised in Table 3.6

Table 3.6 Observation at Dust Monitoring Station

Monitoring Station	Major Dust Source
M-A3	Nearby Traffic emissions

3.6.2. Air quality impact monitoring for the reporting month was carried out on 2, 6, 12, 17, 23, 25, 30 April 2019 for 1-hour TSP and 24-hour TSP. The results for 1-hour TSP and 24-hour TSP are summarized in Table 3.7 and Table 3.8. The measurement data and details of influencing factors such as weather conditions and site observation are presented in Appendix L.

Table 3.7 Summary of 1-hour TSP Monitoring Results

Monitoring Location	Range(µg/m3)	Action Level(µg/m3)	Limit Level(µg/m3)
M-A3	41-67	333	500

Table 3.8 Summary of 24-hour TSP Monitoring Results

Monitoring Location	Range(µg/m3)	Action Level(µg/m3)	Limit Level(µg/m3)
M-A3	29-131	153	260

Noise

3.6.3. According to our field observations, the major noise source identified at the designated noise monitoring station in the reporting month are summarised in Table 3.9:

Table 3.9 Observation at Noise Monitoring Station

Monitoring Station	Major Noise Source
M-N3	Traffic, School activity

3.6.4. The construction noise impact monitoring for the reporting month was carried out on 2, 6, 12, 17, 23, 25, 30 April 2019. The measurement data are shown in Appendix M and summarized in Tables 3.10:

Table 3.10 Summary of Noise Monitoring Results –M-N3

Time Period	Parameter	Range, dB(A)			Action	Limit Level
Time Feriou	rarameter	$ m L_{eq}*$	$L_{10}*$	$L_{90}*$	Level	Limit Level
Normal working hour from 0700-1900	L _{eq 30min}	65.7-67.3	68.0-69.9	63.6-65.5	When one documented compliant is received	For schools: 70dB(A) during normal teaching period and 65 dB(A) during examination periods

Remarks:

1. * Free Field Noise levels were adjusted with a correction of +3 dB(A).

Waste management

3.6.5. The waste generated from this Project includes inert construction and demolition (C&D) materials, and non-inert C&D materials. Non-inert C&D materials are made up of general refuse, vegetative wastes and recyclable wastes such as plastics and paper/cardboard packaging waste. Steel materials generated from the project are also grouped into non-inert C&D materials as the materials were not disposed of with other inert C&D materials. With reference to relevant handling records and trip tickets of this Project, the quantities of different types of waste generated in the reporting month are summarised in Table 3.11. Details of cumulative waste management data are presented as a waste flow table in Appendix N.

Table 3.11 Quantities of waste generated from the Project

	Quantity					
			Non-inert C&D Materials			
Reporting period	Inert C&D Materials	Chemical Waste	Waste General Refuse '000kg) disposed at	Recycled materials		
	(in '000m3)	(in '000kg)		Paper/card board (in '000kg)		Metals
			(in '000m3)		`	(in '000kg)
Apr-19	3.591	0.000	0.007	0.000	0.000	0.000

4. SUMMARY OF COMPLAINTS, NOTIFICATION OF SUMMONS AND PROSECUTIONS

4.1. The Environmental Complaint Handling Procedure is shown in below Table 4.1:

Table 4.1 Environmental Complaint Handling Procedure

Table 4.1 Environmental C	omplant Handing Frocedure
Complaint Received via Project Hotline	Complaint Received via 1823 or from other
	government departments
Contractor notify ER, ET and IEC	ER notify Contractor, ET and IEC
	to the complaint database. Contractor, ER and ET to gation of complaint
If complaint is considered not valid	If complaint is found valid
ET or ER to reply the complainant if necessary	Contractor to identify and implement remedial measures in consultation with the IEC, ET and ER.
	The ER, ET and IEC to review the effectiveness
	of the Contractor's remedial measures and the updated situation; ET to undertake additional monitoring and audit to verify the situation if necessary, and oversee that circumstances leading to the complaint do not recur. ER to conduct
	further inspection as necessary.
If the complaint is referred by the EPD, the Cor	ntractor to prepare interim report on the status of the
complaint investigation and follow-up actions st	ipulated above, including the details of the remedial
	or already taken, for submission to EPD within the
_	signed by the EPD

The ET to record the details of the complaint, results of the investigation, subsequent actions taken to address the complaint and updated situation including the effectiveness of the remedial measures, supported by regular and additional monitoring results in the monthly EM&A reports

- 4.2. Should non-compliance of the criteria occur, action in accordance with the Action Plan in Appendix D and Appendix E shall be carried out.
- 4.3. No exceedance of the Action and Limit Levels of the regular construction noise was recorded during the reporting period
- 4.4. No exceedance of the Action and Limit Level of 1-hour TSP and 24-hour TSP monitoring was recording during the reporting period.
- 4.5. No environmental complaint was received in the reporting period.
- 4.6. No notification of summons and prosecution was received in the reporting period.
- 4.7. Statistics on complaints, notifications of summons and successful prosecutions are summarized in Appendix O.

5. EM&A SITE INSPECTION

- 5.1. Site inspections were carried out on a weekly basis to monitor the implementation of proper environmental pollution control and mitigation measures under the Contract. In the reporting period, five (5) site inspections were carried out on 2, 9, 16, 23, 30 April 2019, along with bi-weekly inspection of the implementation of landscape and visual mitigation measures conducted on 9, 23 April 2019.
- 5.2. One joint site inspection with IEC also undertaken on 9 April 2019. Minor deficiencies were observed during weekly site inspection or joint site inspection. Key observations during the site inspections are summarized in Table 5.1.

 Date
 Environmental Observations
 Follow-up Status

 2 Apr 2019
 No Observations

 9 Apr 2019
 No Observations

 16 Apr 2019
 No Observations

 23 Apr 2019
 No Observations

 30 Apr 2019
 No Observations

Table 5.1 Site Observations

5.3. According to the EIA Study Report, Environmental Permit, contract documents and EM&A Manual, the mitigation measures detailed in the documents are implemented as much as practical during the reporting period. An updated Implementation Status of Environmental Mitigation Measures (EMIS) is provided in Appendix F.

6. FUTURE KEY ISSUES

- 6.1. Work to be undertaken in the next reporting month are:
 - Access Shaft Rock Excavation


Potential environmental impacts arising from the above construction activities are mainly associated with dust, construction noise and waste management.

- 6.2. The tentative schedule of regular construction noise monitoring, 1-hour TSP and 24-hour TSP monitoring in the next reporting period is presented in Appendix P.
- 6.3. The construction programme for the Project for the next reporting month is presented in Appendix B.

7. CONCLUSION AND RECOMMENDATIONS

- 7.1. This 15th monthly Environmental Monitoring and Audit (EM&A) Report presents the EM&A works undertaken during the period from 1 April 2019 to 30 April 2019 in accordance with the EM&A Manual and the requirement under EP- 457/2013/C
- 7.2. Air quality (including 1-hour TSP and 24-hour TSP) and noise impact monitoring were carried out in the reporting period. All monitoring results are satisfactory. No exceedance of the Action and Limit Level was recorded during the reporting period.
- 7.3. Weekly environmental site inspections were conducted during the reporting period. Joint site inspection with IEC were carried out on 9 April 2019. No deficiencies was observed during site inspection. The environmental performance of the Project was therefore considered satisfactory.
- 7.4. No environmental complaint was received in the reporting period.
- 7.5. No notification of summons or prosecution was received since commencement of the Contract.
- 7.6. The ET will keep track on the construction works to confirm compliance of environmental requirements and the proper implementation of all necessary mitigation measures.

Contract No. HY/2014/09 Central Kowloon Route – Ho Man Tin Access Shaft
A companyation A
Appendix A
Alignment and Works Area For the Contract No.
HY/2014/09

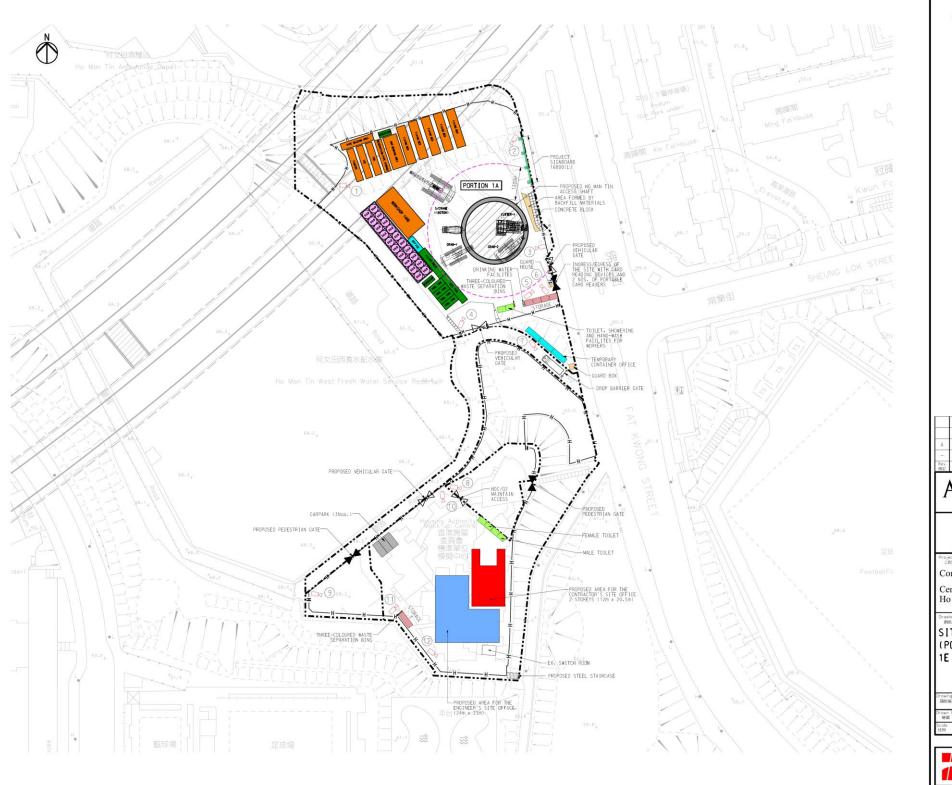


LEGENDS:





-	FIRST ISSUE Description	JK	11/12/17
n	Transaction of the Court		
A	SECOND [SSUE	JK	20/12/17

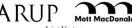





Contract No. HY/2014/09

Central Kowloon Route -Ho Man Tin Access Shaft

SITE LAYOUT PLAN (PORTION 1A.1B.1C.1D. 1E & 1F)

Drowing no 国抵賴號	NCC/	HMTS	/01/0	0001	Rev.
Drawn By 绘図	TC	Checked E 後核	JK	Approve 批准。	d By A OI
Scale tt/M	1:1000 @	A3	Status 聯段	WORK	[NG
	_	CODVDICE	T DESERV	/ED	




路 政 署 HIGHWAYS DEPARTMENT 主要工程管理處 MAJOR WORKS PROJECT MANAGEMENT OFFICE

Monthly Environmental Monitoring & Auditing Report Contract No. HY/2014/09 Central Kowloon Route – Ho Man Tin Access Shaft
Appendix B
Construction Programme



Contract No. HY/2014/09


Central Kowloon Route - Ho Man Tin Access SWork Programme

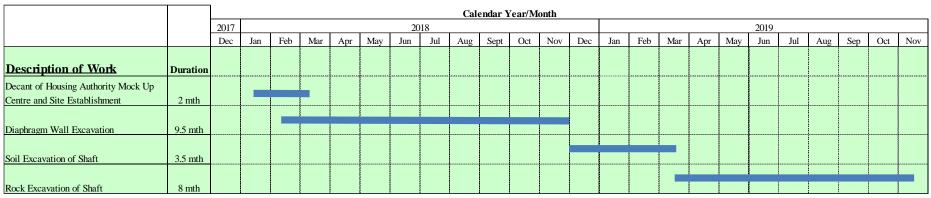

Appendix C Project Organization Chart

Project Organisation Chart

Environmental Protection Department (EPD)		Permit Holder Highways Department
		\bigcirc
Independent Environmental Checker (IEC) (ERM)		Engineer's Representative (ER) (AMMJV)
$\widehat{\bigcup}$		$\frac{1}{1}$
Environmental Team (ET) (Acuity)		Contractor Nishimatsu Construction Co. Ltd. (NCC)
		\bigcirc
		Project Manager (O. Iwata)
		\bigcirc
		Site Agent (Jim KO)
Design & Construction Team		Environmental Officer (Leo WONG
\bigcirc	_	\bigcirc
Subcontractors		Environmental Supervisor (Jeffery Ho)
<u>LEGEND:</u>		
Line of Communication		

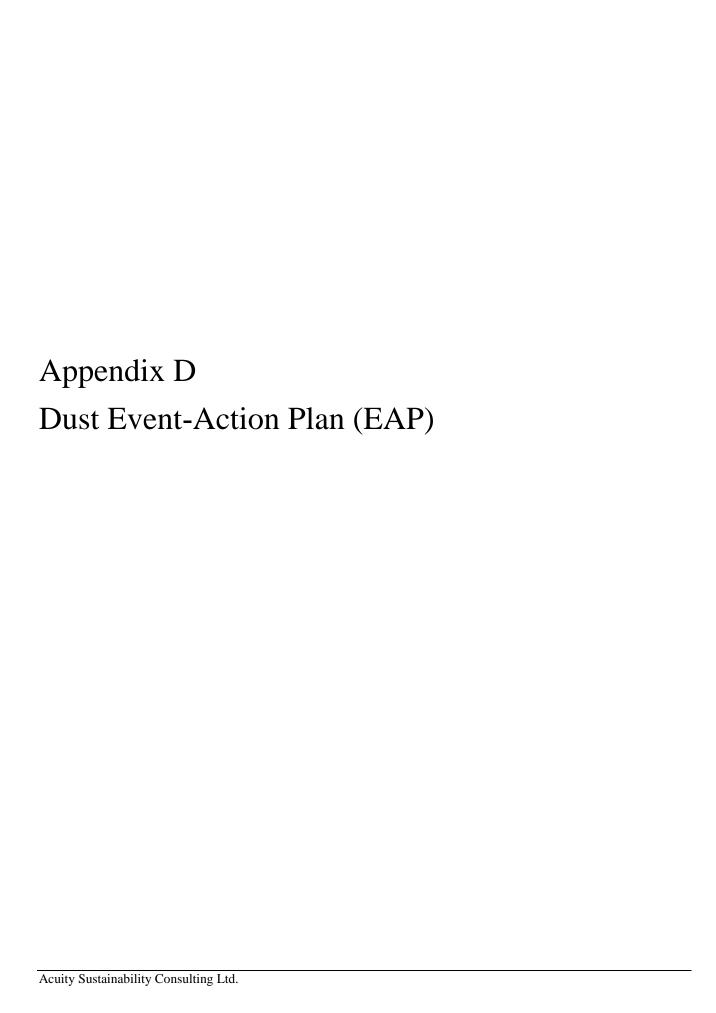

EVENT	ACTION			
EVENI	ET	IEC	ER	CONTRACTOR
ACTION LEV	EL			
1.Exceedance for one sample	 Identify source, investigate the causes of exceedance and propose remedial measures; Inform IEC and ER; Repeat measurement to confirm finding; Increase monitoring frequency to daily. 	 Check monitoring data submitted by ET; Check Contractor's working method. 	1. Notify Contractor.	 Rectify any unacceptable practice; Amend working methods if appropriate.
2.Exceedance for two or more consecutive samples	 Identify source; Inform IEC and ER; Advise the ER on the effectiveness of the proposed remedial measures; Repeat measurements to confirm findings; Increase monitoring frequency to daily; Discuss with IEC and Contractor on remedial actions required; If exceedance continues, arrange meeting with IEC and ER; If exceedance stops, cease additional monitoring. 	 Check monitoring data submitted by ET; Check Contractor's working method; Discuss with ET and Contractor on possible remedial measures; Advise the ET on the effectiveness of the proposed remedial measures; Supervise Implementation of remedial measures. 	Confirm receipt of notification of failure in writing; Notify Contractor; Ensure remedial measures properly implemented.	 Submit proposals for remedial to ER within 3 working days of notification; Implement the agreed proposals; Amend proposal if appropriate.
LIMIT LEVEL				
1.Exceedance for one sample	Identify source, investigate the causes of exceedance and propose remedial measures; Inform ER, Contractor and EPD; Repeat measurement to	 Check monitoring data submitted by ET; Check Contractor's working method; Discuss with ET and Contractor on possible remedial measures; 	Confirm receipt of notification of failure in writing; Notify Contractor; Ensure remedial measures properly implemented.	 Take immediate action to avoid further exceedance; Submit proposals for remedial actions to IEC within 3 working days of notification;


EVENT	ACTION				
EVENI	ET	IEC	ER	CONTRACTOR	
	confirm finding; 4. Increase monitoring frequency to daily; 5. Assess effectiveness of Contractor's remedial actions and keep IEC, EPD and ER informed of the results.	4. Advise the ER on the effectiveness of the proposed remedial measures;5. Supervise implementation of remedial measures.		Implement the agreed proposals; 4. Amend proposal if appropriate.	
2.Exceedance for two or more consecutive samples	 Notify IEC, ER, Contractor and EPD; Identify source; Repeat measurement to confirm findings; Increase monitoring frequency to daily; Carry out analysis of Contractor's working procedures to determine possible mitigation to be implemented; Arrange meeting with IEC and ER to discuss the remedial actions to be taken; Assess effectiveness of Contractor's remedial actions and keep IEC, EPD and ER informed of the results; If exceedance stops, cease additional monitoring. 	 Discuss amongst ER, ET, and Contractor on the potential remedial actions; Review Contractor's remedial actions whenever necessary to assure their effectiveness and advise the ER accordingly; Supervise the implementation of remedial measures. 	 Confirm receipt of notification of failure in writing; Notify Contractor; In consultation with the IEC, agree with the Contractor on the remedial measures to be implemented; Ensure remedial measures properly implemented; If exceedance continues, consider what portion of the work is responsible and instruct the Contractor to stop that portion of work until the exceedance is abated. 	 Take immediate action to avoid further exceedance; Submit proposals for remedial actions to IEC within 3 working days of notification; Implement the agreed proposals; Resubmit proposals if problem still not under control; Stop the relevant portion of works as determined by the ER until the exceedance is abated. 	

Note:

ET – Environmental Team

ER – Engineer's Representative

IEC – Independent Environmental Checker

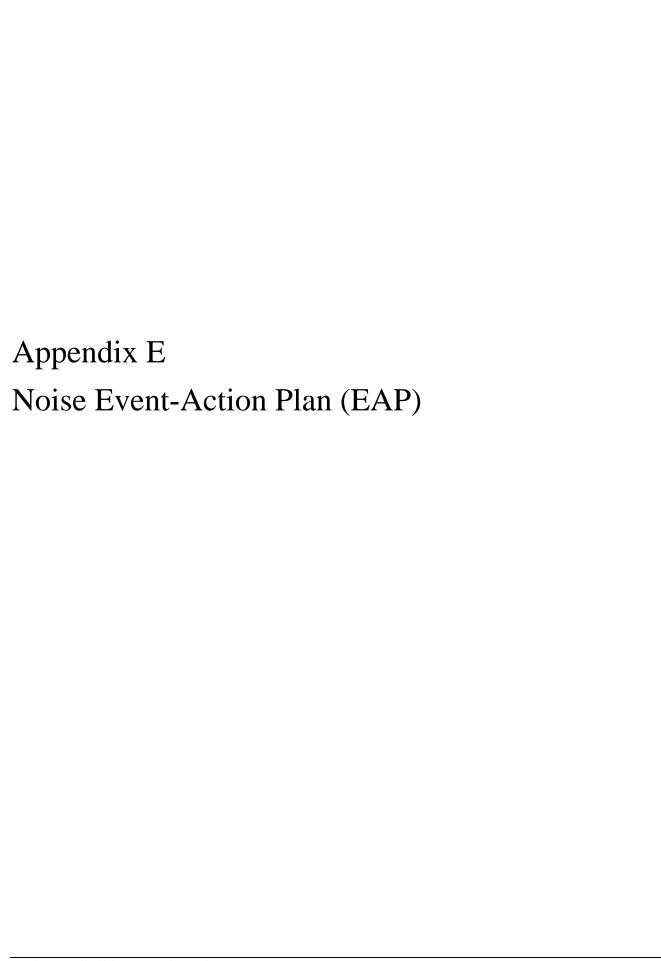

EVEN T	ACTION				
	ET	IEC	ER	CONTRACTOR	
Action Level	 Identify source, investigate the causes of exceedance and propose remedial measures; Notify IEC and Contractor; Report the results of investigation to the IEC, ER and Contractor; Discuss with the Contractor and formulate remedial measures; Increase monitoring frequency to check mitigation effectiveness. 	 Review the analysed results submitted by the ET; Review the proposed remedial measures by the Contractor and advise the ER accordingly; Supervise the implementation of remedial measures. 	 Confirm receipt of notification of failure in writing; Notify Contractor; Require Contractor to propose remedial measures for the analysed noise problem; Ensure remedial measures are properly implemented 	Submit noise mitigation proposals to IEC; Implement noise mitigation proposals.	
Limit Level	 Identify source; Inform IEC, ER, EPD and Contractor; Repeat measurements to confirm findings; Increase monitoring frequency; Carry out analysis of Contractor's working procedures to determine possible mitigation to be implemented; Inform IEC, ER and EPD the 	 Discuss amongst ER, ET, and Contractor on the potential remedial actions; Review Contractors remedial actions whenever necessary to assure their effectiveness and advise the ER accordingly; Supervise the implementation of remedial measures. 	 1.Confirm receipt of notification of failure in writing; 2. Notify Contractor; 3. Require Contractor to propose remedial measures for the analysed noise problem; 4. Ensure remedial measures properly implemented; 5. If exceedance continues, 	 Take immediate action to avoid further exceedance; Submit proposals for remedial actions to IEC within 3 working days of notification; Implement the agreed proposals; Resubmit proposals if problem still not under control; Stop the relevant portion of works as determined by the ER until the exceedance is abated. 	


EVEN T	ACTION				
	ET	IEC	ER	CONTRACTOR	
	causes and actions taken for the		consider what portion of the		
	exceedances;		work is responsible and		
	7. Assess effectiveness of		instruct the Contractor to		
	Contractor's remedial actions and		stop that portion of work		
	keep IEC, EPD and ER informed		until the exceedance is		
	of the results;		abated.		
	8. If exceedance stops, cease additional monitoring.				

Note:

ET – Environmental Team

IEC – Independent Environmental Checker

ER – Engineer's Representative

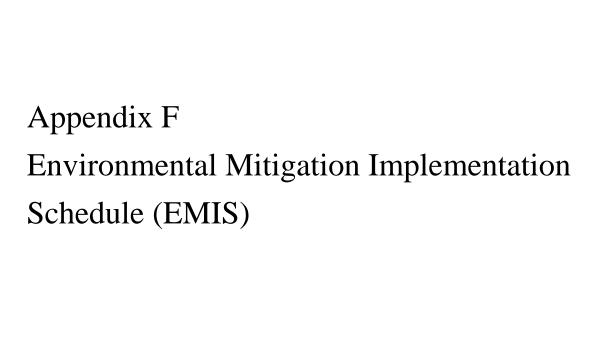

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
			Construction Dust Im	pact				
\$4.3.10	D1	The contractor shall follow the procedures and requirements given in the Air Pollution Control (Construction Dust) Regulation	Minimize dust impact at the nearby sensitive receivers	Contractor	All construction sites	Construction stage	APCO To control the dust impact To meet HKAQO and TM-EIA criteria	Implemented
S4.3.10	D2	Mitigation measures in form of regular watering under a good site practice should be adopted. Watering once per hour on exposed worksites and haul road should be conducted to achieve dust removal efficiencies of 91.7%. While the above watering frequencies are to be followed, the extent of watering may vary depending on actual site conditions but should be sufficient to maintain an equivalent intensity of	Minimize dust impact at the nearby sensitive receivers	Contractor	All construction sites	Construction stage	APCO To control the dust impact To meet HKAQO and TM-EIA criteria	• Implemented

EIA Ref. Log Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
	no less than 1.3 L/m² to achieve the dust removal efficiency.						
S4.3.10 D3	 Proper watering at exposed spoil should be undertaken throughout the construction phase; Any excavated or stockpile of dusty material should be covered entirely by impervious sheeting or sprayed with water to maintain the entire surface wet and then removed or backfilled or reinstated where practicable within 24 hours of the excavation or unloading; Any dusty materials remaining after a stockpile is removed should be wetted with water and cleared from the surface of roads; A stockpile of dusty material should not be extended beyond the pedestrian 	Minimize dust impact at the nearby sensitive receivers	Contractor	All construction sites	Construction stage	APCO To control the dust impact To meet HKAQO and TM-EIA criteria	• Implemented

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		 barriers, fencing or traffic cones; The load of dusty materials on a vehicle leaving a construction site should be covered entirely by impervious sheeting to ensure that the dusty materials do not leak from the vehicle. Where practicable, vehicle washing facilities with high pressure water jet should be provided at every discernible or designated vehicle exit point. The area where vehicle washing takes place and the road section between the washing facilities and the exit point should be paved with concrete, bituminous materials or hardcores; When there are open excavation and reinstatement works, hoarding of 						

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		not less than 2.4m high should be provided and properly maintained as far as practicable along the site boundary with provision for public crossing. Good site practice shall also be adopted by the Contractor to ensure the conditions of the hoardings are properly maintained throughout the construction period; •The portion of any road leading only to						
		construction site that is within 30m of a vehicle entrance or exit should be kept clear of dusty materials; •Surfaces where any pneumatic or power-driven drilling, cutting, polishing or other mechanical breaking operation takes place should be sprayed with water or a dust suppression chemical						

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		continuously; Any area that involves demolition activities should be sprayed with water or a dust suppression chemical immediately prior to, during and immediately after the activities so as to maintain the entire surface wet; Any skip hoist for material transport should be totally enclosed by impervious sheeting; Every stock of more than 20 bags of cement or dry-pulverised fuel ash (PFA) should be covered entirely by impervious sheeting or placed in an area sheltered on the top and the 3 sides; Loading, unloading, transfer, handling or storage of bulk cement						

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		or dry PFA should be carried out in a totally enclosed system or facility, and any vent or exhaust should be fitted with an effective fabric filter or equivalent air pollution control system • Exposed earth should be properly treated by compaction, turfing, hydroseeding, vegetation planting or sealing with latex, vinyl, bitumen, shotcrete or other suitable surface stabilizer within six months after the last construction activity on the construction site or part of the construction site where the exposed earth lies.						
\$4.3.10	D6	Implement regular dust monitoring under EM&A programme during the construction stage.	Monitoring of dust impact	Contractor	Selected rep. dust monitoring	Construction stage	• TM-EIA	Implemented

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
					station			
			Construction Noise (Airborne)	ı	T	1	
S5.4.1		 Implement the following good site practices: Only well-maintained plant should be operated on-site and plant should be serviced regularly during the construction programme; Machines and plant (such as trucks, cranes) that may be in intermittent use should be shut down between work periods or should be throttled down to a minimum; Plant known to emit noise strongly in one direction, where possible, be orientated so that the noise is directed away from nearby NSRs; Silencers or mufflers on construction equipment should be properly fitted 	Control construction airborne noise	Contractor	All construction sites	Construction stage	• Annex 5, TM-EIAO	• Implemented

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		 and maintained during the construction works; Mobile plant should be sited as far away from NSRs as possible and practicable; Material stockpiles, mobile container site office and other structures should be effectively utilized, where practicable, to screen noise from on-site construction activities. 						
S5.4.1		Install temporary hoarding located on the site boundaries between noisy construction activities and NSRs. The conditions of hoardings shall be properly maintained throughout the construction period.	Reduce the construction noise levels at low-level zone of NSRs through partial screening	Contractor	All construction sites	Construction stage	• Annex 5, TM-EIAO	Implemented
\$5.4.1		Install movable noise barriers (typical design is wooden framed barrier with a small-cantilevered on a skid footing with	Screen the noisy plant items to be used at all construction sites	Contractor	All construction sites where	Construction stage	• Annex 5, TM-EIAO	Implemented

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		25mm thick internal sound absorptive lining), acoustic mat or full enclosure, screen the noisy plants including air compressors, generators and handheld breakers, etc.			practicable			
\$5.4.1	N4	Use 'Quiet plant'	Reduce the noise levels of plant items	Contractor	All construction sites where practicable	Construction stage	• Annex 5, TM-EIAO	Implemented
S5.4.1		Loading/ unloading activities should be carried out inside the full enclosure of mucking out points.	Reduce the noise levels of loading/unloading activities	Contractor	Mucking out locations	Construction stage	Annex 5, TM-EIAO	Implemented
\$5.4.1		Sequencing operation of construction plants where practicable.	Operate sequentially within the same work site to reduce the construction airborne noise	Contractor	All construction sites where practicable	Construction stage	• Annex 5, TM-EIAO	Implemented
\$5.4.1		Implement a noise monitoring programme under EM&A programme.	Monitor the construction noise levels at the selected representative location	Contractor	Selected rep. noise monitoring	Construction stage	• TM-EIAO	Implemented

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing station	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
			Water Quality (Construction	on Phase)				
S6.9.1.1		In accordance with the Practice Note for Professional Persons on Construction Site Drainage, Environmental Protection Department, 1994 (ProPECC PN1/94), construction phase mitigation measures shall include the following: Construction Runoff At the start of site establishment, perimeter cut-off drains to direct off-site water around the site should be constructed with internal drainage works and erosion and sedimentation control facilities implemented. Channels (both temporary and permanent drainage pipes and culverts), earth bunds or	To minimize water quality impact from the construction site runoff and general construction activities	Contractor	All construction sites where practicable	Construction stage	Water Pollution Control Ordinance ProPECC PN 1/94 TM-EIAO TM-DSS	• Implemented

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		sand bag barriers should be provided on site to direct stormwater to silt removal facilities. The design of the temporary on-site drainage system will be undertaken by the contractor prior to the commencement of construction; The dikes or embankments for flood protection should be implemented around the boundaries of earthwork areas. Temporary ditches should be provided to facilitate the runoff discharge into an appropriate watercourse, through a silt/ sediment trap. The sediment/ silt traps should be incorporated in the permanent drainage channels to enhance deposition rates; The design of efficient silt removal						

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		facilities should be based on the guidelines in Appendix A1 of ProPECC PN 1/94, which states that the retention time for silt/ sand traps should be 5 minutes under maximum flow conditions. Sizes may vary depending upon the flow rate, but for a flow rate of 0.1 m³/s a sedimentation basin of 30 m³ would be required and for a flow rate of 0.5 m³/s the basin would be 150 m³. The detailed design of the sand/ silt traps shall be undertaken by the contractor prior to the commencement of construction; • All exposed earth areas should be completed and vegetated as soon as possible after earthworks have been completed, or alternatively, within						

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		 14 days of the cessation of earthworks where practicable. Exposed slope surfaces should be covered by tarpaulin or other means; The overall slope of the site should be kept to a minimum to reduce the erosive potential of surface water flows, and all traffic areas and access roads protected by coarse stone ballast. An additional advantage accruing from the use of crushed stone is the positive traction gained during prolonged periods of inclement weather and the reduction of surface sheet flows; All drainage facilities and erosion and sediment control structures should be regularly inspected and maintained to ensure proper and 						

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		efficient operation at all times and particularly following rainstorms. Deposited silt and grit should be removed regularly and disposed of by spreading evenly over stable, vegetated areas; Measures should be taken to minimize the ingress of site drainage into excavations. If the excavation of trenches in wet periods is necessary, they should be dug and backfilled in short sections wherever practicable. Water pumped out from trenches or foundation excavations should be discharged into storm drains via silt removal facilities; Open stockpiles of construction materials (for example, aggregates,						

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		sand and fill material) of more than 50m³ should be covered with tarpaulin or similar fabric during rainstorms. Measures should be taken to prevent the washing away of construction materials, soil, silt or debris into any drainage system; • Manholes should always be adequately covered and temporarily sealed so as to prevent silt, construction materials or debris being washed into the drainage system and storm runoff being directed into foul sewers; • Precautions be taken at any time of year when rainstorms are likely, actions to be taken when a rainstorm is imminent or forecasted, and actions to be taken during or after						

EIA Ref. Lo	M&A Recommended Mitigation Log Measures Ref.	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
	rainstorms are summarized in Appendix A2 of ProPECC PN 1/94. Particular attention should be paid to the control of silty surface runoff during storm events, especially for areas located near steep slopes; • All vehicles and plant should be cleaned before leaving a construction site to ensure no earth, mud, debris and the like is deposited by them on roads. An adequately designed and site wheel washing facilities should be provided at every construction site exit where practicable. Wash-water should have sand and silt settled out and removed at least on a weekly basis to ensure the continued efficiency of the process. The section of access road leading to,						

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		and exiting from, the wheel wash bay to the public road should be paved with sufficient backfall toward the wheel wash bay to prevent vehicle tracking of soil and silty water to public roads and drains; Oil interceptors should be provided in the drainage system downstream of any oil/ fuel pollution sources. The oil interceptors should be emptied and cleaned regularly to prevent the release of oil and grease into the storm water drainage system after accidental spillage. A bypass should be provided for the oil interceptors to prevent flushing during heavy rain; Construction solid waste, debris and rubbish on site should be collected,						

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		 handled and disposed of properly to avoid water quality impacts; All fuel tanks and storage areas should be provided with locks and sited on sealed areas, within bunds of a capacity equal to 110% of the storage capacity of the largest tank to prevent spilled fuel oils from reaching water sensitive receivers nearby; Adopt best management practices; All earth works should be conducted sequentially to limit the amount of construction runoff generated from exposed areas during the wet season (April to September) as far as practicable. 						
\$6.9.1.2	W2	Underground Works	To minimize construction water quality impact from the works	Contractor	All access shaft location	Construction stage	Water Pollution Control	Implemented

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		 Uncontaminated discharge should pass through sedimentation tanks prior to of-site discharge; The wastewater with a high concentration of SS should be treated (e.g. by sedimentation tanks with sufficient retention time) before discharge. Oil interceptors would also be required to remove the oil, lubricants and grease from the wastewater; Direct discharge of the bentonite slurry (as a result of D-wall) is not allowed. It should be reconditioned and reused wherever practicable. Temporary storage locations (typically a properly closed warehouse) should be provided on site for any unused bentonite that 					Ordinance • ProPECC PN 1/94 • TM-DSS • TM-EIAO	

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		needs to be transported away after all the related construction activities area completed. The requirements in ProPECC PN 1/94 should be adhered to in the handling and disposal of bentonite slurries.						
\$6.9.1.3	W3	Portable chemical toilets and sewage holding tanks are recommended for handling the construction sewage generated by the workforce. A licensed contractor should be employed to provide appropriate and adequate portable toilets and be responsible for appropriate disposal and maintenance.	To minimize water quality from sewage effluent	Contractor	All construction sites where practicable	Construction stage	Water Pollution Control Ordinance TM-DSS	• Implemented
\$6.9.1.6	W6	Accidental Spillage	To minimize water quality impact from accidental spillage	Contractor	All construction	Construction stage	Water Pollution Control	Implemented

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		In order to prevent accidental spillage of			site where		Ordinance	
		chemicals, the following is			practicable		• ProPECC PN	
		recommended:					1/94	
		All the tanks, containers,					• TM-EIAO	
		storage area should be					• TM-DSS	
		bunded and the locations						
		should be locked as far as						
		possible from the sensitive						
		watercourse and						
		stormwater drains;						
		The Contractor should						
		register as a chemical waste						
		producer if chemical wastes						
		would be generated.						
		Storage of chemical waste						
		arising from the						
		construction activities						
		should be stored with						
		suitable labels and						

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		warnings. Disposal of chemical wastes should be conducted in compliance with the requirements as stated in the Waste Disposal (Chemical Waste) (General) Regulation.						
	•		Waste Management (Constru	ction Waste)				
S7.4.1	WM1	On-site sorting of C&D material	Separation of unsuitable rock from ending up at concrete	Contractor	All construction	Construction stage	• DEVB (W) No. 6/2010	Implemented
		Geological assessment should be carried out by competent persons on site during excavation to identify materials which are not suitable to use as aggregate in structural concrete (e.g. volcanic rock, Aplite dyke rock, etc.). Volcanic rock and Aplite dyke rock should be separated at the source sites as far as practicable and stored at designated	batching plants and be turned into concrete for structural use		sites			

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		stockpile area preventing them from delivering to crushing facilities. The crushing plant operator should also be reminded to set up measures to prevent unsuitable rock from ending up at concrete batching plants and be turned into concrete for structural use. Details regarding control measures at source site and crushing facilities should be submitted by the Contractor for the Engineer to review and agree. In addition, site records should also be kept for the types of rock materials excavated and the traceability of delivery will be ensured with the implementation of Trip Ticket System and enforced by site supervisory staff as stipulated under DEVB TC(W) No. 6/2010 for						

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		tracking of the correct delivery to the rock crushing facilities for processing into aggregates. Alternative disposal option for the reuse of volcanic rock and Aplite Dyke rock, etc. should be explored.						
S7.5.1	WM2	 Construction and Demolition Material Maintain temporary stockpiles and reuse excavated fill material for backfilling and reinstatement; Carry out on-site sorting; Make provisions in the Contract documents to allow and promote the use of recycled aggregates where appropriate; Adopt 'selective demolition' technique to demolish the existing structures and facilities with a view to recovering broken concrete 	Good site practice to minimize the waste generation and recycle the C&D materials as far as practicable so as to reduce the amount for final disposal	Contractor	All construction sites	Construction stage	 Land (Miscellaneous Provisions) Ordinance Waste Disposal Ordinance ETWB TCW No. 19/2005 	• Implemented

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		effectively for recycling purpose, where possible; Implement a trip-ticket system for each works contract to ensure that the disposal of C&D materials are properly documented and verified; and Implement an enhanced Waste Management Plan similar to ETWBTC (Works) No. 19/2005 – "Environmental Management on Construction Sites" to encourage on-site sorting of C&D materials and to minimize their generation during the course of construction.						
S7.5.1	WM3	C&D Waste • Standard formwork or	Good site practice to minimize the waste generation and	Contractor	All construction	Construction stage	• Land (Miscellaneous	Implemented
		pre-fabrication should be used as far as practicable in order to minimize	recycle the C&D materials as far as practicable so as to reduce		sites		Provisions) Ordinance	

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		the arising of C&D materials. The	the amount for final disposal				Waste Disposal	
		use of more durable formwork or					Ordinance	
		plastic facing for the construction					• ETWB TCW No.	
		works should be considered. Use of					19/2005	
		wooden hoardings should not be						
		used, as in other projects. Metal						
		hoarding should be used to enhance						
		the possibility of recycling. The						
		purchasing of construction materials						
		will be carefully planned in order to						
		avoid over ordering and wastage;						
		• The Contractor should recycle as						
		much of the C&D materials as						
		possible on-site. Public fill and						
		C&D waste should be segregated and						
		stored in different containers or skips						
		to enhance reuse or recycling of						
		materials and their proper disposal.						
		Where practicable, concrete and						

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		masonry can be crushed and used as fill. Steel reinforcement bar can be used by scrap steel mills. Different areas of the sites should be considered for such segregation and storage.						
\$7.5.1	WM6	 Chemical Waste Chemical waste that is produced, as defined by Schedule 1 of the Waste Disposal (Chemical Waste) (General) Regulation, should be handled in accordance with the Code of Practice on the Packaging, Labelling and Storage of Chemical Wastes; Containers used for the storage of chemical wastes should be suitable for the substance they are holding, resistant to corrosion, maintained in a good condition, and securely 	Control the chemical waste and ensure proper storage, handling and disposal	Contractor	All construction sites	Construction stage	 Waste Disposal (Chemical Waste) (General) Regulation Code of Practice on the Packaging, Labelling and Storage of Chemical Waste 	• Implemented

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		closed, have a capacity of less than 450 L unless the specification has been approved by EPD, and display a label in English and Chinese in accordance with instructions prescribed in Schedule 2 of the regulation; The storage area for chemical wastes should be clearly labelled and used solely for the storage of chemical waste, enclosed on at least 3 sides, have an impermeable floor and bunding of sufficient capacity to accommodate 110% of the volume of the largest container or 20% of the total volume of waste stored in that area, whichever is the greatest, have adequate ventilation, covered to prevent rainfall entering, and						

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		arranged so that incompatible materials are adequately separated; • Disposal of chemical waste should be via a licensed waste collector, be to a facility licensed to receive chemical waste, such as the Chemical Waste Treatment Centre which also offers a chemical waste collection service and can supply the necessary storage containers, or be to a reuser of the waste, under approval from EPD.						
\$7.5.1	WM7	General Refuse General refuse generated on-site should be stored in enclosed bins or compaction units separately from construction and chemical wastes; A reputable waste collector should be employed by the Contractor to remove general refuse from the site,	Minimize production of the general refuse and avoid odour, pest and litter impacts	Contractor	All construction sites	Construction stage	Waste Disposal Ordinance	• Implemented

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status	
		separately from construction and chemical wastes, on a daily basis to minimize odour, pest and litter impacts. Burning of refuse on construction sites is prohibited by law. • Aluminum cans are often recovered from the waste stream by individual collectors if they are segregated and made easily accessible. Separate labelled bins for their deposit should be provided if feasible; • Office wastes can be reduced through the recycling of paper if volumes are large enough to warrant collection. Participation in a local collection scheme should be considered by the Contractor.							
	Hazard to Life								

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
S9.18	H1	Blasting activities regarding transport	To ensure that the risks from	Contractor	Works areas	Construction stage	• Dangerous	• N/A
		and use of explosives should be	the proposed explosives		at which		Goods	
		supervised and audited by competent	handling and transport would		explosives		Ordinance	
		site staff to ensure full compliance with	be acceptable		would be			
		the blasting permit conditions.			used			
S9.6,	H2	Detonators shall not be transported in	To reduce the risk of explosion	Contractor	-	Construction stage	Dangerous	• N/A
para.4		the same vehicle with other Category 1	during the transport of				Goods	
		Dangerous Goods.	cartridged emulsion				Ordinance	
S9.6,	Н3	The explosives delivery trucks should be	To comply with the	Contractor	=	Construction stage	Dangerous	• N/A
para.8		approved by Mines Division and should	requirements for approval of an				Goods	
		meet the regulatory requirements for	explosives delivery vehicle				Ordinance	
		transport of explosives.						
S9.10,	H4	Blast cover should be provided for shaft	To ensure safe use of explosives	Contractor	Shaft	Construction stage	-	• N/A
para.7 and		at HMT, and kept closed during blasting.						
S9.18								
		Provision of blast doors or heavy duty						
		blast curtains should be implemented at						
		the shaft to prevent flyrock and control						
		the air overpressure.						

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
\$9.16	H5	Only the required quantity of explosives for a particular blast should be transported to avoid the return.	To reduce risks during explosives transport	Contractor	Works areas at which explosives would be used	Construction stage	-	
S9.18	Н7	The approved truck dedicated for transport of explosives should comply with the "Guidance Note on Requirements for Approval of an Explosives Delivery Vehicle" issued by CEDD Mines Division. The truck should be periodically inspected and properly maintained in good operation conditions. The fuel carried in the fuel tank should be minimized to reduce the duration of fire. Adequate fire fighting equipment shall be provided, inspected and replaced periodically (e.g. fire extinguishers).	To reduce the risk during explosives transport	Contractor	Works areas of which explosives would be used	Construction stage	• Dangerous Goods Ordinance	• N/A

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
\$9.18	Н8	The driver and his assistant should be physically healthy, experienced and have good safe driving records. The driver should hold a proper driving licence for the approved transport truck. Dedicated training programme and regular road safety briefing sessions/ workshops should be provided to enhance their safe driving attitude and practice. Smoking should be strictly prohibited.	To reduce the risk during explosives transport	Contractor	Works areas at which explosives would be used	Construction stage	-	• Implemented
S9.18	Н9	Emergency response plans in case of road accident should be prepared and implemented. The driver and his assistant should be familiar with the emergency procedures including evacuation, and proper communication/ fire-fighting equipment should be provided to the driver and his assistant.	To reduce the risk during explosives transport	Contractor	Works areas at which explosives would be used	Construction stage	-	Implemented

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
S9.18		Close liaison and communication among Mines Division, Contractors for transport of explosives, and working staff of the blasting should be established. In case of any change of work schedule leading to cancellation or variation of explosives required, relevant parties should be informed in time to avoid unused explosives at the work sites.	To reduce the risk during explosives transport	Contractor	Works areas at which explosives would be used	Construction stage	-	• N/A
59.18		Close liaison and communication with Fire Services Department should be established to reduce the accidental detonation escalated from a fire. The contractors for transport of explosives should use the preferred transport routes as far as practicable.	To reduce the risk during explosives transport	Contractor	Works areas at which explosives would be used	Construction stage	-	• N/A
\$9.18		Contingency plan should be prepared for transport of explosives under severe weather conditions such as rainstorms	To reduce the risk during explosives transport	Contractor	Works areas at which explosives	Construction stage	-	• N/A

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		and thunderstorms.			would be used			
S9.18		For explosive transport, all packages of explosives on the truck should be properly stored in the truck compartment as required. Packaging of the explosives should remain intact (i.e. damage free) until they are transferred to the blasting site.	To reduce the risk during explosives transport	Contractor	Works areas at which explosives would be used	Construction stage	-	• N/A
\$9.18		Availability of a parking space should be ensured before commencement of transport of explosives. Location for loading and unloading of explosives should be as close as possible to the shaft. No hot work should be performed in the vicinity during the time of loading and unloading.	To reduce the risk during explosives transport	Contractor	Works areas at which explosives would be used	Construction stage	-	• N/A
S9.18		It is recommended to explore to minimize the use of the cartridged	To reduce the risk during explosives transport	Contractor	Works areas	Construction stage	-	• N/A

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		emulsion explosives and maximize the			explosives			
		use of bulk emulsion explosive as far as			would be			
		practicable.			used			
S9.18	H24	It is recommended to explore to use	To reduce the risk during	Contractor	Works areas	Construction stage	-	• N/A
		smaller explosive charges such as 'cast	explosives transport		at which			
		boosters' or 'mini-cast booster' instead			explosives			
		of cartridged emulsion as primers for			would be			
		bulk emulsion. This option reduces the			used			
		quantity of explosives required for						
		transportation for the sections where						
		bulk emulsion will be used.						
			Landscape & V	isual				
S10.10.1	LV1	Good Site Management	Minimize visual impact	Contractor	Within	Construction stage	-	Implemented
Table					Project site			
10.11		• Large temporary stockpiles of						
		excavated material shall be covered						
		with unobtrusive sheeting to prevent						
		dust and dirt spreading to adjacent						
		landscape areas and vegetation, and						

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		to create a neat and tidy visual appearance. • Construction plant and building material shall be orderly and carefully stored in order to create a neat and tidy visual appearance.						
S10.10.1	LV4	Screen Hoarding	Minimize visual impact	Contractor	Within	Construction stage	-	Implemented
Table		Decorative screen hoarding should			Project site			
10.11		be erected to screen the public from						
		the construction area. It should be						
		designed to be compatible with the						
		existing urban context.						
S10.10.1	LV5	<u>Lighting</u> Control during	Minimize visual impact	Contractor	Within	Construction stage	-	Implemented
Table		<u>Construction</u>			Project site			
10.11		All lighting in the construction site						
		shall be carefully controlled to						
		minimize light pollution and						
		night-time glare to nearby						
		residencies and GIC. The						

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		Contractor shall consider other security measures, which shall minimize the visual impacts.						
S10.10.1 Table 10.11	LV6	 Erosion Control The potential for soil erosion shall be reduced by minimizing the extent of vegetation disturbance on site and by providing a protective cover over newly exposed soil. 	Minimize landscape impact	Contractor	Within Project site	Construction stage	-	• N/A
S10.10.1 Table 10.11	LV7	Tree Protection & Preservation Carefully protected during construction. Tree protection measures will be detailed at the Tree Removal Application stage and plans submitted to the relevant Government Department for approval in due course in accordance with ETWB TC no. 3/2006.	Minimize landscape and visual impact	Contractor	Within Project site	Construction stage	• 'Guidelines for Tree Risk Management and Assessment Arrangement on an Area Basis and on a Tree Basis', Greening,	• Implemented


EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
							Landscape and Tree Management (GLTM) Section, DEVB • Latest recommended horticultural practices from GLTM Section, DEVB	
S10.10.1 Table 10.11	LV8	Tree Transplantation • For trees unavoidably affected by the Project that have to be removed, where practical transplantation will be chosen as the top priority method of removal. If this is not possible or practical compensatory planting will be provided for trees unavoidably	Minimize landscape and visual impact	Contractor	Within Project site and designated off-site locations	Prior to Construction stage	ETWB TCW 3/2006 Latest recommended horticultural practices from Greening, Landscape and	• N/A

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
\$10.10.1	LV9	felled (See LV10). For trees unavoidably affected by the Project works that are transplanted, transplantation must be carried out in accordance with ETWB TCW 2/2004 and 3/2006. Compensatory Planting	Minimize visual impact and also	Contractor	Within	Construction stage	Tree Management (GLTM) Section, DEVB • ETWB TCW 2/2004 • ETWB TCW	• Implemented
Table 10.11		For trees unavoidably affected by the Project that have to be removed, where practical transportation will be chosen as the top priority method of removal but if this is not possible or practical compensatory planting will be provided for trees unavoidably felled. All felled trees shall be compensated for by planting trees to the satisfaction of relevant Government projects. Required numbers and locations of	enhance landscape		Project site		3/2006 • Latest recommended horticultural practices from Greening, Landscape and Tree Management (GLTM) Section, DEVB • ETWB TCW	

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		compensatory trees shall be determined and agreed separately with Government during the Tree Felling Application process under ETWBTC 3/2006. Compensatory tree planting may be incorporated into public open spaces and along roadside amenity areas affected by the construction works and therefore be part of the bigger wider planting plans. Onsite compensation planting is preferred but if necessary, additional receptor sites outside the Works Area shall be agreed separately with Government during the Tree Felling Application process.					2/2004	
		p	Cultural Heritage Impact (Co	nstruction Phase)				
S11.4.4	CH1	The contractor should be alerted	To preserve any cultural	Contractor	During	Construction stage	• AMOs	Implemented

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		during the construction on the	heritage items which may be		construction		requirements	
		possibility of locating archaeological	removed and damaged by the		works			
		remains and as a precautionary	excavation					
		measure, AMO shall be informed						
		immediately in case of discovery of						
		antiquities or supposed antiquities in						
		the subject sites.						
	ı		EM&A Proje	ct	T	T		
S13.2	EM1	An Independent Environmental	Control EM&A Performance	Highways	All	Construction stage	• EIAO Guidance	Implemented
		Checker needs to be employed as per		Department	construction		Note No.	
		the EM&A Manual			sites		4/2010	
							• TM-EIAO	
S13.2-13.4	EM2	An Environmental Team needs to be	Perform environmental	Highways	All	Construction stage	• EIAO Guidance	Implemented
		employed as per the EM&A Manual;	monitoring & auditing	Department/	construction		Note No.	
		Prepare a systematic Environmental		Contractor	sites		4/2010	
		Management Plan to ensure					• TM-EIAO	
		effective implementation of the						
		mitigation measures;						
		An environmental impact monitoring						

EIA Re	EM&A f. Log Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		needs to be implemented by the Environmental Team to ensure all the requirements given in the EM&A Manual are fully complied with.						

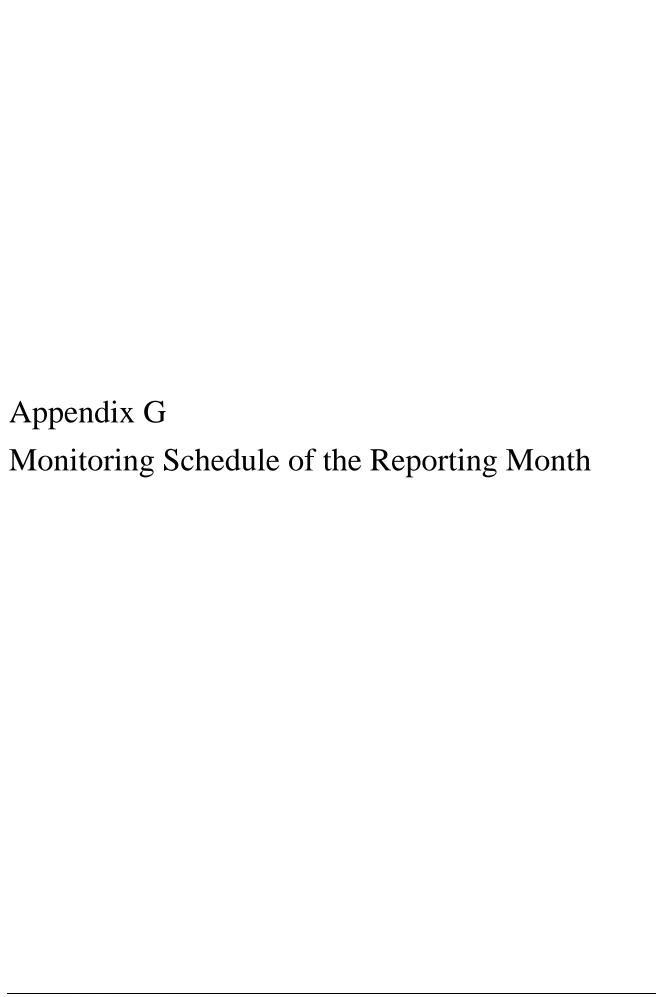

			Impact Monitoring Schedule for HMTS			
			Apr-19			
Sun	Mon	Tue		Thur	Fri	Sat
	1	2	3	4	5	6
		Impact				Impact
		TSP-1hr & TSP-24hr monitoring for M-A3				TSP-1hr & TSP-24hr monitoring for M-A3
		Noise monitoring for				Noise monitoring for
		M-N3				M-N3
7	8	9	10	11	12	13
/	8	9	10	11	Impact	13
					TSP-1hr & TSP-24hr monitoring for M-A3	
					Noise monitoring for M-N3	
14	15	16	17	18	19	20
			Impact			
			TSP-1hr & TSP-24hr monitoring for M-A3			
			Noise monitoring for			
			M-N3			
21	22		24		26	27
		Impact		Impact		
		TSP-1hr & TSP-24hr monitoring for M-A3		TSP-1hr & TSP-24hr monitoring for M-A3		
		Noise monitoring for		Noise monitoring for M-N3		
		M-N3		M-N3		
28	29	30				
		Impact				
		TSP-1hr & TSP-24hr monitoring for M-A3				
		Noise monitoring for				
		M-N3				
<u> </u>		<u> </u>	1	<u> </u>	<u> </u>	

Appendix H
Calibration Certificates
(Air Monitoring)



SIBATA SCIENTIFIC TECHNOLOGY LTD.

1-1-62, Nakane, Soka, Saitama, 340-0005 Japan

TEL: 048-933-1582 FAX: 048-933-1591

CALIBRATION CERTIFICATE

Date: October 17, 2018

Equipment Name : Digital Dust Indicator, Model LD-3B

Code No. : 080000-42

Quantity : 1 unit

Serial No. : 296093

Sensitivity : 0.001 mg/m3 Sensitivity Adjustment : 650CPM

Scale Setting : October 15, 2018

We hereby certify that the avobe mentioned instrment has been calibrated satisfactory.

Sincerely

SIBATA SCIENTIFIC TECHNOLOGY LTD.

Tong Zhang

Tong Zhang

Overseas Sales Division



RECALIBRATION **DUE DATE:**

January 22, 2020

Calibration Certification Information

Cal. Date: January 22, 2019

Rootsmeter S/N: 438320

Ta: 293 Pa: 756.9 °K

Operator: Jim Tisch

mm Hg

Calibrator S/N: 3465 Calibration Model #: TE-5025A

Run	Vol. Init (m3)	Vol. Final (m3)	ΔVol. (m3)	ΔTime (min)	ΔP (mm Hg)	ΔH (in H2O)
1	1	2	1	1.4330	3.2	2.00
2	3	4	1	1.0230	6.4	4.00
3	5	6	1	0.9170	7.9	5.00
4	7	8	1	0.8730	8.7	5.50
5	9	10	1	0.7180	12.7	8.00

		Data Tabula	tion		
Vstd	Qstd	$\sqrt{\Delta H \left(\frac{Pa}{Pstd}\right) \left(\frac{Tstd}{Ta}\right)}$		Qa	√∆H(Ta/Pa)
(m3)	(x-axis)	(y-axis)	Va	(x-axis)	(y-axis)
1.0087	0.7039	1.4233	0.9958	0.6949	0.8799
1.0044	0.9818	2.0129	0.9915	0.9693	1.2443
1.0024	1.0931	2.2505	0.9896	1.0791	1.3912
1.0013	1.1470	2.3603	0.9885	1.1323	1.4591
0.9959	1.3871	2.8467	0.9832	1.3694	1.7598
	m=	2.08653		m=	1.30655
QSTD[b=	-0.03834	QA	b=	-0.02370
,	r=	0.99989		r=	0.99989

	Calculation	IS	
Vstd=	ΔVol((Pa-ΔP)/Pstd)(Tstd/Ta)	Va=	ΔVol((Pa-ΔP)/Pa)
Qstd=	Vstd/∆Time	Qa=	Va/ΔTime
	For subsequent flow rat	e calculatio	ns:
Qstd=	$1/m\left(\left(\sqrt{\Delta H\left(\frac{Pa}{Pstd}\right)\left(\frac{Tstd}{Ta}\right)}\right)-b\right)$	Qa=	$1/m\left(\left(\sqrt{\Delta H\left(Ta/Pa\right)}\right)-b\right)$

	Standard Conditions
Tstd:	298.15 °K
Pstd:	760 mm Hg
	Key
ΔH: calibrator	manometer reading (in H2O)
ΔP: rootsmete	er manometer reading (mm Hg)
Ta: actual abs	olute temperature (°K)
Pa: actual bar	ometric pressure (mm Hg)
b: intercept	
m: slope	

RECALIBRATION

US EPA recommends annual recalibration per 1998 40 Code of Federal Regulations Part 50 to 51, Appendix B to Part 50, Reference Method for the Determination of Suspended Particulate Matter in the Atmosphere, 9.2.17, page 30

Tisch Environmental, Inc. 145 South Miami Avenue Village of Cleves, OH 45002

www.tisch-env.com

TOLL FREE: (877)263-7610 FAX: (513)467-9009

InnoTech Instrumentation Co. Ltd.

創新科儀有限公司

HIVOL SAMPLER CALIBRATION DATA SHEET (TSP)

Site Information

	Tsoi Kung Po				
Location:	Secondary School	Site ID:	M-A3	Date:	12-Apr-2019
Serial No:	1048	Model:	TE-5170X	Operator:	Hong

Ambient Condition

Corrected Pressure (mm Hg):	760.0	Temperature (deg K):	298.2
-----------------------------	-------	----------------------	-------

Calibration Orifice

Model:	TE-5025	Slope:	2.08653
Serial No.:	3465	Intercept:	-0.03834
Calibration Due Date:	22-Jan-20	Corr. Coeff:	0.99989

Calibration Data

Plate or	In,H2O	Qa, X-Axis	I, CFM	IC, Y-Axis
Test #	(in)	(m3/min)	(chart)	(corrected)
1	1.79	0.659	25.7	25.69
2	2.93	0.839	30.7	30.69
3	3.37	0.898	32.5	32.49
4	3.40	0.902	32.5	32.49
5	3.91	0.966	34.4	34.39

Sampler Calibtation Relationship (Qa on x-axis, IC on y-axis)						
m=	28.3563	b=	6.9720	Corr. Coeff=	0.9999	
Sampl	ler set point(SSP)	41	CFM			
		(Calculations			
Qstd = 1/m[Sqrt(Harring)]	H2O(Pa/Pstd)(Tstd/Ta))-b]		m = sampler slope			
IC = I[Sqrt(Pa/Pst)]	d)(Tstd/Ta)]		b = sampler intercept			
			I = chart response			
Qstd = standard f	low rate		Tav = average temperature			
IC = corrected cha	art response		Pav = average pressure			
I = actual chart re	sponse					
m = calibrator Qs	td slope					
b = calibrator Qst	td intercept					
Ta = actual tempe	rature during calibration (deg K)					
Pa = actual pressu	are during calibration (mm Hg)					
Tstd = 298 deg K						
Pstd = 760 mm Hg	<u> </u>					
For subsequent c	alculation of sampler flow:					
(1.21*m+b)/[Sqrt(298/Tav)(Pav/760)]					

Date:

12-Apr-19

Checked by:

InnoTech Instrumentation Co. Ltd.

創新科儀有限公司

HIVOL SAMPLER CALIBRATION DATA SHEET (TSP)

Site Information

	Tsoi Kung Po				
Location:	Secondary School	Site ID:	M-A3	Date:	30-Apr-2019
Serial No:	1048	Model:	TE-5170X	Operator:	Hong

Ambient Condition

	Т		
Corrected Pressure (mm Hg):	760.0	Temperature (deg K):	298.2

Calibration Orifice


Model:	TE-5025	Slope:	2.08653
Serial No.:	3465	Intercept:	-0.03834
Calibration Due Date:	22-Jan-20	Corr. Coeff:	0.99989

Calibration Data

Plate or	In,H2O	Qa, X-Axis	I, CFM	IC, Y-Axis
Test #	(in)	(m3/min)	(chart)	(corrected)
1	1.80	0.661	25.7	26.00
2	2.95	0.841	30.7	31.20
3	3.38	0.899	32.5	32.80
4	3.35	0.895	32.5	32.60
5	3.85	0.959	34.4	34.50

Sampler Calibtation Relationship (Qa on x-axis, IC on y-axis)

m=	28.4948	b=	7.1670	Corr. Coeff=	0.9999
Sam	npler set point(SSP)	42	CFM		
		(Calculations		
Qstd = 1/m[Sqr	t(H2O(Pa/Pstd)(Tstd/Ta))-b]		m = sampler slope		
IC = I[Sqrt(Pa/F	Pstd)(Tstd/Ta)]		b = sampler intercept		
	,,		I = chart response		
Qstd = standard	d flow rate		Tav = average temperature		
IC = corrected of			Pav = average pressure		
I = actual chart	•		0		
m = calibrator (Qstd slope				
b = calibrator (Qstd intercept				
Ta = actual tem	perature during calibration (deg K)			
Pa = actual pres	ssure during calibration (mm Hg)				
Tstd = 298 deg	K				
Pstd = 760 mm	Hg				
	t calculation of sampler flow:				
(1.21*m+b)/[Sq	rt(298/Tav)(Pav/760)]				
	Hava				
Checked by:	(000		Date:	30-A ₁	pr-19

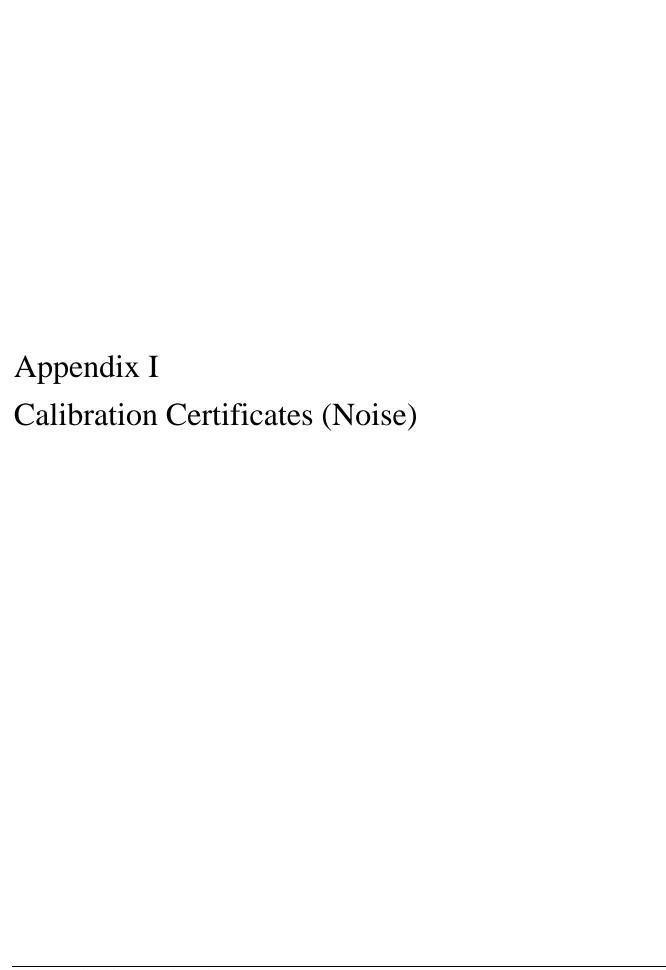

Acoustics and Air Testing Laboratory Co. Ltd. 聲學及空氣測試實驗室有限公司

Certificate of Calibration

for

Description:

Sound Level Meter

Manufacturer:

NTi Audio

Type No.:

XL2 (Serial No.: A2A-13661-E0)

Microphone:

ACO 7052 (Serial No.:70537)

Preamplifier:

NTi Audio MA220 (Serial No.:6282)

Submitted by:

Customer:

Acuity Sustainability Consulting Limited

Company Address:

Unit 1908, iPlace, Nos. 301-305 Castle Peak Road,

Kwai Chung, New Territories

Upon receipt for calibration, the instrument was found to be:

Within

☐ Outside

the allowable tolerance.

The test equipment used for calibration are traceable to National Standards via:

- The Government of The Hong Kong Special Administrative Region Standard & Calibration Laboratory

Date of receipt: 7 September 2018

Date of calibration: 10 September 2018

Certified by:

L∕øboratory Manager

Date of issue: 10 September 2018

Certificate No.: APJ18-086-CC001

Page 1 of 4

Room 422, Leader Industrial Centre, 57-59 Au Pui Wan Street , Fo Tan, Shatin, N.T., Hong Kong Tel: (852) 2668 3423 Fax:(852) 2668 6946

Homepage: http://www.aa-lab.com

E-mail: inquiry@aa-lab.com

1. Calibration Precaution:

- The unit-under-test (UUT) was allowed to stabilize in the laboratory for over 24 hours, and switched on to warm up for over 10 minutes before the commencement of the test.
- The results presented are the mean of 3 measurements at each calibration point.

2. Calibration Conditions:

Air Temperature:

26.0 °C

Air Pressure:

1008 hPa

Relative Humidity:

64.8 %

3. Calibration Equipment:

Type

Serial No.

Calibration Report Number

Traceable to

Multifunction Calibrator

B&K 4226 2288467

AV180064

HOKLAS

4. Calibration Results

Sound Pressure Level

Reference Sound Pressure Level



Setting of Unit-under-test (UUT)		Applied value		UUT Reading,	IEC 61672 Class 1		
Range, dB	Freq. W	Veighting	Time Weighting	Level, dB	Frequency, Hz	dB	Specification, dB
30-130	dBA	SPL	Fast	94	1000	94.0	±0.4

Linearity

Sett	ing of Un	it-under-t	est (UUT)	App	ied value	UUT Reading,	IEC 61672 Class 1
Range, dB	Freq. Weighting Time Weighting		Level, dB	Frequency, Hz	dB	Specification, dB	
	dBA		Fast	94		94.0	Ref
30-130		SPL		104	1000	104.0	±0.3
				114		114.0	±0.3

Time Weighting

Sett	ing of Uni	t-under-t	est (UUT)	Appl	ied value	UUT Reading,	IEC 61672 Class	
Range, dB	Freq. W	eighting	Time Weighting	Level, dB	Frequency, Hz	dB	Specification, dB	
30-130	dBA	SPL	Fast	94	1000	94.0	Ref	
30-130	dbA SPL	Slow	94	1000	94.0	±0.3		

Certificate No.: APJ18-086-CC001

Page 2 of 4

Room 422,Leader Industrial Centre,57-59 Au Pui Wan Street ,Fo Tan, Shatin,N.T.,Hong Kong
Tel: (852) 2668 3423 Fax:(852) 2668 6946

Frequency Response

Linear Response

Sett	ing of Unit	t-under-t	est (UUT)	Appl	ied value	UUT Reading,	IEC 61672 Class 1
Range, dB	Freq. Wo	eighting	Time Weighting	Level, dB	Frequency, Hz	dB	Specification, dB
			Fast		31.5	93.9	±2.0
1		dB SPL			63	94.0	±1.5
				94	125	94.0	±1.5
30-130	dВ				250	94.0	±1.4
30-130	uБ				500	94.0	±1.4
					1000	94.0	Ref
					2000	93.8	±1.6
					4000	93.9	±1.6

A-weighting

Sett	ing of Uni	t-under-t	est (UUT)	Appl	ied value	UUT Reading,	IEC 61672 Class 1
Range, dB	Freq. Weighting		Time Weighting	Level, dB	Frequency, Hz	dB	Specification, dB
					31.5	54.8	-39.4 ±2.0
				63	67.8	-26.2 ±1.5	
		SDI	Fact	04	125	77.9	-16.1 ±1.5
30-130	dBA SPL Fast 94				250	85.4	-8.6 ±1.4
30 130		500	90.8	-3.2 ±1.4			
				1000	94.0	Ref	
					2000	95.0	+1.2±1.6
					4000	94.9	+1.0±1.6

C-weighting

Sett	ing of U	nit-under-t	est (UUT)	Appl	ied value	UUT Reading,	IEC 61672 Class 1
Range, dB	Freq. V	Weighting	Time Weighting	Level, dB	Frequency, Hz	dB	Specification, dB
			Fast	94	31.5	90.9	-3.0 ±2.0
					63	93.2	-0.8 ±1.5
					125	93.8	-0.2 ±1.5
30-130	dBC	C SPL			250	94.0	-0.0 ±1.4
30-130	abc	SIL			500	94.0	-0.0±1.4
					1000	94.0	Ref
				2000	93.7	-0.2 ±1.6	
					4000	93.1	-0.8 ±1.6



Certificate No.: APJ18-086-CC001

Page 3 of 4

Room 422,Leader Industrial Centre,57-59 Au Pui Wan Street ,Fo Tan, Shatin,N.T.,Hong Kong
Tel: (852) 2668 3423 Fax:(852) 2668 6946

(A+A)*L

Calibration Results Applied 5.

The results apply to the particular unit-under-test only. All calibration points are within manufacture's specification as IEC 61672 Class 1.

Uncertainties of Applied Value:

31.5 Hz	± 0.15
63 Hz	± 0.05
125 Hz	± 0.05
250 Hz	± 0.05
500 Hz	± 0.10
1000 Hz	± 0.05
2000 Hz	± 0.05
4000 Hz	± 0.10
1000 Hz	± 0.05
1000 Hz	± 0.05
	63 Hz 125 Hz 250 Hz 500 Hz 1000 Hz 2000 Hz 4000 Hz 1000 Hz

The uncertainties are evaluated for a 95% confidence level.



The values given in this certification only related to the values measured at the time of the calibration and any uncertainties quoted will not allow for the equipment long-term drift, variations with environmental changes, vibration and shock during transportation, overloading, mis-handling, or the capability of any other laboratory to repeat the calibration. (A+A)*L shall not be liable for any loss or damage resulting from the use of the equipment.

Certificate No.: APJ18-086-CC001

Page 4 of 4

Contro 57-59 Au Pui Wan Street ,Fo	Tan, Shatin, N. I., Hong Kong
Room 422, Leader Industrial Centre, 57-59 Au Pui Wan Street, Fo Tel: (852) 2668 3423	Fax:(852) 2668 6946
	E-mail: inquiry@aa-lab.com
!!anago: http://www.aa-lab.com	E-mail : inquiry@da idoroom



CALIBRATION CERTIFICATE

Certificate Inform	nation		
Date of Issue	11-Sep-2018	Certificate Number MLCN18216	6S
Customer Inform	ation		

Customer Information

Company Name Address Acuity Sustainability Consulting Limited Unit 1908, Nos. 301-305 Castle Peak Road,

Kwai Chung, N.T.

Equipment-under-Test (EUT)

Description

Acoustic Calibrator

Manufacturer

Pulsar

Model Number Serial Number 105 63705

Equipment Number

Calibration Particular

Date of Calibration

11-Sep-2018

Calibration Equipment

4231(MLTE008) / AV180068 / 13-May-20

1357(MLTE190) / MLEC18/05/02 / 25-May-19

Calibration Procedure

MLCG00, MLCG15

Calibration Conditions

Laboratory Temperature

23 °C ± 5 °C 55% ± 25%

EUT

Relative Humidity Stabilizing Time

Over 3 hours

Warm-up Time

Not applicable

Power Supply

Internal battery

Calibration Results

Calibration data were detailed in the continuation pages.

Calibration result was out of EUT specification.

Approved By & Date

h

K.O. Lo

11-Sep-2018

Statements

- Calibration equipment used for this calibration are traceable to national / international standards.
- * The results on this Calibration Certificate only relate to the values measured at the time of the calibration and the uncertainties quoted will not include allowance for the EUT long term drift, variation with environmental changes, vibration and shock during transportation, overloading, mishandling, misuse, and the capacity of any other laboratory to repeat the measurement.
- * MaxLab Calibration Centre Limited shall not be liable for any loss or damage resulting from the use of the EUT.
- The copy of this Certificate is owned by MaxLab Calibration Centre Limited. No part of this Certificate may be reproduced without the prior written approval of MaxLab Calibration Centre Limited.

Page 1 of 2

萬儀校正中心有限公司 MaxLab Calibration Centre Limited



Certificate No.

MLCN182166S

Calibration Data				*
EUT Setting	Standard Reading	EUT Error from Setting	Calibration Uncertainty	EUT Specification
94 dB	93.6 dB	-0.4 dB *	0.20 dB	± 0.2 dB

- END -

Calibrated By: Date:


Dan 11-Sep-18 Checked By:

Date:

K.O. Lo 11-Sep-18

Page 2 of 2

萬 儀 校 正 中 心 有 限 公 司 MaxLab Calibration Centre Limited 香港新界葵涌華星街 16-18 號保盈工業大廈 9 樓 B2 室 Unit B2, 9/F., Boldwin Industrial Bldg., 16-18 Wah Sing Street, Kwai Chung, N.T., Hong Kong Tel: (852) 2116 1380 Fax: (852) 2264 6480 Email: info@maxlab.com.hk

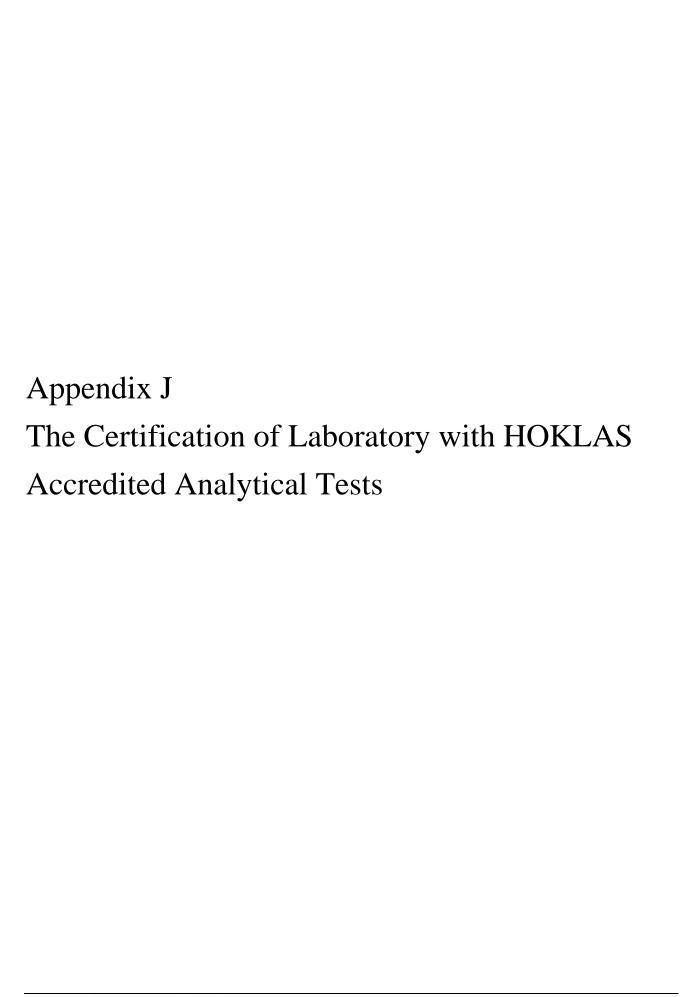



Hong Kong Accreditation Service 香港認可處

Certificate of Accreditation

認可證書

This is to certify that 特此證明

ALS TECHNICHEM (HK) PTY LIMITED

11/F., Chung Shun Knitting Centre, 1-3 Wing Yip Street, Kwai Chung, New Territories, Hong Kong 香港新界葵涌永業街1-3號忠信針織中心11樓

has been accepted by the HKAS Executive, on the recommendation of the Accreditation Advisory Board, as a 為香港認可處執行機關根據認可諮詢委員會建議而接受的

> **HOKLAS Accredited Laboratory** 「香港實驗所認可計劃」認可實驗所

This laboratory meets the requirements of ISO / IEC 17025 : 2005 - General requirements for the competence 此實驗所符合ISO / IEC 17025: 2005 - (測試及校正實驗所能力的通用規定)所訂的要求 of testing and calibration laboratories and it has been accredited for performing specific tests or calibrations as 機認可進行截於香港實驗所認可計劃(認可實驗所名冊)內下溫測試類別中的指定 listed in the HOKLAS Directory of Accredited Laboratories within the test category of 测试或校正工作

Environmental Testing 環境測試

This laboratory is accredited in accordance with the recognised international Standard ISO / IEC 17025; 2005. 本實驗所乃根據公額的國際標準 ISO / IEC 17025; 2005 獲得認可。 This accreditation demonstrates technical competence for a defined scope and the operation of a laboratory 透明認可資格源示在核定觀釋所需的技術能力及實驗所質量管理關系的運作 quality management system (see joint IAF-ILAC-ISO Communiqué), (見國際認可論權、國際實驗所認可含作組織及國際標準化組織的聯合公報)。

The common seal of the Hong Kong Accreditation Service is affixed hereto by the authority of the HKAS Executive 香港認可處根據認可處執行機關的權限在此蓋上通用印章

CHAN Sing Sing, Terence, Executive Administrator

執行幹事 陳成城 Issue Date: 5 May 2009 簽發日期:二零零九年五月五日

Registration Number : NORMAS 066

Date of First Registration: 15 September 1995 首次註冊日期:一九九五年九月十五日

This certificate is issued subject to the terms and conditions laid down by HKAS 本證書按照香港語可應訂立的提款及條件發出

L 000552



Hong Kong Accreditation Service 香港認可處

Certificate of Accreditation

認可證書

This is to certify that 特此證明

ACUMEN LABORATORY AND TESTING LIMITED

浩科檢測中心有限公司

Lot 12, Tam Kon Shan Road, North Tsing Yi, New Territories, Hong Kong 香港新界青衣北担杆山路12路段

has been accepted by the HKAS Executive, on the recommendation of the Accreditation Advisory Board, as a 在認可諮詢委員會的建議下獲香港認可處執行機關接受為

HOKLAS Accredited Laboratory

「香港實驗所認可計劃」認可實驗所

This laboratory meets the requirements of ISO/IEC 17025:2005 and it has been accredited for performing specific tests or calibrations as listed in the scope of accreditation within the test category of

Environmental Testing

此實驗所符合ISO/IEC 17025:2005所訂的要求 並獲認可進行載於認可範圍內下述測試類別中的指定測試或校正工作

環境測試

This accreditation to ISC/IEC 17025:2005 demonstrates technical competence for a defined scope and the operation of a laboratory quality management system (see joint IAF-ILAC-ISO Communiqué). 此項 ISO/IEC 17025:2005 的認可資格證明此實驗所具備指定範疇內所須的技術能力並 實施一套實驗所質量管理體系(見國際認可論壇、國際實驗所認可合作組織及國際標準化組織的聯合公報)。

The common seal of the Hong Kong Accreditation Service is affixed hereto by the authority of the HKAS Executive 現經香港認可處執行機關授權在此蓋上香港認可處的印章

WONG Wang-wah, Executive Administrator

執行幹事 黃宏華 Issue Date: 16 July 2014

簽發日期:二零一四年七月十六日

註冊號碼:


Registration Number : HOKLAS 241


Date of First Registration: 16 July 2014 首次註冊日期:二零一四年七月十六日

L 001195

This certificate is issued subject to the terms and conditions laid down by HKAS 本證書按照香港認可處訂立的條款及條件發出

Appendix K
Location Plan of Noise and Air Quality
Monitoring Station

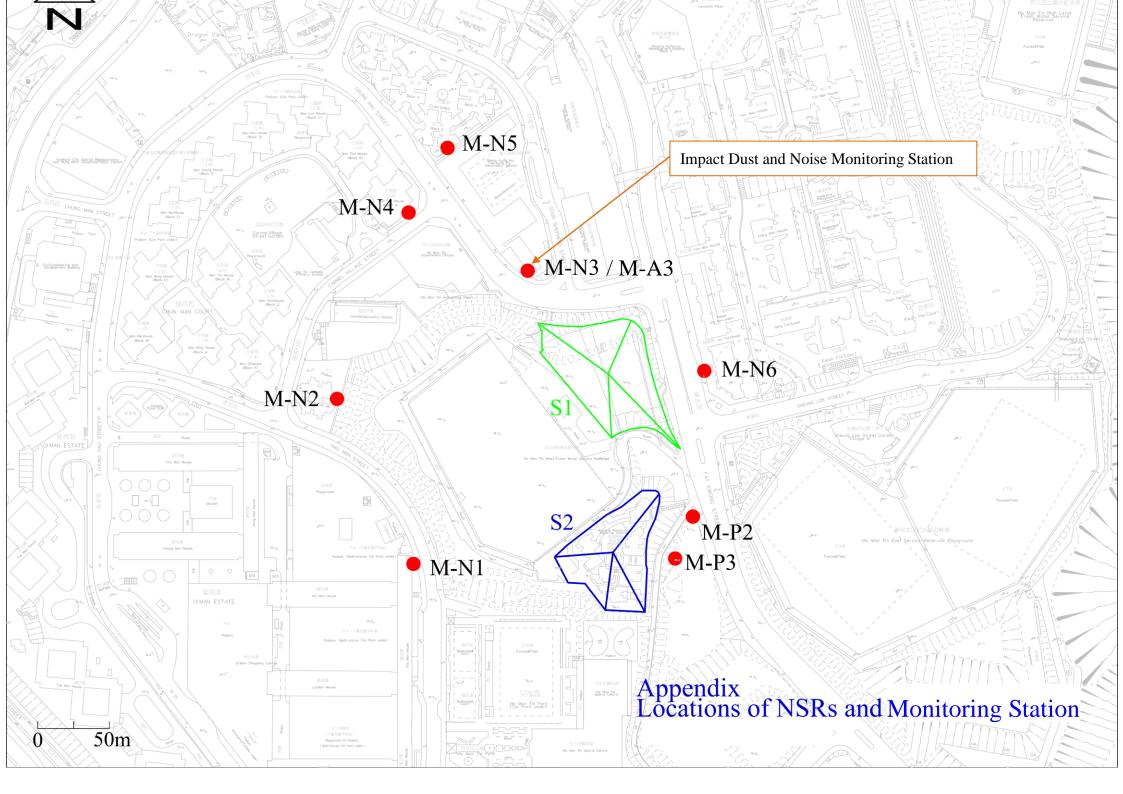

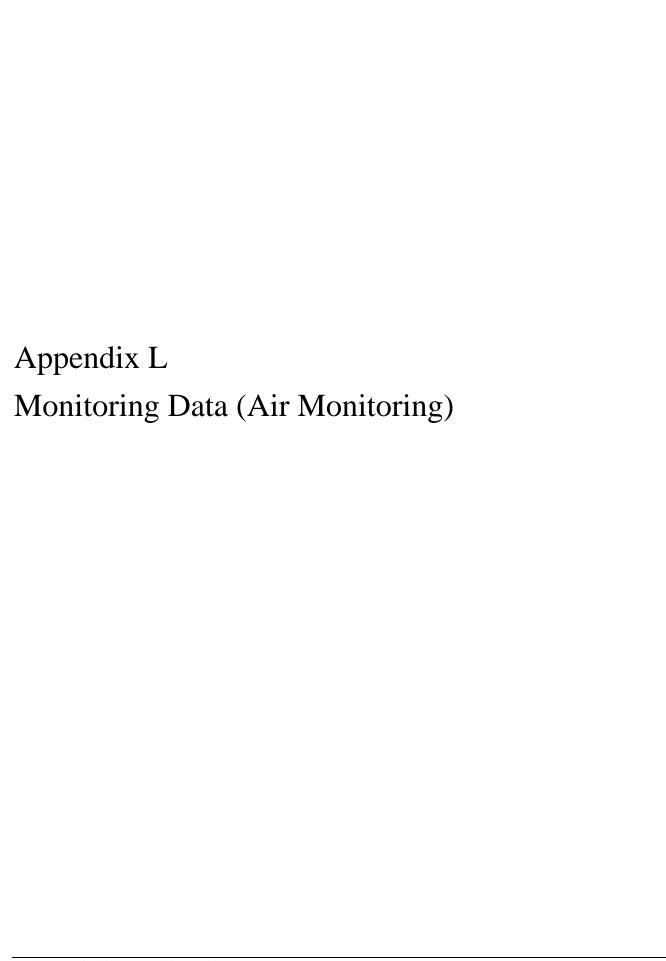


Location: SKH Tsoi Kung Po Secondary School

Monitoring date: 2, 6, 12, 17, 23, 25, 30 April 2019

Parameter: TSP 1-hour
Other Factors nearby traffic

	1-hour TSP (μg/m³)									
Date	Weather	Start Time	1 st Hour (μg/m³)	2 nd Hour (μg/m³)	3 rd Hour (μg/m³)					
2/4/2019	Sunny	9:02	58	62	54					
6/4/2019	Sunny	10:11	55	59	62					
12/4/2019	Sunny	9:56	67	63	65					
17/4/2019	Sunny	9:44	54	57	51					
23/4/2019	Sunny	9:16	59	55	60					
25/4/2019	Sunny	13:30	58	54	57					
30/4/2019	Cloudy	9:28	47	44	41					

Figure 1: Graphical Illustration of Measured 1-hour TSP ($\mu g/m^3$) Levels at M-N3

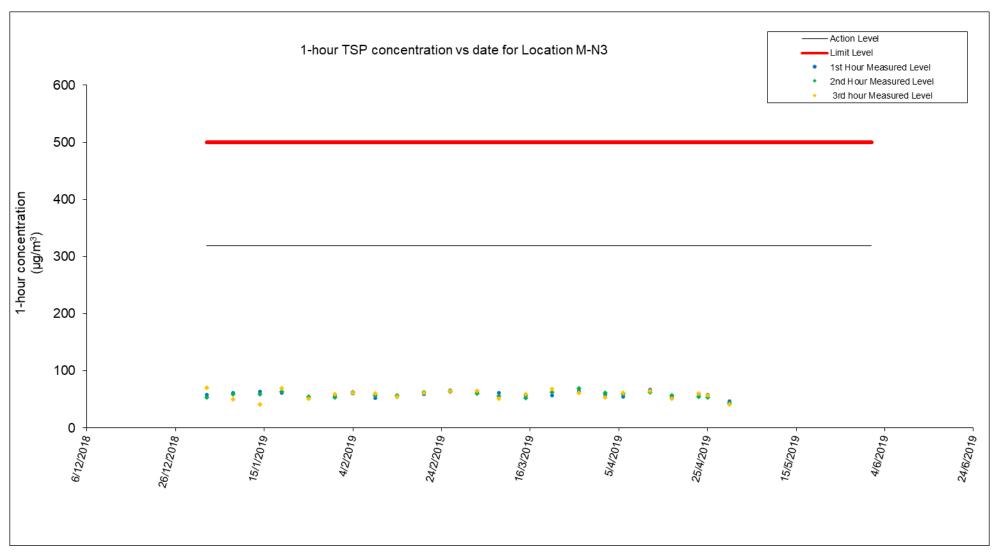

Location: SKH Tsoi Kung Po Secondary School

Monitoring date: 2, 6, 12, 17, 23, 25, 30 April 2019


Parameter: TSP 24-hour

Other Factors Nearby Traffic emissions

Date of Calibration:	27-Mar-19	Slope =	30.7585
Calibration due date:	11-Apr-19	Intercept =	4.7375
Date of Calibration:	12-Apr-19	Slope =	28.3563
Calibration due date:	27-Apr-19	Intercept =	6.972
Date of Calibration:	30-Apr-19	Slope =	28.4948
Calibration due date	15-May-19	Intercent =	7 167


Start Date	Weather Condition		Elapse Tim	ne	C	Chart Readin	g	Avg Air Temp	Avg Atmospher ic Pressure		Standard Air Volume	Filter Weight (g)	Particulate weight	Conc.
		Initial	Final	Actual (min)	Min	Max	Avg	(°C)	(mm Hg)	(m³/min)	(m^3)	Initial	Final	(g)	$(\mu g/m^3)$
2/4/2019	Sunny	1750.2	1774.2	1440.0	48	49	48.5	20.7	1018.2	1.97	2842	2.7323	2.9355	0.2032	71
6/4/2019	Sunny	1774.2	1798.2	1440.0	46	47	46.5	25.1	1013.0	1.86	2679	2.7521	2.8604	0.1083	40
12/4/2019	Sunny	1798.5	1822.5	1440.0	47	47	47.0	22.3	1013.3	1.97	2843	2.7381	2.8758	0.1377	48
17/4/2019	Sunny	1822.5	1846.5	1440.0	48	49	48.5	23.5	1012.2	2.04	2934	2.7291	2.8138	0.0847	29
23/4/2019	Sunny	1846.6	1870.6	1440.0	48	50	49.0	28	1010.4	2.04	2938	2.7634	2.8761	0.1127	38
25/4/2019	Sunny	1870.6	1894.6	1440.0	47	49	48.0	28.5	1009.3	1.99	2864	2.7671	3.1412	0.3741	131
30/4/2019	Cloudy	1894.9	1918.9	1440.0	48	48	48.0	26.7	1008.0	1.98	2846	2.7578	2.9241	0.1663	58

Figure 2: Graphical Illustration of Measured 24-hour TSP (μg/m³) Levels at M-N3

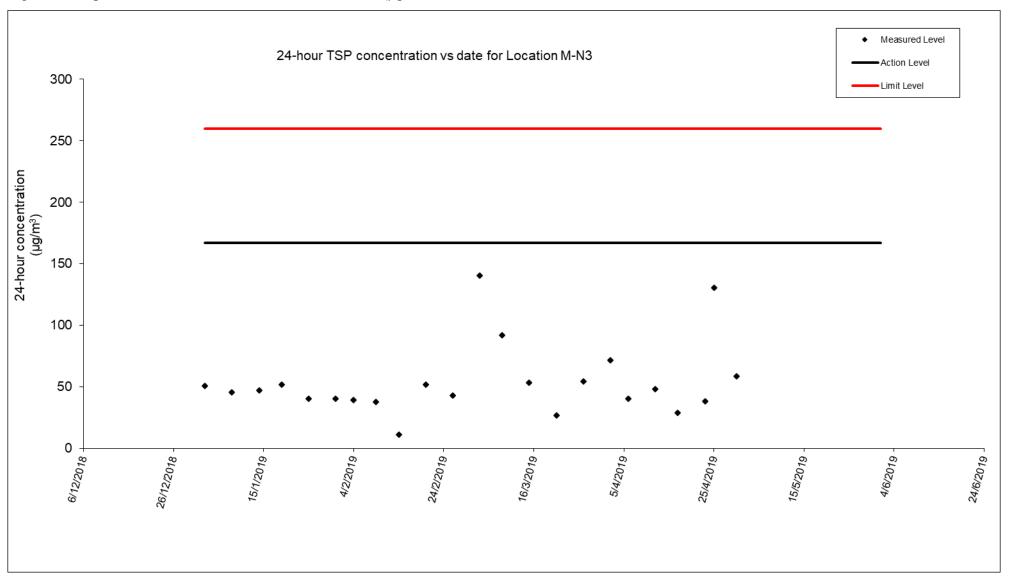


Wind speed data for 2, 3, 6, 7, 12, 13, 17, 18, 23, 24, 25, 26, 30 April 2019 and 1 May 2019

Wind Speed:

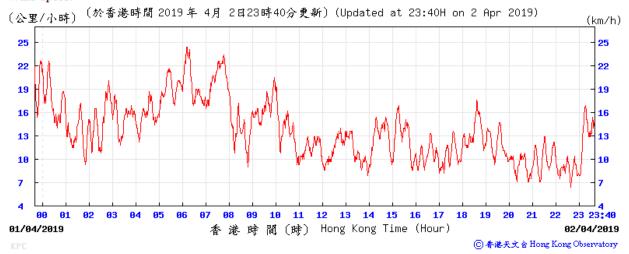





Wind Speed:

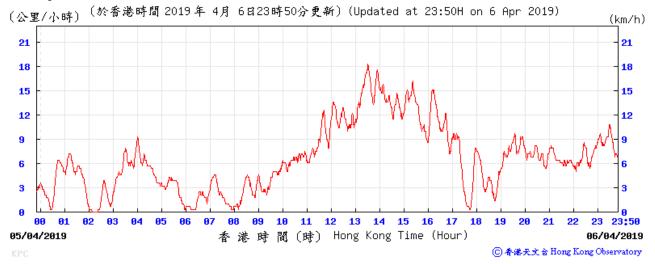


Wind Speed:

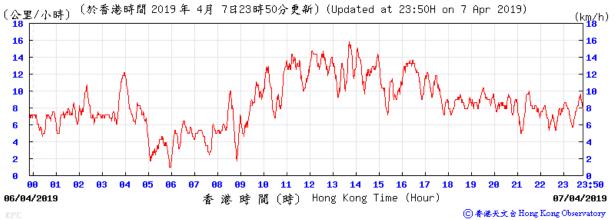


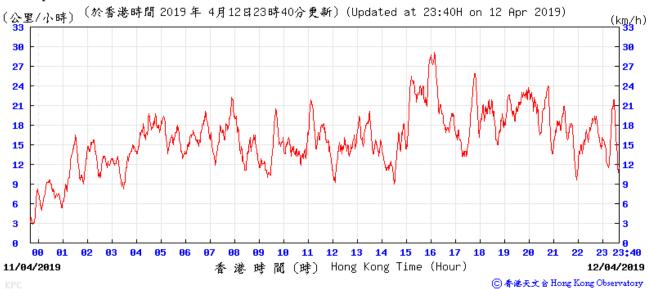


Wind Speed:

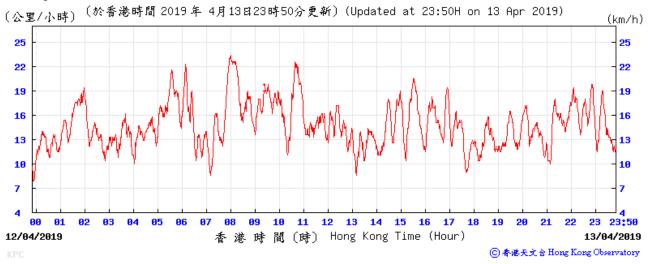


Wind Speed:

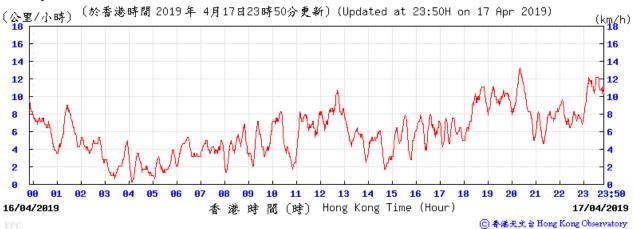


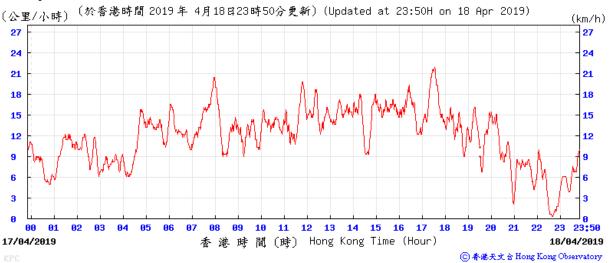


Wind Speed:



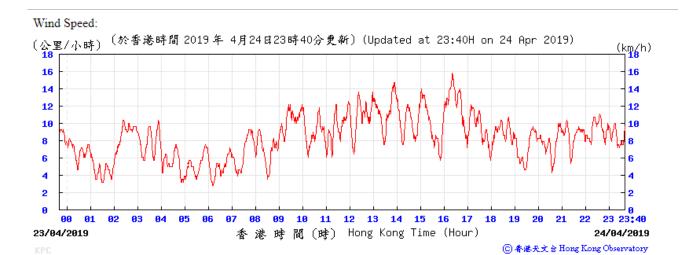


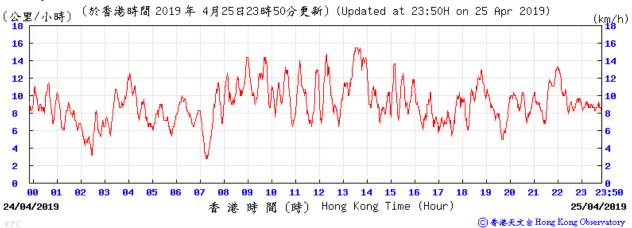

Wind Speed:

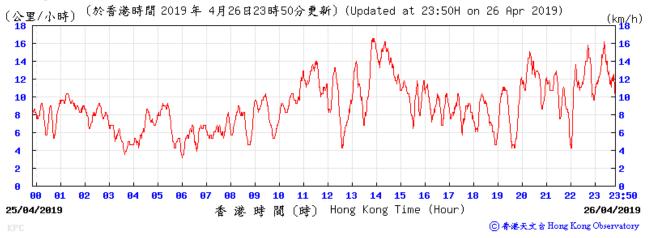

Wind Speed:

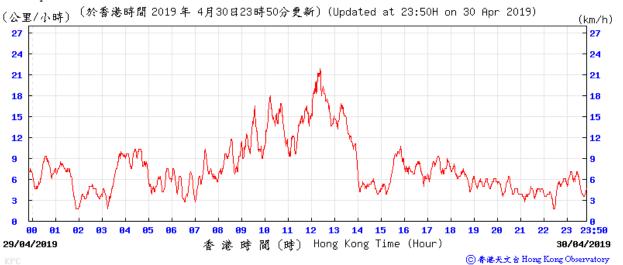


Wind Speed:




Wind direction data for 2, 3, 6, 7, 12, 13, 17, 18, 23, 24, 25, 26, 30 April 2019 and 1 May 2019

Wind Direction:

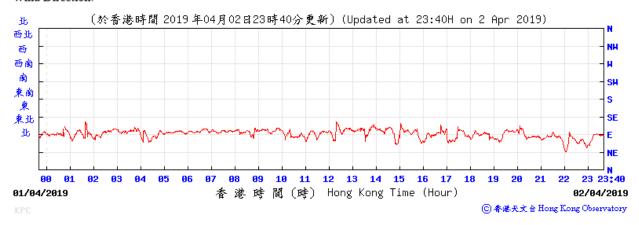


Wind Direction:

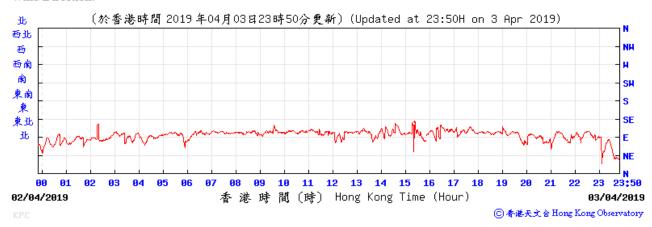








Wind Direction:

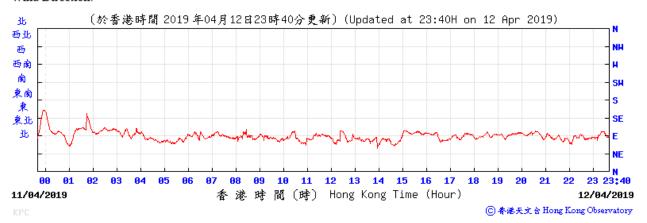


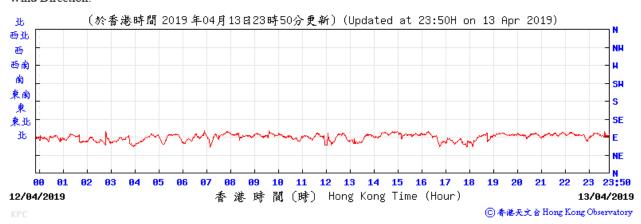


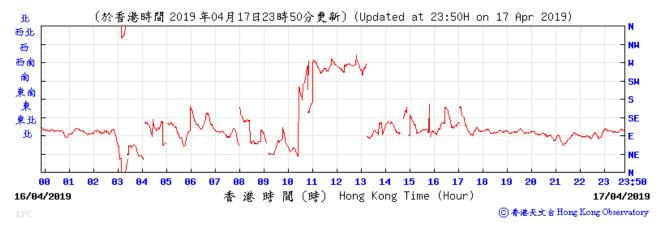


Wind Direction:

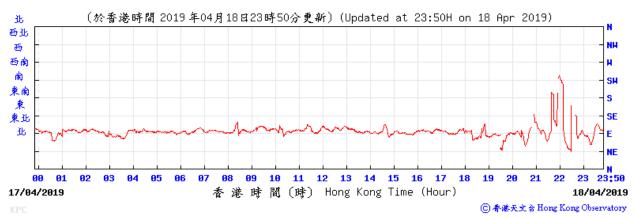


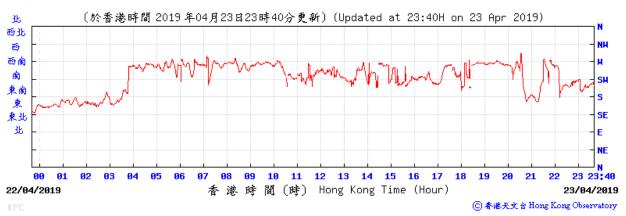

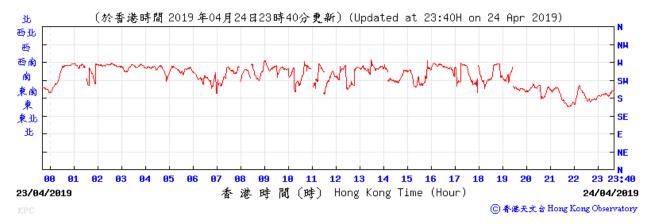


Wind Direction:

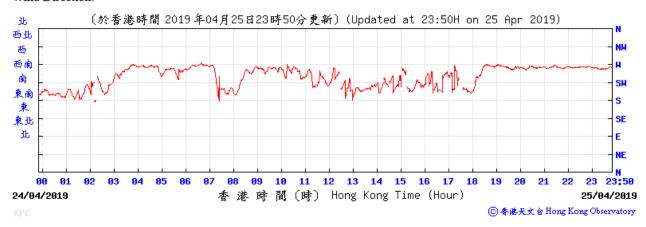

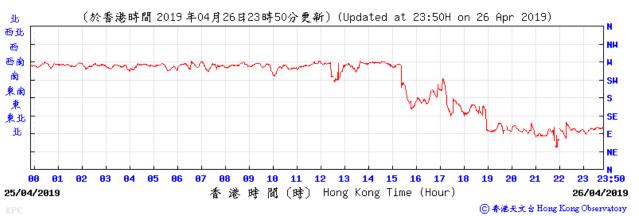



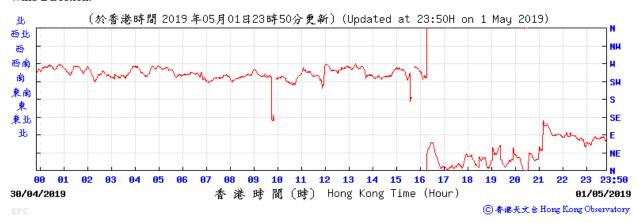

Appendix M
Monitoring Data (Noise)

Location: SKH Tsoi Kung Po Secondary School

Monitoring date: 2, 6, 12, 17, 23, 25, 30 April 2019

 $\begin{array}{ll} \text{Parameter}: & L_{\text{eq}}, L_{10}, \ L_{90} \\ \\ \text{Other Factors} & \text{nearby traffic} \end{array}$


Noise Monitoring data:

Date	Weather	Start Time -	End Time	$L_{ m Aeq}$ *	$L_{10}*$	L ₉₀ *	Wind speed	
							(m/s)	
2/4/2019	Sunny	9:03	-	9:33	67.3	69.2	65.4	4.4
6/4/2019	Sunny	10:11	-	10:41	67.0	69.9	65.5	1.9
12/4/2019	Sunny	9:56	-	10:26	65.8	68.0	64.1	4.5
17/4/2019	Sunny	9:44	-	10:14	66.2	69.0	64.4	1.6
23/4/2019	Sunny	9:17		9:47	67.1	69.2	65.2	3.0
25/4/2019	Sunny	13:30	-	14:00	65.7	68.7	63.6	3.8
30/4/2019	Cloudy	9:28	-	9:58	65.8	68.3	63.7	3.5

Remarks:

1. * Free Field Noise levels were adjusted with a correction of +3 dB(A).



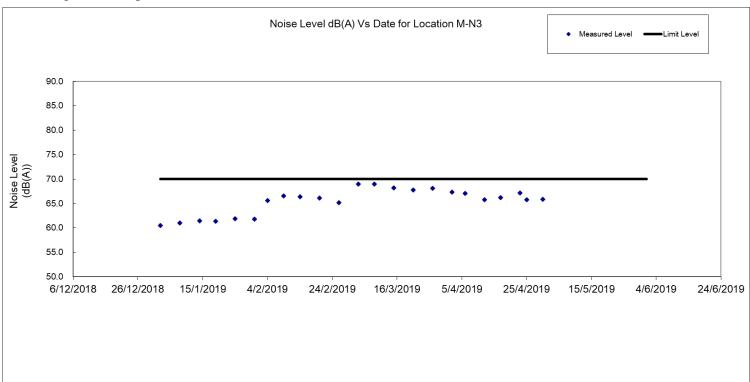

Appendix N Waste Flow Table

Monthly Summary Waste Flow Table

Name of Department: Highways Department Monthly Summary Waste Flow Table for April 2019

[to be submitted not later than the 15th day of each month following reporting month]

Contract No. / Works Order No.: <u>HY/2014/09</u>

(All quantities shall be rounded off to 2 decimal places.)

	Actual Quantities of <u>Inert</u> Construction Waste Generated Monthly						
Month	(a)=(b)+(c)+(d)+(e) Total Quantity Generated	(b) Hard Rock and Large Broken Concrete	(c) Reused in the Contract	(d) Reused in other Projects	(e) Disposed of as Public Fill	Imported Fill	
	(in '000m ³)	(in '000m ³)	(in '000m ³)	(in '000m ³)	(in '000m ³)	(in '000m ³)	
Jan	4.507	0.755	0.000	0.000	3.752	0.000	
Feb	5.032	0.242	0.000	0.000	4.790	0.000	
Mar	7.887	0.148	0.000	0.000	7.739	0.000	
Apr	3.591	0.251	0.000	0.000	3.340	0.000	
May							
Jun							
Sub-total*	21.017	1.396	0.000	0.000	19.621	0.000	
Jul							
Aug							
Sep							
Oct							
Nov							
Dec							
Sub-total*	21.017	1.396	0.000	0.000	19.621	0.000	

	Actual Quantities of Non-inert Construction Waste Generated Monthly								
Month	Metals		Paper/ cardboard packaging		Plastics		Chemical Waste		Others, e.g. General Refuse disposed at Landfill
	(in '0	00kg)	(in '0	00kg)	(in '00	00kg)	(in '000kg)		(in '000m ³)
	generated	recycled	generated	recycled	generated	recycled	generated	recycled	generated
Jan	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.003
Feb	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.002 0.002 (yard waste for recycle)
Mar	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.004 0.003 (yard waste for recycle)
Apr	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.007
May									
Jun									
Sub-total	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.021
Jul									
Aug									
Sep									
Oct									
Nov									
Dec									
Total	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.021

Appendix O
Statistics on Complaint, Notifications of
Summons and Successful Prosecutions

Statistical Summary of Exceedances

	Air Quality						
Location	Action Level	Limit Level	Total				
M-A3	0	0	0				
	Noise						
Location	Action Level	Limit Level	Total				
M-N3	0	0	0				

Statistical Summary of Environmental Complaints


Reporting	Environmental Complaint Statistics						
Period	Period Frequency Cumulative Comp						
1 Apr 2019 - 30 Apr 2019	0	1	N/A				

Statistical Summary of Environmental Summons

Reporting	Environmental Summons Statistics						
Period	Frequency	Cumulative	Details				
1 Apr 2019 - 30 Apr 2019	0	0	N/A				

Statistical Summary of Environmental Prosecution

Reporting	Environmental Prosecution Statistics						
Period	Frequency	Cumulative	Details				
1 Apr 2019 - 30 Apr 2019	0	0	N/A				

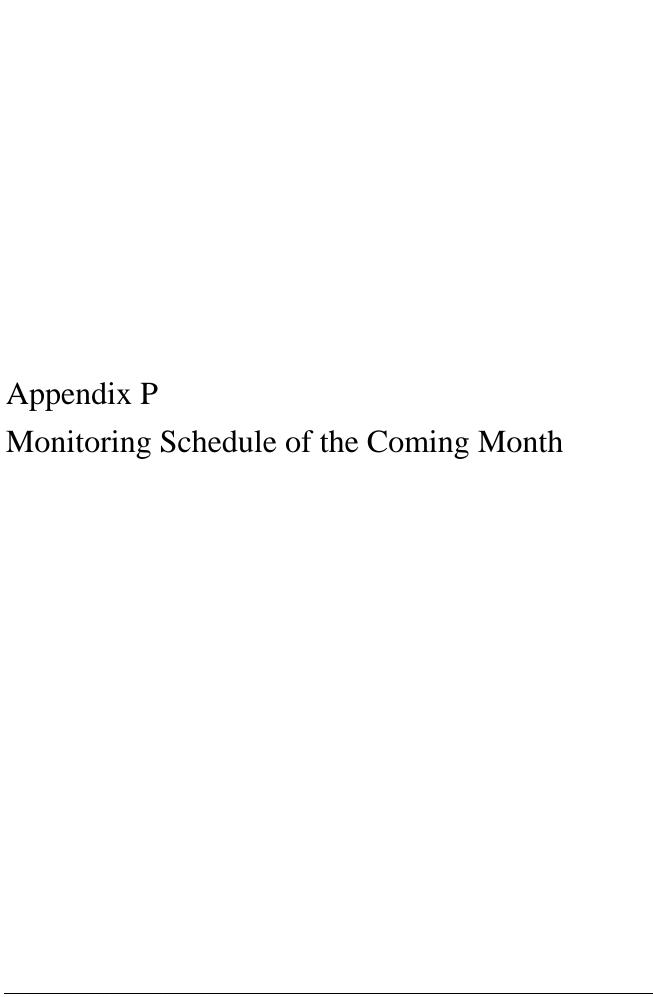

	Impact Monitoring Schedule for HMTS							
	May-19							
Sun	Mon	Tue				Sat		
			1	2	3	4		
5	6	7	8	9	10	11		
	Impact					Impact		
	TSP-1hr & TSP-24hr monitoring for M-A3					TSP-1hr & TSP-24hr monitoring for M-A3		
	Noise monitoring for					Noise monitoring for		
	M-N3					M-N3		
12	13	14	15		17	18		
				Impact				
				TSP-1hr & TSP-24hr monitoring for M-A3				
				Noise monitoring for				
				M-N3				
19	20	21		23	24	25		
			Impact					
			TSP-1hr & TSP-24hr monitoring for M-A3					
			13F-11II & 13F-24III IIIOIIIIOIIII IOI IVI-A3					
			Noise monitoring for					
			M-N3					
26	27		29	30	31			
		Impact						
		TSP-1hr & TSP-24hr monitoring for M-A3						
		131 IIII & 131-24III IIIOIIIIOIIIIg IOI WI-AS						
		Noise monitoring for						
		M-N3						
		<u> </u>						